



City of East Palo Alto
ADA Transition Plan

Final Report – February 2019

Appendix: D

City Facilities Detail Summary

Table of Contents

1790 Bay Road	1
Bell Street Park.....	19
City Hall - Offices	35
Community & Economic Development Department.....	178
Cooley Landing Park & Educational Center	249
Gloria Well	295
Jack Farrell Park	298
Joel Davis Park.....	350
Maintenance Yard.....	363
Martin Luther King Jr. Park	428
Newbridge Pocket Park.....	502
Pad "D"	505
Parole Reentry Nonprofit Office/Water Building	512
Police Department-Office	558
Police Department-Office-3 Coaches.....	625
Rail Spur Trail	808
Senior Center	817
Vacant Land.....	900
Vacant Lot - Corner of Bay Road & University Avenue.....	903
Vacant Lot - Corner of Purdue Avenue & Fordham Street	907

Accessibility Survey



1790 Bay Road

1790 Bay Road
East Palo Alto, CA 94303

Date of Inspection

11/12/2017

Prepared By

Disability Access Consultants

1790 Bay Road

Parking - Exterior : Parking Lot , Parking Lot

Parking Lot

Finding

There is no device at the head of the general parking spaces to prevent vehicles from encroaching into walkways.

On-Site Finding None Found

Recommendation

Install a wheel stop at the head of the general parking spaces.

Recommendation See Recommendation

Code Reference ADA 502, 502.7, CA 11B-502.7.2

Record Number 88193

1790 Bay Road

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 88207

1790 Bay Road

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Center Accessible Space

Finding

There is no vertically-mounted signage at the designated accessible parking space showing the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Provide a permanently posted reflectorized sign that includes an International Symbol of Accessibility symbol at the head of the parking space. The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign.

Recommendation See Recommendation

Code Reference ADA 502, 502.6, 703.7.2.1, CA 11B-502.6, 703.7.2.1

Record Number 88195

1790 Bay Road

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Center Accessible Space

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 88197

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Center Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 88196

1790 Bay Road

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Center Accessible Space

Finding

The accessible parking space does not meet the minimum requirements for width.

On-Site Finding 107.00 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 108.00 inches

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 88194

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Right Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 88200

1790 Bay Road

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Right Accessible Space

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 88198

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Right Accessible Space

Finding

There is no vertically-mounted signage at the designated accessible parking space showing the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Provide a permanently posted reflectorized sign that includes an International Symbol of Accessibility symbol at the head of the parking space. The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign.

Recommendation See Recommendation

Code Reference ADA 502, 502.6, 703.7.2.1, CA 11B-502.6, 703.7.2.1

Record Number 88199

1790 Bay Road

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

There is no vertically-mounted signage at the designated accessible parking space showing the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Provide a permanently posted reflectorized sign that includes an International Symbol of Accessibility symbol at the head of the parking space. The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign.

Recommendation See Recommendation

Code Reference ADA 502, 502.6, 703.7.2.1, CA 11B-502.6, 703.7.2.1

Record Number 88202

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 88201

1790 Bay Road

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Left Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 88203

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 88206

1790 Bay Road

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 2.40 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 88205

Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone

Finding

There is no required striped access aisle adjacent to the passenger loading zone.

On-Site Finding None Found

Recommendation

Create an access aisle to meet the required minimum width and length adjacent and parallel to the vehicle pull-up space. The access aisle striping for the passenger loading zone shall provide immediate access to an adjacent curb ramp or primary path of travel.

Recommendation See Recommendation

Code Reference ADA 502, 503, 503.3, CA 11B-503.3

Record Number 88209

1790 Bay Road

Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone

Finding

Passenger loading zone has no sign.

On-Site Finding Not Marked

Recommendation

Mark the passenger loading zone with ISA symbol of accessibility.

Recommendation See Recommendation

Code Reference ADA 503.3.3, CA 11B-503.6, 703.5, 703.7.2.1

Record Number 88210

Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone

Finding

There are curbs between the access aisle and the vehicle pull-up space.

On-Site Finding Curbs Exists

Recommendation

Remove curbs or install compliant curb ramp to provide accessible path of travel from the vehicle pull-up space and the access aisle.

Recommendation See Recommendation

Code Reference ADA 502, 503, 503.4, CA 11B-206.2.1, 303.4, 503.4

Record Number 88208

1790 Bay Road

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Right Accessible Space

Finding

The curb ramp projects into vehicular traffic lanes, parking spaces, or parking access aisles.

On-Site Finding Projects

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 406, 406.4, 406.5

Record Number 88211

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Right Accessible Space

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 10.50 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Code Reference ADA 406, 406.3, CA 11B-406.2.2

Record Number 88213

1790 Bay Road

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Right Accessible Space

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 88212

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Left Accessible Space

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 88215

1790 Bay Road

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Left Accessible Space

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.10 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Code Reference ADA 406, 406.3, CA 11B-406.2.2

Record Number 88216

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Left Accessible Space

Finding

The curb ramp projects into vehicular traffic lanes, parking spaces, or parking access aisles.

On-Site Finding Projects

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 406, 406.4, 406.5

Record Number 88214

1790 Bay Road

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp at the Left Accessible Space

Bottom Landing

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 88217

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

Path of Travel from the Public Right of Way at Bay Road

Tree Limb

Finding

The vertical clearance height is less than required.

On-Site Finding 52.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 87732

1790 Bay Road

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 87731

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 4.60 percent for 30.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 87730

1790 Bay Road

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

Sidewalk Next to Parking Lot

Tree Limb

Finding

The vertical clearance height is less than required.

On-Site Finding 52.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 88219

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk Next to Parking Lot

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.90 percent for 30.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 88218

1790 Bay Road

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 87735

Accessibility Survey



Bell Street Park

2159 University Avenue
East Palo Alto, CA 94303

Date of Inspection

11/3/2017

Prepared By

Disability Access Consultants

Bell Street Park

Path of Travel - Exterior : Path Of Travel

**Path of Travel from YMCA Parking Lot
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 85182

Bell Street Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from YMCA Parking Lot
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.70 percent for 60.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 85181

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from YMCA Parking Lot
Appurtenance**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 85183

Bell Street Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel Around Play Area

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Bevel the area or resurface the area to provide a smooth and level path of travel.

Recommendation Up to 0.50 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 85193

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Euclid Avenue - Continued
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 85194

Bell Street Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from Parking Lots to Park

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 85198

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from Parking Lots to Park

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.10 percent for 180.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 85196

Bell Street Park

Path of Travel - Exterior : Path Of Travel

**Path from Parking Lots to Park
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 85197

Path of Travel - Exterior : Path Of Travel

**Path of Travel from Senior Center Parking Lot
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 85199

Bell Street Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at University Avenue
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 85200

Doors - Exterior : Door , Clear Floor Space

Park Gate Next to Skate Park

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 3.10 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 85176

Bell Street Park

Doors - Exterior : Door , Latch Side Clearance

Park Gate Next to Skate Park

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 23.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 85175

Doors - Exterior : Door , Hardware

Park Gate Next to Skate Park

Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 85174

Bell Street Park

Doors - Exterior : Door , Clear Floor Space

Gate Next to University Avenue

Push Side

Finding

There is no level landing at this door.

On-Site Finding 2.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 85203

Doors - Exterior : Door , Clear Floor Space

Gate Next to University Avenue

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.40 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 85204

Bell Street Park

Doors - Exterior : Door , Hardware

Gate Next to University Avenue

Push Bar / Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 85201

Doors - Exterior : Door , Clear Floor Space

Skate Park Entrance

Push Side

Finding

There is no level landing at this door.

On-Site Finding 5.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 85206

Bell Street Park

Doors - Exterior : Door , Clear Floor Space

Skate Park Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.80 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 85207

Doors - Exterior : Door , Hardware

Skate Park Entrance

Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 85205

Bell Street Park

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 85195

Play Area - Exterior : Play Area

Play Area

Finding

Clear space around stationary equipment is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear space around stationary equipment for the play area.

Recommendation At least 72.00 inches

Code Reference ADA 1008.2.6.2

Record Number 85576

Bell Street Park

Play Area - Exterior : Play Area , Elevated or Ground Equipment or Play Table

Play Area

Train Slide - Fibar

Finding

The vertical clearance height on route to the transfer platform/play equipment is not compliant.

On-Site Finding 56.12 inches

Recommendation

Provide compliant vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 1008, 1008.2, 307.4

Record Number 85187

Play Area - Exterior : Play Area , Elevated or Ground Equipment or Play Table

Play Area

Swings - Rubberized Surface

Finding

The width of the route to the transfer platform/play equipment is not compliant.

On-Site Finding 42.00 inches

Recommendation

Modify the width of the route to the transfer platform/play equipment.

Recommendation At least 60.00 inches

Code Reference ADA 1008, 1008.2.4.1

Record Number 85189

Bell Street Park

Play Area - Exterior : Play Area , Elevated or Ground Equipment or Play Table

Play Area

Bucket Swings - Rubberized Surface

Finding

The width of the route to the transfer platform/play equipment is not compliant.

On-Site Finding 53.00 inches

Recommendation

Modify the width of the route to the transfer platform/play equipment.

Recommendation At least 60.00 inches

Code Reference ADA 1008, 1008.2.4.1

Record Number 85191

Picnic Areas - Exterior : Picnic Tables

Picnic Table in Skate Park

Finding

At least 5% of the provided tables are not accessible.

On-Site Finding None Found

Recommendation

Provide enough compliant Accessible Tables (At least 5% of the total Tables).

Recommendation At least 1.00 tables

Code Reference ADA 205, 226.1, 228, 305, 306, 308, 309, 902

Record Number 85575

Bell Street Park

Picnic Areas - Exterior : Picnic Tables

Picnic Tables Next to Play Area

Finding

At least 5% of the provided tables are not accessible.

On-Site Finding None Found

Recommendation

Provide enough compliant Accessible Tables (At least 5% of the total Tables).

Recommendation At least 1.00 tables

Code Reference ADA 205, 226.1, 228, 305, 306, 308, 309, 902

Record Number 85184

Benches - Exterior : Bench

Benches Next to Play Area

Finding

No clear floor space provided at the bench.

On-Site Finding Not Found

Recommendation

Provide compliant clear floor space for the bench at one end.

Recommendation See Recommendation

Code Reference ADA 305, 903.2 , CA 11B-305, 903.2

Record Number 85180

Bell Street Park

Benches - Exterior : Bench

Benches Next to Play Area

Finding

The bench is not on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the benches.

Recommendation See Recommendation

Code Reference ADA 205, 228, 305, 308, 309, 903

Record Number 85179

Accessibility Survey



City Hall - Offices

2415 University Avenue
East Palo Alto, CA 94303

Date of Inspection

10/11/2017

Prepared By

Disability Access Consultants

City Hall - Offices

Parking - Exterior : Parking Lot , Warning Signage

Covered Parking

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding None Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 70138

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Covered Parking

Finding

There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.

On-Site Finding None Found

Recommendation

Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".

Recommendation See Recommendation

Code Reference ADA 208, 208.2, CA 11B-208.2, 502

Record Number 70137

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.

On-Site Finding Incorrect Wording

Recommendation

Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8.2

Notes : Sign is Positioned So That It Faces Exiting Traffic.

Record Number 70190

City Hall - Offices

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

2nd Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 70169

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

2nd Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 4.90 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70168

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

2nd Accessible Space from Left

Finding

The designated accessible parking space does not provide accessible signage at the head of the space.

On-Site Finding None Found

Recommendation

Provide a permanently posted reflectorized sign that includes an International Symbol of Accessibility symbol at the head of the parking space. The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign.

Recommendation See Recommendation

Code Reference ADA 502, 502.6

Record Number 70170

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

5th Accessible Space from Left

Finding

The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.

On-Site Finding None Found

Recommendation

Paint "NO PARKING" in 12 inch white letters.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 70174

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

5th Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 4.50 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70171

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

5th Accessible Space from Left

Finding

The access aisle exceeds maximum slope.

On-Site Finding 3.80 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70173

City Hall - Offices

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

5th Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 70172

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

4th Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 70175

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

4th Accessible Space from Left

Finding

The designated accessible parking space does not provide accessible signage at the head of the space.

On-Site Finding None Found

Recommendation

Provide a permanently posted reflectorized sign that includes an International Symbol of Accessibility symbol at the head of the parking space. The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign.

Recommendation See Recommendation

Code Reference ADA 502, 502.6

Record Number 70176

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

6th Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 70178

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

6th Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.90 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70177

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 3.90 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70179

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

The access aisle exceeds maximum slope.

On-Site Finding 4.40 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70182

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

3rd Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 70180

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 70183

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 94.17 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 96.00 inches

Code Reference CA 11B-502.2

Record Number 70181

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.

On-Site Finding None Found

Recommendation

Paint "NO PARKING" in 12 inch white letters.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 70189

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 70188

City Hall - Offices

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

1st Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 70185

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The access aisle exceeds maximum slope.

On-Site Finding 5.70 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70187

City Hall - Offices

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 4.90 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 70184

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 59.00 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 60.00 inches

Code Reference ADA 502, 502.3.1, CA 11B-502.3.1

Record Number 70186

City Hall - Offices

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to the Main Entrance

Finding

The cross slope is greater than allowed.

On-Site Finding 2.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 405.3, 406.1, CA 11B-406.5.7

Record Number 70056

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to the Main Entrance

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 70055

City Hall - Offices

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp Next to the Main Entrance

Bottom Landing

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 2.50 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 70057

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp Next to the Main Entrance

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.30 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 70058

City Hall - Offices

Path of Travel - 1st Floor : Path Of Travel , Walking Surfaces

Council Chambers

Floor Mat

Finding

The mats or carpet runners do not adhere to the underlying floor surface and slip, thereby creating a hazardous path of travel.

On-Site Finding Not Accessible

Recommendation

Securely fasten the mats or carpet runners or replace with a mat or carpet runner that grips to the underlying floor surface to provide a firm, stable, continuous and relatively smooth path of travel surface. Mats or carpet runners along the primary path of travel shall provide beveled edges on all sides to prevent roll over.

Recommendation See Recommendation

Code Reference ADA 302, 302.2, CA 11B-302, 403.2

Record Number 70150

Path of Travel - 1st Floor : Path Of Travel , Walking Surfaces

Path of Travel from Ramp to Council Member Dais

Interior Corridor

Finding

The width of the path of travel is insufficient.

On-Site Finding 33.00 inches for 8.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 36.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Notes : Workstation Reduces Walking Surface Width.

Record Number 70154

City Hall - Offices

Path of Travel - 2nd Floor : Path Of Travel , Walking Surfaces

City Hall Offices Reception

Floor Mat

Finding

The carpeting is loose and bulging and not securely fastened to the underlying surface, thereby creating a hazardous path of travel.

On-Site Finding Not Accessible

Recommendation

Securely stretch and fasten the carpeting or replace the carpeting to provide a firm, stable, continuous and relatively smooth path of travel surface.

Recommendation See Recommendation

Code Reference ADA 302, 302.2, CA 11B-302.2, 403.2

Record Number 69504

Path of Travel - 2nd Floor : Path Of Travel , Drop Offs

2nd Floor Lobby

Curb

Finding

The curb height is not compliant.

On-Site Finding 3.50 inches

Recommendation

Provide a curb with a compliant height.

Recommendation At least 6.00 inches

Code Reference CA 11B-303.5

Record Number 70222

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from the Public Right of Way at Bay Road
Vehicular Traffic**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 70026

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 70024

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road
Curb**

Finding

There is a curb on the designated path of travel.

On-Site Finding Curb Found

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 206, 302, 303, 303.4, 402, 403.4, 406

Record Number 70025

Path of Travel - Exterior : Path Of Travel

**Path of Travel from the Public Right of Way at Bay Road
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 70023

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 4.30 percent for 125.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 70022

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from the Accessible Spaces
Sidewalk Adjoins Access Aisle**

Finding

The pedestrian route adjoins vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5

Record Number 71149

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

**Path of Travel from the Public Right of Way at Bay Road - Continued
Tree Limb**

Finding

The vertical clearance height is less than required.

On-Site Finding 74.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 71193

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

**Path of Travel from the Public Right of Way at Bay Road - Continued
Tree Limb**

Finding

The vertical clearance height is less than required.

On-Site Finding 57.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 71194

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

**Path of Travel from the Public Right of Way at Bay Road - Continued
Tree Limb**

Finding

The vertical clearance height is less than required.

On-Site Finding 72.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 71195

Path of Travel - Exterior : Path Of Travel

**Path of Travel from the Public Right of Way at Bay Road - Continued
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 71190

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road - Continued
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 71191

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road - Continued
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Bevel the area or resurface the area to provide a smooth and level path of travel.

Recommendation Up to 0.50 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 71192

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road - Continued
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.50 percent for 189.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 71189

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from Covered Parking
Crosswalk from the Access Aisle**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 71219

City Hall - Offices

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from Covered Parking
Crosswalk from the Public Right of Way**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 71220

Ramps - 1st Floor : Ramp , Ramp Run

**Ramp to Council Chambers Dais
Run 1**

Finding

The width of the ramp is less than required.

On-Site Finding 32.25 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Notes : When Projection Screen is Lowered Ramp Vertical Clearance is Obstructed at 41"

Record Number 70042

City Hall - Offices

Ramps - 1st Floor : Ramp , Handrail

Ramp to Council Chambers Dais

Run 1

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Notes : When Projection Screen is Lowered Ramp Vertical Clearance is Obstructed at 41"

Record Number 70044

Ramps - 1st Floor : Ramp , Ramp Run

Ramp to Council Chambers Dais

Run 1

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 8.80 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Code Reference ADA 405, 405.2, CA 11B-405.2

Notes : When Projection Screen is Lowered Ramp Vertical Clearance is Obstructed at 41"

Record Number 70043

City Hall - Offices

Ramps - 1st Floor : Ramp , Handrail

Ramp to Council Chambers Dais

Run 1 Left Handrail

Finding

The surface of the wall adjacent to the handrail is abrasive.

On-Site Finding Abrasive

Recommendation

Modify the surface of the wall adjacent to the handrail so that the surface is smooth and nonabrasive.

Recommendation See Recommendation

Code Reference ADA 405.8, 505, 505.8

Notes : When Projection Screen is Lowered Ramp Vertical Clearance is Obstructed at 41"

Record Number 70047

Ramps - 1st Floor : Ramp , Handrail

Ramp to Council Chambers Dais

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505

Notes : When Projection Screen is Lowered Ramp Vertical Clearance is Obstructed at 41"

Record Number 70046

City Hall - Offices

Ramps - 1st Floor : Ramp , Handrail

Ramp to Council Chambers Dais

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 405.9.1, 505.10.1, CA 11B-405.8, 505.10.1

Notes : When Projection Screen is Lowered Ramp Vertical Clearance is Obstructed at 41"

Record Number 70045

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Main Entrance

Run 2

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Code Reference ADA 405, 405.9, CA 11B-405.9

Record Number 70155

City Hall - Offices

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 2 Left Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 70156

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 70157

City Hall - Offices

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 8.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 70158

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 9.10 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Code Reference ADA 405, 405.2, CA 11B-405.2

Record Number 70159

City Hall - Offices

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The cross slope of the ramp is greater than the allowed cross slope.

On-Site Finding 28.00 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 2.08 percent

Code Reference ADA 403, 405.3, CA 11B-405.3

Record Number 70160

Ramps - Exterior : Ramp , Landing

Ramp to the Main Entrance

Run 1 Intermediate Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 2.70 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Record Number 70162

City Hall - Offices

Ramps - Exterior : Ramp , Landing

Ramp to the Main Entrance

Run 1 Intermediate Landing

Finding

The ramp changes direction at this landing. The length of the landing is less than the required minimum length.

On-Site Finding 63.00 inches

Recommendation

Modify or replace the landing to meet the minimum required width and length.

Recommendation At least 72.00 inches

Code Reference ADA 405.7, 405.7.4

Record Number 70161

Ramps - Exterior : Ramp , Landing

Ramp to the Main Entrance

Run 1 Bottom Landing

Finding

The length of the bottom landing does not meet the required minimum length.

On-Site Finding 60.00 inches

Recommendation

Modify or replace the bottom landing to provide the required minimum length and width.

Recommendation At least 72.00 inches

Code Reference ADA 405, 405.7.3, CA 11B-405.7.3.1

Record Number 70163

City Hall - Offices

Ramps - Exterior : Ramp , Landing

Ramp to the Main Entrance

Run 1 Bottom Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 2.90 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Record Number 70164

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 70165

City Hall - Offices

Elevators - 1st Floor : Elevator

Elevator

Finding

There is no signage at the Elevator indicating the Evacuation Plan.

On-Site Finding None Found

Recommendation

Provide compliant signage indicating Evacuation plan and routes.

Recommendation See Recommendation

Code Reference ADA 302, 407

Record Number 71157

Elevators - 1st Floor : Elevator , Communication Control Signage

Elevator

Finding

No signage is provided adjacent to the emergency communication controls.

On-Site Finding Not Found

Recommendation

Provide compliant signage adjacent to the emergency communication controls.

Recommendation See Recommendation

Code Reference ADA 407.4.9 , ASME A17.1, CA 11B-407.4.9

Record Number 71158

City Hall - Offices

Elevators - 1st Floor : Elevator , Controls

Elevator
Elevator Car

Finding

The control panel is not located on the front wall for a center opening elevator doorway.

On-Site Finding Not Accessible

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation See Recommendation

Code Reference ADA 407

Record Number 71159

Elevators - 1st Floor : Elevator , Direction Lantern

Elevator

Finding

The hall direction lanterns do not function.

On-Site Finding Not Operational

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation See Recommendation

Code Reference ADA 407, 407.2.2

Record Number 71160

City Hall - Offices

Elevators - 1st Floor : Elevator , Direction Lantern

Elevator

Finding

The hall direction lanterns are not located at the compliant height.

On-Site Finding 71.25 inches

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation 72.00 inches

Code Reference ADA 407, 407.2.2.2

Record Number 71161

Elevators - 1st Floor : Elevator

Elevator

Finding

Braille is not located immediately below the raised letters.

On-Site Finding None Found

Recommendation

Make sure that braille is located immediately below the raised letters.

Recommendation See Recommendation

Code Reference ADA 407

Record Number 71162

City Hall - Offices

Stairs - 1st Floor : Stairway , Risers Striping

Steps to Councilmembers Dais

Run 1

Finding

The width of the striping is not compliant, does not contrast, or is too far from the nosing.

On-Site Finding 1.00 inches

Recommendation

Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 504, CA 11B-504.4.1

Record Number 70036

Stairs - 1st Floor : Stairway , Handrails

Steps to Councilmembers Dais

Run 1

Finding

There are no handrails provided on the stairway.

On-Site Finding None Found

Recommendation

Provide compliant handrails.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.2, CA 11B-504.6, 505.2

Record Number 70035

City Hall - Offices

Stairs - 1st Floor : Stairway , Handrails

Steps to Council Chambers Dais

Run 1

Finding

There are no handrails provided on the stairway.

On-Site Finding None Found

Recommendation

Provide compliant handrails.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.2, CA 11B-504.6, 505.2

Record Number 70122

Stairs - 1st Floor : Stairway , Risers Striping

Steps to Council Chambers Dais

Run 1

Finding

The width of the striping is not compliant, does not contrast, or is too far from the nosing.

On-Site Finding 1.00 inches

Recommendation

Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 504, CA 11B-504.4.1

Record Number 70123

City Hall - Offices

Stairs - 1st Floor : Stairway , Handrails

Stairwell Next to Elevator

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.25 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 70198

Stairs - 1st Floor : Stairway , Handrails

Stairwell Next to Elevator

Run 1 Right Handrail

Finding

The handrail extension is not the required length.

On-Site Finding 8.00 inches

Recommendation

Install a compliant extension to the handrail.

Recommendation At least 12.00 inches

Code Reference ADA 504, CA 11B-505.10.3

Record Number 70197

City Hall - Offices

Stairs - 1st Floor : Stairway , Handrails

Stairwell Next to Elevator

Run 1 Left Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 70199

Stairs - 1st Floor : Stairway , Handrails

Stairwell Next to Elevator

Run 3 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 70200

City Hall - Offices

Stairs - 1st Floor : Stairway , Run

Stairwell Next to Elevator

Run 2

Finding

The width of the stairway does not meet the minimum required width.

On-Site Finding 43.50 inches

Recommendation

Install a stairway with a minimum width as required.

Recommendation At least 44.00 inches

Code Reference ADA 210, 504, CA 11B-1009.1, 210, 504

Record Number 70201

Stairs - 1st Floor : Stairway , Handrails

Stairwell Next to Elevator

Run 2 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 70202

City Hall - Offices

Stairs - 1st Floor : Stairway , Run

Stairwell Next to Elevator

Run 4

Finding

The width of the stairway does not meet the minimum required width.

On-Site Finding 43.50 inches

Recommendation

Install a stairway with a minimum width as required.

Recommendation At least 44.00 inches

Code Reference ADA 210, 504, CA 11B-1009.1, 210, 504

Record Number 70203

Stairs - 1st Floor : Stairway , Risers Striping

Stairwell Next to Elevator

Run 4

Finding

There is no detectable striping on the stairways.

On-Site Finding None Found

Recommendation

Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-504.4.1

Record Number 70204

City Hall - Offices

Stairs - 1st Floor : Stairway , Handrails

Stairwell Next to Elevator

Run 4 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 7.62 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 70205

Stairs - 1st Floor : Stairway , Handrails

Stairwell Next to Elevator

Run 4 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.62 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 70206

City Hall - Offices

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Middle Handrail

Finding

The handrail extension is not the required length.

On-Site Finding 11.50 inches

Recommendation

Install a compliant extension to the handrail.

Recommendation At least 12.00 inches

Code Reference ADA 504, CA 11B-505.10.3

Record Number 70139

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Right Handrail

Finding

The handrail extension is not the required length.

On-Site Finding 11.25 inches

Recommendation

Install a compliant extension to the handrail.

Recommendation At least 12.00 inches

Code Reference ADA 504, CA 11B-505.10.3

Record Number 70141

City Hall - Offices

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 39.12 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 70142

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 3.75 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 70140

City Hall - Offices

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Left Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 70144

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Left Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 6.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 70143

City Hall - Offices

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Left Handrail

Finding

The handrail extension is not parallel with the floor surface at the bottom landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant extension to the handrail.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-505.10.3

Record Number 70145

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Middle Handrail

Finding

The handrail extension is not parallel with the floor surface at the bottom landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant extension to the handrail.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-505.10.3

Record Number 70147

City Hall - Offices

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Middle Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 70146

Doors - 1st Floor : Door , Clear Floor Space

Stairwel Next to Elevator - 1st Floor

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 45.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4

Record Number 70153

City Hall - Offices

Doors - 1st Floor : Door , Hardware

Stairwel Next to Elevator - 1st Floor

Push Bar / D Handle

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 12.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70152

Doors - 1st Floor : Door , Clear Floor Space

Womens Restroom Next to Library

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 44.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71198

City Hall - Offices

Doors - 1st Floor : Door , Hardware

**Womens Restroom Next to Library
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71197

Doors - 1st Floor : Door , Clear Floor Space

**Mens Restroom Next to Property Department
Pull Side**

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 44.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71200

City Hall - Offices

Doors - 1st Floor : Door , Hardware

**Mens Restroom Next to Property Department
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71199

Doors - 2nd Floor : Door , Hardware

**City Hall Office Main Entrance
Push / Pull**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Notes : Push/Pull Hardware is at 44.75"

Record Number 69501

City Hall - Offices

Doors - 2nd Floor : Door , Hardware Height

City Hall Office Main Entrance

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 53.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Notes : Push/Pull Hardware is at 44.75"

Record Number 69502

Doors - 2nd Floor : Door , Hardware

City Hall Office Main Entrance

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Notes : Push/Pull Hardware is at 44.75"

Record Number 69503

City Hall - Offices

Doors - 2nd Floor : Door

2C

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 69506

Doors - 2nd Floor : Door , Hardware

2C

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69505

City Hall - Offices

Doors - 2nd Floor : Door , Hardware

Prenatal Advantage Vestibule

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69509

Doors - 2nd Floor : Door , Hardware Height

Prenatal Advantage Vestibule

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 44.87 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Record Number 69510

City Hall - Offices

Doors - 2nd Floor : Door , Latch Side Clearance

Office of the City Manager

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 70028

Doors - 2nd Floor : Door

Work Room Hallway Entrance Next to Womens Restroom

Finding

The clear opening width of the door is less than required.

On-Site Finding 27.37 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 70040

City Hall - Offices

Doors - 2nd Floor : Door , Hardware

**Work Room Hallway Entrance Next to Womens Restroom
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70041

Doors - 2nd Floor : Door , Latch Side Clearance

**City Attorneys Office - Assistants
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 1.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 70050

City Hall - Offices

Doors - 2nd Floor : Door , Hardware

**2nd Floor Mens Restroom Next to Work Room
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70066

Doors - 2nd Floor : Door , Clear Floor Space

Supply Closet

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 35.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Record Number 70093

City Hall - Offices

Doors - 2nd Floor : Door , Latch Side Clearance

Supply Closet

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 5.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Shelving Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 70092

Doors - 2nd Floor : Door , Clear Floor Space

Supply Closet

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 43.37 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Shelving Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 70094

City Hall - Offices

Doors - 2nd Floor : Door

Hallway Entrance Next to Mens Restroom

Finding

The clear opening width of the door is less than required.

On-Site Finding 27.50 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 70095

Doors - 2nd Floor : Door , Hardware

Hallway Entrance Next to Mens Restroom

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70096

City Hall - Offices

Doors - 2nd Floor : Door

**Hallway Entrance Next to Mens Restroom
Lever**

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 70097

Doors - 2nd Floor : Door , Hardware

**2nd Floor Womens Restroom in Work Room
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70124

City Hall - Offices

Doors - 2nd Floor : Door , Clear Floor Space

Rent Stabalization Program

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 39.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : File Cabinet Obstructs Clear Floor Space Length.

Record Number 70149

Doors - 2nd Floor : Door , Clear Floor Space

File Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 58.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 70192

City Hall - Offices

Doors - 2nd Floor : Door , Hardware

File Room

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70191

Doors - 2nd Floor : Door , Latch Side Clearance

Work Room

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : File Cabinet Obstructs Latch Side Clearance.

Record Number 70195

City Hall - Offices

Doors - 2nd Floor : Door , Hardware

Work Room

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 14.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70194

Doors - 2nd Floor : Door , Clear Floor Space

Stairwell Next to Elevator - 2nd Floor

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 47.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 70221

City Hall - Offices

Doors - 2nd Floor : Door , Threshold

Stairwell Next to Elevator - 2nd Floor

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 5.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 70220

Doors - 2nd Floor : Door , Hardware

Stairwell Next to Elevator - 2nd Floor

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70218

City Hall - Offices

Doors - 2nd Floor : Door , Hardware Height

Stairwell Next to Elevator - 2nd Floor

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 50.75 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Record Number 70219

Doors - 2nd Floor : Door , Hardware

City Attorneys Office Lobby Entrances

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 70223

City Hall - Offices

Doors - 2nd Floor : Door , Latch Side Clearance

**2nd Floor Unisex Restroom Next to City Hall Offices
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.25 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71156

Doors - 2nd Floor : Door , Hardware

**2nd Floor Unisex Restroom Next to City Hall Offices
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71155

City Hall - Offices

Doors - 2nd Floor : Door , Latch Side Clearance

**2nd Floor Unisex Restroom Next to Probation Department
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.12 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Lavatory Obstructs Latch Side Clearance.

Record Number 71218

Doors - 2nd Floor : Door , Hardware

**2nd Floor Unisex Restroom Next to Probation Department
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 12.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71217

City Hall - Offices

Counters - 2nd Floor : Counter

City Hall Offices Reception

Finding

The counter is a protruding object.

On-Site Finding See Above

Recommendation

Adjust the counter so that it is no longer a protruding object.

Recommendation See Recommendation

Code Reference ADA 307.2, 902

Notes : Counter Protrudes 5.75" Into the Path of Travel.

Record Number 69512

Counters - 2nd Floor : Counter

Rent Stabalization Program

Finding

The counter is a protruding object.

On-Site Finding See Above

Recommendation

Adjust the counter so that it is no longer a protruding object.

Recommendation See Recommendation

Code Reference ADA 307.2, 902

Record Number 70209

City Hall - Offices

Counters - 2nd Floor : Counter

Rent Stabalization Program

Finding

The knee clearance depth provided is not compliant.

On-Site Finding 14.50 inches

Recommendation

Provide compliant knee clearance depth at the counter for a forward approach.

Recommendation At least 19.00 inches

Code Reference ADA 306.3.3, 904.3.2, CA 11B-306.3.3, 904.4.2

Record Number 70210

Signage - 1st Floor : Signage , Signage

Stairwel Next to Elevator - 1st Floor

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 70049

City Hall - Offices

Signage - 1st Floor : Signage

Council Chambers, Community Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70196

Signage - 1st Floor : Stairway , Signage

Stairwell Next to Elevator

Run 4 Floor Level Landing

Finding

The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.

On-Site Finding None Found

Recommendation

Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.

Recommendation See Recommendation

Code Reference ADA 216.4.1, CA 11B-504.8

Record Number 70207

City Hall - Offices

Signage - 1st Floor : Signage , Signage

Building Main Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71211

Signage - 2nd Floor : Signage , Signage

City Hall Office Reception Main Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 69500

City Hall - Offices

Signage - 2nd Floor : Signage

Conference Room Next to Prenatal Advantage

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 69507

Signage - 2nd Floor : Signage

2C

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 69508

City Hall - Offices

Signage - 2nd Floor : Signage

City Hall Office Reception Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 69511

Signage - 2nd Floor : Signage

Prenatal Advantage Vestibule

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 69514

City Hall - Offices

Signage - 2nd Floor : Signage

Office of the Administrative Services Director

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70027

Signage - 2nd Floor : Signage

Office of the Finance Director

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70034

City Hall - Offices

Signage - 2nd Floor : Signage

Rent Stabalization Program

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70037

Signage - 2nd Floor : Signage

City Attorneys Office Lobby Entrances

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70038

City Hall - Offices

Signage - 2nd Floor : Signage

City Attorneys Office - Assistants

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70039

Signage - 2nd Floor : Signage

Supply Closet

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70051

City Hall - Offices

Signage - 2nd Floor : Signage

Workroom

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70059

Signage - 2nd Floor : Signage

Hallway Entrance Next to Mens Restroom

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70090

City Hall - Offices

Signage - 2nd Floor : Signage

Stairwell Next to Elevator - 2nd Floor

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70091

Signage - 2nd Floor : Signage

Office of the City Attorney

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70125

City Hall - Offices

Signage - 2nd Floor : Signage

File Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70148

Signage - 2nd Floor : Signage

Office of the City Manager

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70151

City Hall - Offices

Signage - 2nd Floor : Signage

Work Room Hallway Entrance Next to Womens Restroom

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70193

Signage - 2nd Floor : Signage

City Hall Office - Hallway Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 70208

City Hall - Offices

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 70021

ATMs - 1st Floor : Automated Teller Machine

Bank of America ATM Next to Main Entrance

Finding

Either function keys does not contrast or does not have tactile symbol.

On-Site Finding Not Compliant

Recommendation

Provide compliant functions keys that contrasts and have tactile symbol.

Recommendation See Recommendation

Code Reference ADA 707.6.3.2

Record Number 71196

City Hall - Offices

Restrooms - 1st Floor : Restroom

**Womens Restroom Next to Library
Lavatory**

Finding

There is not enough toe clearance at the restroom lavatory.

On-Site Finding 0.00 inches

Recommendation

Provide minimum required toe clearance.

Recommendation At least 9.00 inches

Code Reference ADA 213, 306.2.1, 606, 606.2

Record Number 71171

Restrooms - 1st Floor : Restroom , Lavatory

**Womens Restroom Next to Library
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 71170

City Hall - Offices

Restrooms - 1st Floor : Restroom , Door Signage

Womens Restroom Next to Library

Female

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 60.12 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 71172

Restrooms - 1st Floor : Restroom , Dispensers

Womens Restroom Next to Library

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 56.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71167

City Hall - Offices

Restrooms - 1st Floor : Restroom , Dispensers

Womens Restroom Next to Library

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Record Number 71168

Restrooms - 1st Floor : Restroom , Dispensers

Womens Restroom Next to Library

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 44.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71169

City Hall - Offices

Restrooms - 1st Floor : Restroom , Lavatory

**Mens Restroom Next to Property Department
Lavatory**

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 71178

Restrooms - 1st Floor : Restroom , Lavatory

**Mens Restroom Next to Property Department
Lavatory**

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 1.62 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 30.00 inches

Code Reference ADA 213, 305.3, 606, 606.2, CA 11B-305, 606.2

Record Number 71177

City Hall - Offices

Restrooms - 1st Floor : Restroom , Lavatory

**Mens Restroom Next to Property Department
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 71179

Restrooms - 1st Floor : Restroom , Lavatory

**Mens Restroom Next to Property Department
Lavatory**

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 17.00 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
center

Code Reference CA 11B-606.6

Record Number 71176

City Hall - Offices

Restrooms - 1st Floor : Restroom , Door Signage

Mens Restroom Next to Property Department Male

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 60.12 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 71180

Restrooms - 1st Floor : Restroom , Wall Signage

Mens Restroom Next to Property Department

Finding

There is signage posted on the latch side of the entry door to the restroom. The signage does not include uppercase characters.

On-Site Finding None Found

Recommendation

Post signage designating the restroom as accessible. Signage shall be mounted at the required height and location and shall include Braille, uppercase characters, raised lettering, the International Symbol of Accessibility symbol and gender use pictogram.

Recommendation See Recommendation

Code Reference ADA 216, 703, 703.2.2, CA 11B-703.2

Record Number 71181

City Hall - Offices

Restrooms - 1st Floor : Restroom , Dispensers

Mens Restroom Next to Property Department

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 55.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71173

Restrooms - 1st Floor : Restroom , Dispensers

Mens Restroom Next to Property Department

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Record Number 71174

City Hall - Offices

Restrooms - 1st Floor : Restroom , Dispensers

Mens Restroom Next to Property Department Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 53.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71175

Restrooms - 1st Floor : Restroom , Compartment Door

Mens Restroom Next to Property Department

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 71186

City Hall - Offices

Restrooms - 1st Floor : Restroom

Mens Restroom Next to Property Department

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Code Reference ADA 604.8.1.2, CA 11B-604.8.1.2

Record Number 71185

Restrooms - 1st Floor : Restroom

Mens Restroom Next to Property Department

Finding

The center of the roll is not within the required distance from the floor.

On-Site Finding 13.00 inches

Recommendation

Provide a compliant toilet paper dispenser.

Recommendation At least 19.00 inches

Code Reference ADA 304, 604.7, CA 11B-604.7

Record Number 71188

City Hall - Offices

Restrooms - 1st Floor : Restroom , Toilet Compartment

Mens Restroom Next to Property Department

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 19.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 71187

Restrooms - 1st Floor : Restroom , Toilet

Mens Restroom Next to Property Department

Finding

The height of the toilet seat is not at the required height.

On-Site Finding 181.12 inches

Recommendation

Adjust or modify the toilet so the seat height is at the required accessible height.

Recommendation 17.00 - 19.00 inches

Code Reference ADA 603, 604.4, CA 11B-604.4

Record Number 71183

City Hall - Offices

Restrooms - 1st Floor : Restroom , Toilet

Mens Restroom Next to Property Department

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 18.25 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 71182

Restrooms - 1st Floor : Restroom , Compartment Door

Womens Restroom Next to Library

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Notes : Latch Hardware Damaged/Missing.

Record Number 71207

City Hall - Offices

Restrooms - 1st Floor : Restroom

Womens Restroom Next to Library

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Code Reference ADA 604.8.1.2, CA 11B-604.8.1.2

Notes : Latch Hardware Damaged/Missing.

Record Number 71208

Restrooms - 1st Floor : Restroom , Compartment Door

Womens Restroom Next to Library

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 309.4, 404, 404.2.7, 604.8, CA 11B-404.2.7, 604.8.1.2

Notes : Latch Hardware Damaged/Missing.

Record Number 71209

City Hall - Offices

Restrooms - 1st Floor : Restroom , Grab Bar

Womens Restroom Next to Library

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 71206

Restrooms - 1st Floor : Restroom , Toilet Compartment

Womens Restroom Next to Library

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 11.50 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 71210

City Hall - Offices

Restrooms - 1st Floor : Restroom , Toilet

Womens Restroom Next to Library

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 18.25 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 71204

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Womens Restroom in Work Room

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 48.75 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 70071

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Grab Bars

2nd Floor Womens Restroom in Work Room

Finding

There are no grab bars.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Code Reference ADA 603, 604.5, 609, CA 11B-604.5

Record Number 70072

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Womens Restroom in Work Room

Finding

The location of the seat cover dispenser does not provide sufficient clear floor space.

On-Site Finding Not Accessible

Recommendation

Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.

Recommendation See Recommendation

Code Reference ADA 304, 305.1, 309.2, CA 11B-305.1, 309.2, 603.5

Record Number 70067

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Womens Restroom in Work Room

Finding

There is no toilet paper dispenser provided on the narrow side wall.

On-Site Finding None Found

Recommendation

Install a compliant toilet paper dispenser.

Recommendation See Recommendation

Code Reference ADA 603, 604.7, CA 11B-604.7

Record Number 70068

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Womens Restroom in Work Room

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 55.50 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 56.00 inches

Code Reference ADA 213, 603, 604, 604.8.1.1, CA 11B-604.8.1.1

Record Number 70070

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Womens Restroom in Work Room

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 30.37 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 60.00 inches

Code Reference ADA 213, 603, 604, 604.8.1.1, CA 11B-604.8.1.1

Record Number 70069

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Womens Restroom in Work Room

Finding

The clear opening width of the doorway to the compartment is less than required.

On-Site Finding 20.37 inches

Recommendation

Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, 604.8, CA 11B-404.2.3, 604.8.1.2

Record Number 70080

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Womens Restroom in Work Room

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 309.4, 404, 404.2.7, 604.8, CA 11B-404.2.7, 604.8.1.2

Record Number 70082

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Womens Restroom in Work Room

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 70079

City Hall - Offices

Restrooms - 2nd Floor : Restroom

2nd Floor Womens Restroom in Work Room

Finding

The inside handle is not located near the latch.

On-Site Finding None Found

Recommendation

Adjust the inside handle so that it is located near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 70083

Restrooms - 2nd Floor : Restroom

2nd Floor Womens Restroom in Work Room

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Code Reference ADA 604.8.1.2, CA 11B-604.8.1.2

Record Number 70081

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Womens Restroom in Work Room

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 66.50 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 70084

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Womens Restroom in Work Room

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 30.25 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 70078

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Womens Restroom in Work Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 15.25 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 70077

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Womens Restroom in Work Room

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 15.12 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 70073

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Womens Restroom in Work Room

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 70076

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Womens Restroom in Work Room

Finding

The height of the toilet seat is not at the required height.

On-Site Finding 16.00 inches

Recommendation

Adjust or modify the toilet so the seat height is at the required accessible height.

Recommendation 17.00 - 19.00 inches

Code Reference ADA 603, 604.4, CA 11B-604.4

Record Number 70074

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Mens Restroom Next to Work Room

Finding

The location of the seat cover dispenser does not provide sufficient clear floor space.

On-Site Finding Not Accessible

Recommendation

Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.

Recommendation See Recommendation

Code Reference ADA 304, 305.1, 309.2, CA 11B-305.1, 309.2, 603.5

Record Number 70098

Restrooms - 2nd Floor : Restroom , Grab Bars

2nd Floor Mens Restroom Next to Work Room

Finding

There are no grab bars.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Code Reference ADA 603, 604.5, 609, CA 11B-604.5

Record Number 70101

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Mens Restroom Next to Work Room

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 48.50 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 70100

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Mens Restroom Next to Work Room

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 31.00 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 60.00 inches

Code Reference ADA 213, 603, 604, 604.8.1.1, CA 11B-604.8.1.1

Record Number 70099

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Mens Restroom Next to Work Room

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 309.4, 404, 404.2.7, 604.8, CA 11B-404.2.7, 604.8.1.2

Record Number 70113

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Mens Restroom Next to Work Room

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 70112

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Mens Restroom Next to Work Room

Finding

The clear opening width of the doorway to the compartment is less than required.

On-Site Finding 20.37 inches

Recommendation

Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, 604.8, CA 11B-404.2.3, 604.8.1.2

Record Number 70109

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Mens Restroom Next to Work Room

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 70108

City Hall - Offices

Restrooms - 2nd Floor : Restroom

2nd Floor Mens Restroom Next to Work Room

Finding

The inside handle is not located near the latch.

On-Site Finding None Found

Recommendation

Adjust the inside handle so that it is located near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 70114

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Mens Restroom Next to Work Room

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Code Reference ADA 304.4, 603, 604.8, CA 11B-604.8.1

Record Number 70111

City Hall - Offices

Restrooms - 2nd Floor : Restroom

2nd Floor Mens Restroom Next to Work Room

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 4.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4.1, 604.8.1.2, 604.8.2.2, CA 11B-404, 604.8.1.2

Record Number 70115

Restrooms - 2nd Floor : Restroom

2nd Floor Mens Restroom Next to Work Room

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Code Reference ADA 604.8.1.2, CA 11B-604.8.1.2

Record Number 70110

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Mens Restroom Next to Work Room

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 68.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 70116

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Mens Restroom Next to Work Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 15.50 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 70106

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Mens Restroom Next to Work Room

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 32.37 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 70107

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Mens Restroom Next to Work Room

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 15.50 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 70102

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Mens Restroom Next to Work Room

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 70105

Restrooms - 2nd Floor : Restroom , Toilet

2nd Floor Mens Restroom Next to Work Room

Finding

The height of the toilet seat is not at the required height.

On-Site Finding 15.75 inches

Recommendation

Adjust or modify the toilet so the seat height is at the required accessible height.

Recommendation 17.00 - 19.00 inches

Code Reference ADA 603, 604.4, CA 11B-604.4

Record Number 70103

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Urinal

2nd Floor Mens Restroom Next to Work Room

Finding

There is less than the required clear floor space provided in front of the urinal in the restroom to allow an accessible forward approach.

On-Site Finding 25.50 inches

Recommendation

Provide the required minimum clear floor space in front of the urinal designated to be accessible in the restroom, for a forward approach.

Recommendation At least 30.00 inches

Code Reference ADA 305.3, 605, 605.3, CA 11B-305.3, 605.3

Record Number 70133

Restrooms - 2nd Floor : Restroom , Urinal

2nd Floor Mens Restroom Next to Work Room

Finding

The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.

On-Site Finding 24.00 inches

Recommendation

Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.

Recommendation Up to 17.00 inches

Code Reference ADA 605, 605.2, CA 11B-605.2

Record Number 70130

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Urinal

2nd Floor Mens Restroom Next to Work Room

Finding

The width between urinal shields in the restroom is less than required.

On-Site Finding 25.50 inches

Recommendation

Modify or replace the urinal shields in the restroom to provide the required shield-width clearance.

Recommendation At least 30.00 inches

Code Reference ADA 305.3, 605, 605.3

Record Number 70134

Restrooms - 2nd Floor : Restroom , Urinal

2nd Floor Mens Restroom Next to Work Room

Finding

The height of the urinal flush control in the restroom is greater than the required maximum height.

On-Site Finding 46.00 inches

Recommendation

Lower the flush control valve on the urinal to a height not greater than the required maximum height.

Recommendation Up to 44.00 inches

Code Reference ADA 308.2, 309.3, 605, 605.4, CA 11B-605.4

Record Number 70131

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Lavatory

**2nd Floor Mens Restroom Next to Work Room
Lavatory**

Finding

The height of the counter surface is greater than allowed.

On-Site Finding 34.25 inches

Recommendation

Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.

Recommendation Up to 34.00 inches

Code Reference ADA 213, 606, 606.3, CA 11B-213, 606.3

Record Number 70128

Restrooms - 2nd Floor : Restroom , Lavatory

**2nd Floor Mens Restroom Next to Work Room
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 70129

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Wall Signage

2nd Floor Mens Restroom Next to Work Room

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 70136

Restrooms - 2nd Floor : Restroom , Door Signage

2nd Floor Mens Restroom Next to Work Room

Male

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 70135

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Mens Restroom Next to Work Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 40.75 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 70126

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Mens Restroom Next to Work Room

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 45.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 70127

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Lavatory

**2nd Floor Womens Restroom in Work Room
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 70215

Restrooms - 2nd Floor : Restroom , Lavatory

**2nd Floor Womens Restroom in Work Room
Lavatory**

Finding

The height of the counter surface is greater than allowed.

On-Site Finding 34.37 inches

Recommendation

Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.

Recommendation Up to 34.00 inches

Code Reference ADA 213, 606, 606.3, CA 11B-213, 606.3

Record Number 70214

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Wall Signage

2nd Floor Womens Restroom in Work Room

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 70217

Restrooms - 2nd Floor : Restroom , Door Signage

2nd Floor Womens Restroom in Work Room

Female

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 70216

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Womens Restroom in Work Room

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 44.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 70211

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Womens Restroom in Work Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 56.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 70212

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Womens Restroom in Work Room

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Record Number 70213

Restrooms - 2nd Floor : Restroom

2nd Floor Unisex Restroom Next to City Hall Offices

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Code Reference ADA 213, 213.2.1, CA 11B-213.2.1

Record Number 71150

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Lavatory

2nd Floor Unisex Restroom Next to City Hall Offices Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Supply Lines Not Completely Wrapped.

Record Number 71152

Restrooms - 2nd Floor : Restroom , Wall Signage

2nd Floor Unisex Restroom Next to City Hall Offices

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 71154

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Door Signage

**2nd Floor Unisex Restroom Next to City Hall Offices
Unisex**

Finding

Signage does not include contrasting gender use symbols.

On-Site Finding None Found

Recommendation

Provide compliant contrasting gender use unisex signage.

Recommendation See Recommendation

Code Reference CA 11B-703.7.2.6.3

Record Number 71153

Restrooms - 2nd Floor : Restroom , Dispensers

**2nd Floor Unisex Restroom Next to City Hall Offices
Soap**

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 45.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71151

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Grab Bars

2nd Floor Unisex Restroom Next to Probation Department

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 52.50 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Record Number 71164

Restrooms - 2nd Floor : Restroom , Grab Bar

2nd Floor Unisex Restroom Next to Probation Department

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 71165

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Unisex Restroom Next to Probation Department

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 12.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 71166

Restrooms - 2nd Floor : Restroom , Grab Bars

2nd Floor Unisex Restroom Next to City Hall Offices

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 51.75 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Record Number 71202

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Toilet Compartment

2nd Floor Unisex Restroom Next to City Hall Offices

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 11.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 71203

Restrooms - 2nd Floor : Restroom , Lavatory

2nd Floor Unisex Restroom Next to Probation Department

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Supply Lines Not Completely Wrapped.

Record Number 71213

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Wall Signage

2nd Floor Unisex Restroom Next to Probation Department

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding Wrong Placement

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 703, 703.4.2, CA 11B-703.4.2

Record Number 71216

Restrooms - 2nd Floor : Restroom , Door Signage

2nd Floor Unisex Restroom Next to Probation Department

Unisex

Finding

Signage does not include contrasting gender use symbols.

On-Site Finding None Found

Recommendation

Provide compliant contrasting gender use unisex signage.

Recommendation See Recommendation

Code Reference CA 11B-703.7.2.6.3

Record Number 71215

City Hall - Offices

Restrooms - 2nd Floor : Restroom , Door Signage

**2nd Floor Unisex Restroom Next to Probation Department
Unisex**

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 60.25 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 71214

Restrooms - 2nd Floor : Restroom , Dispensers

**2nd Floor Unisex Restroom Next to Probation Department
Soap**

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 44.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71212

City Hall - Offices

Drinking Fountains - 1st Floor : Drinking Fountain

Drinking Fountain Next to Council Chambers

Finding

There is insufficient clear floor space in front of the drinking fountain.

On-Site Finding 3.50 inches

Recommendation

Provide the required clear floor space that is on a primary path of travel.

Recommendation At least 30.00 inches

Code Reference ADA 211, 305, 305.3, 306, 602, 602.2

Record Number 70120

Drinking Fountains - 1st Floor : Drinking Fountain

Drinking Fountain Next to Council Chambers

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Code Reference ADA 211.2, 305, 602, CA 11B-211.2, 602

Record Number 70117

City Hall - Offices

Drinking Fountains - 1st Floor : Drinking Fountain

Drinking Fountain Next to Council Chambers

Finding

The spout outlet height is greater than required.

On-Site Finding 36.12 inches

Recommendation

Provide a spout outlet that does not exceed the required height.

Recommendation Up to 36.00 inches

Code Reference ADA 211, 602, 602.4, CA 11B-602.4

Record Number 70118

Drinking Fountains - 1st Floor : Drinking Fountain

Drinking Fountain Next to Council Chambers

Finding

The water flow trajectory is not parallel to the front of the drinking fountain.

On-Site Finding Not Compliant

Recommendation

Provide a water flow trajectory that is parallel to the front of the drinking fountain.

Recommendation See Recommendation

Code Reference ADA 602.6, CA 11B-602.6

Record Number 70119

City Hall - Offices

Drinking Fountains - 1st Floor : Drinking Fountain

Drinking Fountain Next to Council Chambers

Finding

An unstable floor mat is provided within the drinking fountain clear floor space.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat.

Recommendation See Recommendation

Code Reference ADA 302, 305.2, 602.2, CA 11B-302, 305.2, 602.2

Record Number 70121

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to City Hall Office Main Entrance

Finding

The spout outlet height is greater than required.

On-Site Finding 40.00 inches

Recommendation

Provide a spout outlet that does not exceed the required height.

Recommendation Up to 36.00 inches

Code Reference ADA 211, 602, 602.4, CA 11B-602.4

Record Number 70062

City Hall - Offices

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to City Hall Office Main Entrance

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Code Reference ADA 211.2, 305, 602, CA 11B-211.2, 602

Record Number 70060

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to City Hall Office Main Entrance

Finding

Drinking fountain does not provide a required fountain depth.

On-Site Finding 12.87 inches

Recommendation

Install a drinking fountain the meets the required minimum depth.

Recommendation At least 18.00 inches

Code Reference ADA 211, 305, 306, 602, CA 11B-602.8

Record Number 70064

City Hall - Offices

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to City Hall Office Main Entrance

Finding

The height of the water stream is less than required.

On-Site Finding 3.00 inches

Recommendation

Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.

Recommendation At least 4.00 inches

Code Reference ADA 211, 602, 602.6, CA 11B-211, 602

Record Number 70063

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to City Hall Office Main Entrance

Finding

The drinking fountain is not set entirely in an alcove.

On-Site Finding None Found

Recommendation

If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.

Recommendation See Recommendation

Code Reference ADA 307.2, 602.1 , CA 11B-602.9

Record Number 70065

City Hall - Offices

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to City Hall Office Main Entrance

Finding

There is less than the required minimum knee clearance height.

On-Site Finding 17.25 inches

Recommendation

Provide a fountain with the required knee and toe clearances.

Recommendation At least 27.00 inches

Code Reference ADA 211, 306, 602, 602.2, CA 11B-306, 602.2

Record Number 70061

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to Prenatal Advantage

Finding

There is less than the required minimum knee clearance height.

On-Site Finding 17.25 inches

Recommendation

Provide a fountain with the required knee and toe clearances.

Recommendation At least 27.00 inches

Code Reference ADA 211, 306, 602, 602.2, CA 11B-306, 602.2

Record Number 70086

City Hall - Offices

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to Prenatal Advantage

Finding

The drinking fountain is not set entirely in an alcove.

On-Site Finding None Found

Recommendation

If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.

Recommendation See Recommendation

Code Reference ADA 307.2, 602.1 , CA 11B-602.9

Record Number 70089

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to Prenatal Advantage

Finding

Drinking fountain does not provide a required fountain depth.

On-Site Finding 13.00 inches

Recommendation

Install a drinking fountain the meets the required minimum depth.

Recommendation At least 18.00 inches

Code Reference ADA 211, 305, 306, 602, CA 11B-602.8

Record Number 70088

City Hall - Offices

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to Prenatal Advantage

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Code Reference ADA 211.2, 305, 602, CA 11B-211.2, 602

Record Number 70085

Drinking Fountains - 2nd Floor : Drinking Fountain

Drinking Fountain Next to Prenatal Advantage

Finding

The spout outlet height is greater than required.

On-Site Finding 40.00 inches

Recommendation

Provide a spout outlet that does not exceed the required height.

Recommendation Up to 36.00 inches

Code Reference ADA 211, 602, 602.4, CA 11B-602.4

Record Number 70087

City Hall - Offices

Break/Conference Room - 1st Floor : Break Room

Community Room

Finding

The table knee clearance does not meet required standards.

On-Site Finding 26.75 inches

Recommendation

Provide compliant tables.

Recommendation At least 27.00 inches

Code Reference ADA 305, 306, 902.2, CA 11B-305, 306, 902.2

Record Number 70052

Break/Conference Room - 1st Floor : Break Room

Community Room

Finding

The table knee depth does not meet required standards.

On-Site Finding 14.50 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Code Reference ADA 205, 228, 306.3.3, 308, 309, CA 11B-306.3.2, 306.3.3, 902.2

Record Number 70053

City Hall - Offices

Break/Conference Room - 2nd Floor : Break Room

2C

Finding

The table knee clearance does not meet required standards.

On-Site Finding 23.75 inches

Recommendation

Provide compliant tables.

Recommendation At least 27.00 inches

Code Reference ADA 305, 306, 902.2, CA 11B-305, 306, 902.2

Record Number 69513

Break/Conference Room - 2nd Floor : Break Room

Office of the City Manager

Finding

The table knee depth does not meet required standards.

On-Site Finding 17.62 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Code Reference ADA 205, 228, 306.3.3, 308, 309, CA 11B-306.3.2, 306.3.3, 902.2

Record Number 70048

City Hall - Offices

Break/Conference Room - 2nd Floor : Break Room

City Hall Office Break Room

Finding

The table knee depth does not meet required standards.

On-Site Finding 5.00 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Code Reference ADA 205, 228, 306.3.3, 308, 309, CA 11B-306.3.2, 306.3.3, 902.2

Record Number 70054

Reach Ranges - 1st Floor : Reach Range , Clear Floor Space Length

Council Chambers

Councilmembers Dais

Finding

The clear floor space length is not compliant.

On-Site Finding 41.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Code Reference ADA 304, 305.3, CA 11B-305, 309.2

Record Number 70029

City Hall - Offices

Reach Ranges - 1st Floor : Reach Range

Council Chambers

Councilmembers Dais

Finding

The knee height is not compliant.

On-Site Finding 25.25 inches

Recommendation

Adjust knee height to the recommended value.

Recommendation At least 27.00 inches

Code Reference ADA 226, 304, 306, 902

Record Number 70030

Reach Ranges - 1st Floor : Reach Range

Council Chambers

Podium

Finding

The knee height is not compliant.

On-Site Finding 22.00 inches

Recommendation

Adjust knee height to the recommended value.

Recommendation At least 27.00 inches

Code Reference ADA 226, 304, 306, 902

Record Number 70032

City Hall - Offices

Reach Ranges - 1st Floor : Reach Range , Clear Floor Space Width

Council Chambers

Podium

Finding

The clear floor space width is not compliant.

On-Site Finding 23.25 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Code Reference ADA 304, 305.3, CA 11B-305

Record Number 70031

Reach Ranges - 1st Floor : Reach Range , Element Highest Point of Operation

Council Chambers

Podium

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 39.50 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 28.00 - 34.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Record Number 70033

City Hall - Offices

Reach Ranges - 2nd Floor : Reach Range , Vending Machine

2nd Floor

Finding

The side reach height of the controls on the vending machine is greater than the allowed maximum height.

On-Site Finding 59.50 inches

Recommendation

Contact the owner of the vending machines to obtain accessible vending machines.

Recommendation Up to 48.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Record Number 70166

Reach Ranges - 2nd Floor : Reach Range , Vending Machine

2nd Floor

Finding

The side reach height of the controls on the vending machine is greater than the allowed maximum height.

On-Site Finding 52.50 inches

Recommendation

Contact the owner of the vending machines to obtain accessible vending machines.

Recommendation Up to 48.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Record Number 70167

Accessibility Survey



Community & Economic Development Department

1960 Tate Street
East Palo Alto, CA 94303

Date of Inspection

10/13/2017

Prepared By

Disability Access Consultants

Community & Economic Development Department

Parking - Exterior : Parking Lot , Parking Space

Student Parking Lot

Finding

There is no designated "van accessible" parking space provided in the parking lot.

On-Site Finding None Found

Recommendation

Provide a compliant van accessible space.

Recommendation See Recommendation

Code Reference ADA 208, 208.2.4, 502.7, CA 11B-208.2.4, 502.7

Record Number 71226

Parking - Exterior : Parking Lot , Warning Signage

Student Parking Lot

Entrance from Tate Stret

Finding

There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.

On-Site Finding Sign not Filled

Recommendation

Fill in the blank spaces which are required to furnish the point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8.2

Record Number 71233

Community & Economic Development Department

Parking - Exterior : Parking Lot , Parking Space

Student Parking Lot

Accessible Space

Finding

ISA marking is faded and not viewable.

On-Site Finding Faded or Damaged

Recommendation

Repaint the ISA marking in the parking space.

Recommendation See Recommendation

Code Reference ADA 502, CA 11B-502.6.4

Record Number 71230

Parking - Exterior : Parking Lot , Warning Signage

Student Parking Lot

Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 71229

Community & Economic Development Department

Parking - Exterior : Parking Lot , Parking Space

Student Parking Lot

Accessible Space

Finding

The access aisle markings are faded, damaged, or otherwise not viewable.

On-Site Finding None Found

Recommendation

Re-stripe the access aisle so as to discourage parking.

Recommendation See Recommendation

Code Reference ADA 502.3, 502.3.3, CA 11B-502.3

Record Number 71232

Parking - Exterior : Parking Lot , Parking Space

Student Parking Lot

Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 2.40 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 71231

Community & Economic Development Department

Parking - Exterior : Parking Lot , Parking Space

Student Parking Lot

Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 71227

Parking - Exterior : Parking Lot , Parking Space

Student Parking Lot

Accessible Space

Finding

There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.

On-Site Finding None Found

Recommendation

Install a wheel stop at the head of the accessible parking space.

Recommendation See Recommendation

Code Reference ADA 502, 502.7, CA 11B-502.7.2

Record Number 71228

Community & Economic Development Department

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Accessible Space

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 71270

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp at the Accessible Space

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 71271

Community & Economic Development Department

Path of Travel - Community & Economic Development : Path Of Travel , Walking Surfaces

Reception

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 28.00 inches for 2.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Notes : Furniture Reduces Walking Surface Width.

Record Number 71339

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Joel Davis Park

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.80 percent for 42.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 71259

Community & Economic Development Department

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Reception to Engineering & Planning Departments
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 6.90 percent for 10.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 71269

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

**Path of Travel from the Public Right of Way at Wilks Street
Tree Limb**

Finding

The vertical clearance height is less than required.

On-Site Finding 77.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 71336

Community & Economic Development Department

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Wilks Street
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 16.60 percent for 5.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 71335

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Wilks Street to Planning
Department
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 12.20 percent

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 71764

Community & Economic Development Department

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way at Wilks Street to Planning Department

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 71765

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path Next to Permit Center Exterior Entrance

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 71769

Community & Economic Development Department

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path Next to Permit Center Exterior Entrance
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 71770

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path Next to Permit Center Exterior Entrance
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 18.00 percent

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 71768

Community & Economic Development Department

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way at Wilks Street to Engineering Department

Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 9.50 percent

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 71790

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way at Wilks Street to Engineering Department

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 47.50 inches for 11.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 71791

Community & Economic Development Department

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel to Offices North Exterior Entrance
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.30 percent for 16.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 71795

Doors - Community & Economic Development : Door , Clear Floor Space

**Planning Department North Entrance
Push Side**

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 27.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71224

Community & Economic Development Department

Doors - Community & Economic Development : Door , Clear Floor Space

Planning Department North Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 17.20 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71225

Doors - Community & Economic Development : Door , Threshold

Planning Department North Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.87 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 71223

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Planning Department North Entrance

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71222

Doors - Community & Economic Development : Door , Latch Side Clearance

Mens Restroom Next to Offices

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 10.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71236

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Mens Restroom Next to Offices

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71235

Doors - Community & Economic Development : Door , Clear Floor Space

Reception Rear Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 3.90 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71246

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Reception Rear Entrance

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71244

Doors - Community & Economic Development : Door , Threshold

Reception Rear Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 4.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 71245

Community & Economic Development Department

Doors - Community & Economic Development : Door , Clear Floor Space

Main Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 71254

Doors - Community & Economic Development : Door , Clear Floor Space

Main Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 3.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71255

Community & Economic Development Department

Doors - Community & Economic Development : Door

Permit Center

Push Bar / Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 71257

Doors - Community & Economic Development : Door , Hardware

Permit Center

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 8.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71256

Community & Economic Development Department

Doors - Community & Economic Development : Door

North Hallway

Push Bar / Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 71258

Doors - Community & Economic Development : Door , Clear Floor Space

Engineering Department

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 3.90 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71264

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Engineering Department

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 8.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71263

Doors - Community & Economic Development : Door , Clear Floor Space

Planning Department

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.80 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71268

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Planning Department

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71266

Doors - Community & Economic Development : Door , Threshold

Planning Department

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 71267

Community & Economic Development Department

Doors - Community & Economic Development : Door , Clear Floor Space

Offices South Exterior Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 6.10 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71274

Doors - Community & Economic Development : Door , Hardware

Offices South Exterior Entrance

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71273

Community & Economic Development Department

Doors - Community & Economic Development : Door , Clear Floor Space

Engineering Department North Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 13.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71277

Doors - Community & Economic Development : Door , Hardware

Engineering Department North Entrance

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 13.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71275

Community & Economic Development Department

Doors - Community & Economic Development : Door , Threshold

Engineering Department North Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 71276

Doors - Community & Economic Development : Door , Latch Side Clearance

Planners Office

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71279

Community & Economic Development Department

Doors - Community & Economic Development : Door

Offices North Exterior Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.75 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 71280

Doors - Community & Economic Development : Door , Clear Floor Space

Offices North Exterior Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 5.90 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71283

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Offices North Exterior Entrance

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71282

Doors - Community & Economic Development : Door , Clear Floor Space

Workroom Exterior Entrance

Push Side

Finding

There is no level landing at this door.

On-Site Finding 5.10 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71288

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Workroom Exterior Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71286

Doors - Community & Economic Development : Door , Threshold

Workroom Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 71287

Community & Economic Development Department

Doors - Community & Economic Development : Door , Clear Floor Space

Conference Room Exterior Entrance

Push Side

Finding

There is no level landing at this door.

On-Site Finding 3.10 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71301

Doors - Community & Economic Development : Door , Clear Floor Space

Conference Room Exterior Entrance

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 56.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length.

Record Number 71302

Community & Economic Development Department

Doors - Community & Economic Development : Door , Threshold

Conference Room Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 71300

Doors - Community & Economic Development : Door , Latch Side Clearance

Engineers Office

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 8.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Desk Obstructs Latch Side Clearance.

Record Number 71307

Community & Economic Development Department

Doors - Community & Economic Development : Door

Workroom Next to Conference Room

Finding

The vertical clearance height of the open doorway is not compliant.

On-Site Finding 79.00 inches

Recommendation

Provide a compliant open doorway at the location.

Recommendation At least 80.00 inches

Code Reference ADA 307.4

Record Number 71337

Doors - Community & Economic Development : Door , Clear Floor Space

Permit Counter Gate

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 0.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71767

Community & Economic Development Department

Doors - Community & Economic Development : Door , Latch Side Clearance

Permit Counter Gate

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71766

Doors - Community & Economic Development : Door , Latch Side Clearance

Unisex Restroom in Permit Center

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 20.37 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 71782

Community & Economic Development Department

Doors - Community & Economic Development : Door , Clear Floor Space

Permit Center Exterior Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 4.00 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71794

Doors - Community & Economic Development : Door

Permit Center Exterior Entrance

Push Bar / Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 71793

Community & Economic Development Department

Doors - Community & Economic Development : Door , Hardware

Permit Center Exterior Entrance

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 71792

Counters - Community & Economic Development : Counter

Permit Department

Finding

The knee clearance depth provided is not compliant.

On-Site Finding 12.25 inches

Recommendation

Provide compliant knee clearance depth at the counter for a forward approach.

Recommendation At least 19.00 inches

Code Reference ADA 306.3.3, 904.3.2, CA 11B-306.3.3, 904.4.2

Record Number 71762

Community & Economic Development Department

Signage - Community & Economic Development : Signage

North Hallway

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71221

Signage - Community & Economic Development : Signage , Signage

Engineering Department North Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71265

Community & Economic Development Department

Signage - Community & Economic Development : Signage

Offices

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71297

Signage - Community & Economic Development : Signage , Signage

Planning Department North Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71298

Community & Economic Development Department

**Signage - Community & Economic Development : Signage , Signage
Conference Room**

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71303

**Signage - Community & Economic Development : Signage , Signage
Offices South Exterior Entrance**

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71304

Community & Economic Development Department

Signage - Community & Economic Development : Signage

Workroom Exterior Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71305

Signage - Community & Economic Development : Signage

Break Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71308

Community & Economic Development Department

Signage - Community & Economic Development : Signage

Planners Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71309

Signage - Community & Economic Development : Signage , Signage

Permit Center

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71310

Community & Economic Development Department

Signage - Community & Economic Development : Signage

Offices North Exterior Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71311

Signage - Community & Economic Development : Signage

Engineers Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71323

Community & Economic Development Department

**Signage - Community & Economic Development : Signage , Signage
Conference Room Exterior Entrance**

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71324

**Signage - Community & Economic Development : Signage , Signage
Planning Department**

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71325

Community & Economic Development Department

Signage - Community & Economic Development : Signage , Signage

Main Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71326

Signage - Community & Economic Development : Signage

Workroom Next to Conference Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71338

Community & Economic Development Department

Signage - Community & Economic Development : Signage

Reception Rear Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 71340

Signage - Community & Economic Development : Signage , Signage

Permit Center Exterior Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 71780

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom , Toilet
Compartment**

Womens Restroom Next to Offices

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 59.75 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 60.00 inches

Code Reference ADA 213, 603, 604, 604.8.1.1, CA 11B-604.8.1.1

Record Number 71237

Restrooms - Community & Economic Development : Restroom

Womens Restroom Next to Offices

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 3.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4.1, 604.8.1.2, 604.8.2.2, CA 11B-404, 604.8.1.2

Record Number 71242

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom ,
Compartment Door**

Womens Restroom Next to Offices

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 71241

Restrooms - Community & Economic Development : Restroom , Grab Bar

Womens Restroom Next to Offices

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 71240

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Grab Bars

Womens Restroom Next to Offices

Finding

The distance from the rear wall to the side grab bar is greater than allowed.

On-Site Finding 12.37 inches

Recommendation

Remount the side grab bar so it meets the distance requirements from the back wall.

Recommendation Up to 12.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1

Record Number 71239

**Restrooms - Community & Economic Development : Restroom ,
Compartment Door**

Mens Restroom Next to Offices

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 309.4, 404, 404.2.7, 604.8, CA 11B-404.2.7, 604.8.1.2

Record Number 71296

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom ,
Compartment Door**

Mens Restroom Next to Offices

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 71295

Restrooms - Community & Economic Development : Restroom , Grab Bar

Mens Restroom Next to Offices

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 71294

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom

Mens Restroom Next to Offices

Finding

Rear grab bar interferes with the tank/flushometer.

On-Site Finding Not Compliant

Recommendation

Readjust the rear grab bar so that it does not interfere with the tank/flushometer.

Recommendation See Recommendation

Code Reference ADA 609.3, CA 11B-609.3

Record Number 71293

Restrooms - Community & Economic Development : Restroom , Grab Bars

Mens Restroom Next to Offices

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding -38.25 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 71292

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Toilet

Mens Restroom Next to Offices

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 71290

Restrooms - Community & Economic Development : Restroom , Toilet

Mens Restroom Next to Offices

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 0.25 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 71291

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom

Womens Restroom Next to Offices

Finding

The entrance door swings into the turning space within the restroom.

On-Site Finding 44.00 inches

Recommendation

Reverse the door swing, or modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 48.00 inches

Code Reference ADA 304, 305.3, 603.2, 603.2.3, CA 11B-603.2.3

Record Number 71314

Restrooms - Community & Economic Development : Restroom , Lavatory

Womens Restroom Next to Offices

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 24.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Notes : Supply Lines Not Completely Wrapped.

Record Number 71318

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Lavatory

Womens Restroom Next to Offices

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Supply Lines Not Completely Wrapped.

Record Number 71320

Restrooms - Community & Economic Development : Restroom , Lavatory

Womens Restroom Next to Offices

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 24.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Notes : Supply Lines Not Completely Wrapped.

Record Number 71319

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Wall Signage

Womens Restroom Next to Offices

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 71322

Restrooms - Community & Economic Development : Restroom , Door Signage

Womens Restroom Next to Offices

Female

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 68.00 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 71321

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom ,
Dispensers**

Womens Restroom Next to Offices

Soap

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Record Number 71316

**Restrooms - Community & Economic Development : Restroom ,
Dispensers**

Womens Restroom Next to Offices

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 49.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71315

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom ,
Dispensers**

Womens Restroom Next to Offices

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 55.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71317

Restrooms - Community & Economic Development : Restroom , Lavatory

Mens Restroom Next to Offices

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71331

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Lavatory

Mens Restroom Next to Offices

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71332

Restrooms - Community & Economic Development : Restroom , Lavatory

Mens Restroom Next to Offices

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 28.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71329

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Lavatory

Mens Restroom Next to Offices

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 13.00 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71330

Restrooms - Community & Economic Development : Restroom , Wall Signage

Mens Restroom Next to Offices

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 71334

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Door Signage

Mens Restroom Next to Offices

Male

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 69.12 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 71333

Restrooms - Community & Economic Development : Restroom , Dispensers

Mens Restroom Next to Offices

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 52.75 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71327

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Dispensers

Mens Restroom Next to Offices

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 50.25 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71328

Restrooms - Community & Economic Development : Restroom

Unisex Restroom in Permit Center

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Code Reference ADA 213, 213.2.1, CA 11B-213.2.1

Record Number 71771

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Lavatory

Unisex Restroom in Permit Center

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71776

Restrooms - Community & Economic Development : Restroom , Lavatory

Unisex Restroom in Permit Center

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 17.62 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71775

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Lavatory

Unisex Restroom in Permit Center

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 28.12 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71774

Restrooms - Community & Economic Development : Restroom , Lavatory

Unisex Restroom in Permit Center

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71777

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom

**Unisex Restroom in Permit Center
Lavatory**

Finding

There is not enough toe clearance at the restroom lavatory.

On-Site Finding 6.37 inches

Recommendation

Provide minimum required toe clearance.

Recommendation At least 9.00 inches

Code Reference ADA 213, 306.2.1, 606, 606.2

Notes : Pipes Not Completely Wrapped. Supply Lines Not Completely Wrapped.

Record Number 71778

**Restrooms - Community & Economic Development : Restroom , Wall
Signage**

Unisex Restroom in Permit Center

Finding

There is no signage with the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Install signage that includes the International Symbol of Accessibility (ISA Symbol).

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, 703.7, CA 11B-703.7

Record Number 71779

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom ,
Dispensers**

**Unisex Restroom in Permit Center
Soap**

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 49.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71772

**Restrooms - Community & Economic Development : Restroom ,
Dispensers**

**Unisex Restroom in Permit Center
Paper Towel**

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 55.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 71773

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom , Toilet
Compartment**

Unisex Restroom in Permit Center

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 59.50 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Notes : Furniture Obstructs Clearance Around Toilet Length. With Obstruction Removed Length is 81".

Record Number 71783

Restrooms - Community & Economic Development : Restroom , Grab Bar

Unisex Restroom in Permit Center

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 71788

Community & Economic Development Department

**Restrooms - Community & Economic Development : Restroom , Toilet
Compartment**

Unisex Restroom in Permit Center

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 14.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 71789

Restrooms - Community & Economic Development : Restroom , Toilet

Unisex Restroom in Permit Center

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 33.62 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 71786

Community & Economic Development Department

Restrooms - Community & Economic Development : Restroom , Toilet
Unisex Restroom in Permit Center

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 38.25 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 71787

Restrooms - Community & Economic Development : Restroom , Toilet
Unisex Restroom in Permit Center

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 18.75 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 71784

Community & Economic Development Department

**Emergency Warning Systems - Community & Economic Development :
Emergency Warning Systems**

Visual Alarms

Finding

There are some visual warning devices, though visual warning devices are not located throughout the facility.

On-Site Finding Some Found

Recommendation

Install visual warning devices integrated with the facility's alarm system in all common areas such as hallways, classrooms and general use rooms, accessible restrooms and other accessible rooms.

Recommendation See Recommendation

Code Reference ADA 215, 702, CA 11B-215, 702

Notes : No Visual Alarms in Unisex Restroom

Record Number 71761

**Break/Conference Room - Community & Economic Development : Break
Room , Sink**

Break Room

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 71251

Community & Economic Development Department

Break/Conference Room - Community & Economic Development : Break Room

Break Room

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.25 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 71247

Break/Conference Room - Community & Economic Development : Break Room

Break Room

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 71249

Community & Economic Development Department

Break/Conference Room - Community & Economic Development : Break Room

Break Room

Finding

The cabinet door hardware is not accessible.

On-Site Finding None Found

Recommendation

Provide compliant hardware for the cabinet door.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309, CA 11B-606.4

Record Number 71250

Break/Conference Room - Community & Economic Development : Break Room

Break Room

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 71248

Community & Economic Development Department

Break/Conference Room - Community & Economic Development : Break Room

Break Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 41.25 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 71253

Break/Conference Room - Community & Economic Development : Break Room , Appliance

Break Room

Refrigerator

Finding

Appliance Reach Height in the break/conference room is not compliant.

On-Site Finding 49.00 inches

Recommendation

Make sure that the specified appliance reach height is compliant.

Recommendation Up to 48.00 inches

Code Reference ADA 205, 308, 309, CA 11B-205, 308, 309

Record Number 71252

Community & Economic Development Department

Break/Conference Room - Community & Economic Development : Break Room

Conference Room

Finding

The table knee clearance does not meet required standards.

On-Site Finding 26.50 inches

Recommendation

Provide compliant tables.

Recommendation At least 27.00 inches

Code Reference ADA 305, 306, 902.2, CA 11B-305, 306, 902.2

Record Number 71262

Picnic Areas - Exterior : Picnic Tables

Picnic Table

Finding

At least 5% of the provided tables are not accessible.

On-Site Finding None Found

Recommendation

Provide enough compliant Accessible Tables (At least 5% of the total Tables).

Recommendation At least 1.00 tables

Code Reference ADA 205, 226.1, 228, 305, 306, 308, 309, 902

Record Number 71261

Community & Economic Development Department

Picnic Areas - Exterior : Picnic Tables

Picnic Table

Finding

There is no accessible route to the picnic tables.

On-Site Finding None Found

Recommendation

Provide an accessible route to the picnic tables.

Recommendation See Recommendation

Code Reference ADA 205, 226, 228, 308, 309, 402, 403, CA 11B-246.5, 902

Record Number 71260

Lockers - Community & Economic Development : Lockers

Lockers Permit Center

Finding

No accessible lockers were found.

On-Site Finding Not Available

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Code Reference ADA 225.2.1 , 811, CA 11B-225.2.1, 811

Record Number 71763

Accessibility Survey



Cooley Landing Park & Educational Center

2100 Bay Road
East Palo Alto, CA 94303

Date of Inspection

10/10/2017

Prepared By

Disability Access Consultants

Cooley Landing Park & Educational Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Educational Center

Next to Education Center, Right Accessible Space

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 68170

Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Educational Center

Next to Education Center, Right Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 68171

Cooley Landing Park & Educational Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Educational Center

Next to Education Center, Right Accessible Space

Finding

The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.

On-Site Finding See Above

Recommendation

Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.

Recommendation See Recommendation

Code Reference ADA 502.3, CA 11B-502.7.1

Record Number 68172

Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Educational Center

Next to Education Center, Left Accessible Space

Finding

The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.

On-Site Finding See Above

Recommendation

Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.

Recommendation See Recommendation

Code Reference ADA 502.3, CA 11B-502.7.1

Record Number 68173

Cooley Landing Park & Educational Center

Parking - Exterior : Parking Lot , Parking Space

**Parking Lot Next to Educational Center
Next to Education Center, Left Accessible Space**

Finding

There is no additional signage marked "van accessible" at the van accessible parking space.

On-Site Finding None Found

Recommendation

Van accessible parking spaces shall provide additional signage that states "van accessible" .

Recommendation See Recommendation

Code Reference ADA 502, 502.6

Record Number 68174

Parking - Exterior : Parking Lot , Parking Space

Preserve Parking Lot

Finding

There is no designated "van accessible" parking space provided in the parking lot.

On-Site Finding None Found

Recommendation

Provide a compliant van accessible space.

Recommendation See Recommendation

Code Reference ADA 208, 208.2.4, 502.7, CA 11B-208.2.4, 502.7

Record Number 69468

Cooley Landing Park & Educational Center

Parking - Exterior : Parking Lot , Parking Space

Preserve Parking Lot

Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 69470

Parking - Exterior : Parking Lot , Parking Space

Preserve Parking Lot

Accessible Space

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 69469

Cooley Landing Park & Educational Center

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Right Curb Ramp Next to Accesible Spaces

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 68176

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

South Curb Ramp at Crosswalk

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 71752

Cooley Landing Park & Educational Center

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

South Curb Ramp at Crosswalk

Bottom Landing

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 3.40 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 71751

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Path of Travel from the Accessible Spaces Next to Educational Center

Sidewalk Adjoins Vehicular Traffic

Finding

Detectable warnings are not the same width as the crosswalk.

On-Site Finding Not Compliant

Recommendation

Provide compliant detectable warnings that are the full width of the crosswalk.

Recommendation See Recommendation

Code Reference

Record Number 68175

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Preserve Parking Lot
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.10 percent for 120.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 69472

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way - Continued
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 4.10 percent for 250.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 69473

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way - Continued
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 69475

Path of Travel - Exterior : Path Of Travel

**Path of Travel from the Public Right of Way - Continued
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 69474

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel

**Path of Travel from the Public Right of Way
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 69477

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 69478

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.60 percent for 200.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 69476

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel to North Observation Point
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 71728

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**South Path of Travel from Parking Lot to Picnic Area
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.10 percent for 4.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 71730

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**South Path of Travel from Picnic Area to Arroyo Lupine Bench
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 42.00 percent

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 71742

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Parking Lot North Side of Education Center to East Patio

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.50 percent for 10.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 71743

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel to South Observation Point

Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 71744

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

North Path of Travel from California Ckaoer Rail Pad to Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.20 percent for 26.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 71749

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

North Path of Travel from California Ckaoer Rail Pad to Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Bevel the area or resurface the area to provide a smooth and level path of travel.

Recommendation Up to 0.50 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 71750

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from East Patio to Circle Assembly Area

Open Area

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 16.80 percent

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 71753

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from East Patio to Circle Assembly Area

Open Area

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 71754

Cooley Landing Park & Educational Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Parking Lot to North Path

Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 71755

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Parking Lot to North Path

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 43.00 inches for 65.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 71756

Cooley Landing Park & Educational Center

Doors - Education Center : Door , Clear Floor Space

Main Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 69451

Doors - Education Center : Door , Clear Floor Space

Main Entrance

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 19.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 69450

Cooley Landing Park & Educational Center

Doors - Education Center : Door , Hardware

Main Entrance

Push Bar / D Handle

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69449

Doors - Education Center : Door , Hardware

East Entrance

Push Bar / D Handle

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69471

Cooley Landing Park & Educational Center

Doors - Education Center : Door , Hardware

**Womens Restroom Next to Main Entrance
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69485

Doors - Education Center : Door , Hardware

**Entrance Next to Warming Kitchen
Push Bar / D Handle**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 12.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69486

Cooley Landing Park & Educational Center

Doors - Education Center : Door , Threshold

Entrance Next to Warming Kitchen

Finding

The height of the threshold at the entrance door is greater than allowed for a vertical rise.

On-Site Finding 0.50 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 69487

Doors - Education Center : Door , Hardware

Mens Restroom Next to Main Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69488

Cooley Landing Park & Educational Center

Doors - Education Center : Door , Clear Floor Space

Office

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 58.87 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 69490

Doors - Education Center : Door , Hardware

Office

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69489

Cooley Landing Park & Educational Center

Doors - Education Center : Door , Clear Floor Space

Warming Kitchen

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 45.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Table Obstructs Clear Floor Space Length.

Record Number 69499

Doors - Education Center : Door , Hardware

Warming Kitchen

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 13.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 69497

Cooley Landing Park & Educational Center

Doors - Education Center : Door , Hardware

Warming Kitchen

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 8.00 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 69498

Doors - Exterior : Door

Portable Restroom

Finding

The clear opening width of the door is less than required.

On-Site Finding 31.62 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Notes : Closing Mechanism Vandalized at Time of Inspection.

Record Number 71757

Cooley Landing Park & Educational Center

Doors - Exterior : Door , Clear Floor Space

Portable Restroom

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 31.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 71759

Doors - Exterior : Door , Clear Floor Space

Portable Restroom

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.50 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 71760

Cooley Landing Park & Educational Center

Doors - Exterior : Door , Hardware

Portable Restroom

Push / Pull

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 71758

Signage - Education Center : Signage , Room Identification

Office

Finding

The accessible element/identification signage attached to the wall does not include raised lettering or numbering.

On-Site Finding None Found

Recommendation

Install accessible signage that includes raised UPPERCASE letters and/or numbers between 5/8 inch and 2 inches in height

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, 703.2.1, CA 11B-703.2.1

Record Number 69462

Cooley Landing Park & Educational Center

Signage - Education Center : Signage , Room Identification

Office

Finding

The accessible element/identification signage attached to the wall does not include Braille characters.

On-Site Finding None Found

Recommendation

Install accessible signage to include Grade 2 Braille characters.

Recommendation See Recommendation

Code Reference ADA 216, 703, 703.3, CA 11B-703.3

Record Number 69460

Signage - Education Center : Signage , Contains the word Handicap

Office

Finding

Signage contains the word Handicap.

On-Site Finding None Found

Recommendation

Provide compliant signage. Remove the word Handicap.

Recommendation See Recommendation

Code Reference ADA 216, 703

Record Number 69464

Cooley Landing Park & Educational Center

Signage - Education Center : Signage

Office

Finding

Clear floor space of at least 18"x18" is not centered at the signage and/or is within the swing of the door.

On-Site Finding Not Compliant

Recommendation

Provide at least 18"x18" of clear floor space centered at the signage. Make sure it is not located within the door swing.

Recommendation See Recommendation

Code Reference ADA 703.4.2, CA 11B-703.4.2

Record Number 69463

Signage - Education Center : Signage , Room Identification

Office

Finding

The accessible element/identification signage attached to the wall is not contrasting.

On-Site Finding None Found

Recommendation

Install accessible signage that has a contrasting finish.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, 703.5.1, CA 11B-703.5.1

Record Number 69461

Cooley Landing Park & Educational Center

Signage - Education Center : Signage , Signage

East Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 69483

Signage - Education Center : Signage

Main Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 69484

Cooley Landing Park & Educational Center

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 69491

Restrooms - Education Center : Restroom

Mens Restroom Next to Main Entrance

Finding

The shields extend greater than 24" in front of the urinal. The width between the shields is less than required.

On-Site Finding 35.50 inches

Recommendation

Modify or replace the urinal shields in the restroom to provide the required clearance between the shields for the urinal designated as accessible.

Recommendation At least 36.00 inches

Code Reference ADA 305.7, 605, 605.3, CA 11B-305.7, 605.3

Record Number 69455

Cooley Landing Park & Educational Center

Restrooms - Education Center : Restroom , Lavatory

Mens Restroom Next to Main Entrance

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 16.25 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Record Number 69454

Restrooms - Education Center : Restroom , Lavatory

Mens Restroom Next to Main Entrance

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 24.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Record Number 69453

Cooley Landing Park & Educational Center

Restrooms - Education Center : Restroom , Wall Signage

Mens Restroom Next to Main Entrance

Finding

There is signage posted on the latch side of the entry door to the restroom. The signage does not include uppercase characters.

On-Site Finding None Found

Recommendation

Post signage designating the restroom as accessible. Signage shall be mounted at the required height and location and shall include Braille, uppercase characters, raised lettering, the International Symbol of Accessibility symbol and gender use pictogram.

Recommendation See Recommendation

Code Reference ADA 216, 703, 703.2.2, CA 11B-703.2

Record Number 69456

Restrooms - Education Center : Restroom , Dispensers

Mens Restroom Next to Main Entrance

Soap

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Record Number 69452

Cooley Landing Park & Educational Center

Restrooms - Education Center : Restroom , Compartment Door

Mens Restroom Next to Main Entrance

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 69459

Restrooms - Education Center : Restroom , Grab Bar

Mens Restroom Next to Main Entrance

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 69458

Cooley Landing Park & Educational Center

Restrooms - Education Center : Restroom , Lavatory

**Womens Restroom Next to Main Entrance
Lavatory**

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 15.50 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
center

Code Reference CA 11B-606.6

Record Number 69466

Restrooms - Education Center : Restroom , Lavatory

**Womens Restroom Next to Main Entrance
Lavatory**

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 24.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Record Number 69465

Cooley Landing Park & Educational Center

Restrooms - Education Center : Restroom , Wall Signage

Womens Restroom Next to Main Entrance

Finding

There is signage posted on the latch side of the entry door to the restroom. The signage does not include uppercase characters.

On-Site Finding None Found

Recommendation

Post signage designating the restroom as accessible. Signage shall be mounted at the required height and location and shall include Braille, uppercase characters, raised lettering, the International Symbol of Accessibility symbol and gender use pictogram.

Recommendation See Recommendation

Code Reference ADA 216, 703, 703.2.2, CA 11B-703.2

Record Number 69467

Restrooms - Education Center : Restroom , Grab Bars

Womens Restroom Next to Main Entrance

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 47.50 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Record Number 69480

Cooley Landing Park & Educational Center

Restrooms - Education Center : Restroom , Grab Bars

Womens Restroom Next to Main Entrance

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 16.00 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 69481

Restrooms - Education Center : Restroom , Grab Bars

Womens Restroom Next to Main Entrance

Finding

The distance between the wall and the gripping surface of the grab bar does not meet requirements.

On-Site Finding 15.00 inches

Recommendation

Remount the grab bar so the space between the wall and gripping surface meets requirements. Grab bars must be able to support a point load of at least 250 pounds and shall be less than the allowable shear stress of the grab bar material.

Recommendation 1.50 inches

Code Reference ADA 505, 604.9.3, 609.3, CA 11B-604.5, 609.3

Record Number 69482

Cooley Landing Park & Educational Center

Restrooms - Exterior : Restroom , Wall Signage

Portable Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Notes : Signage Vandalized at Time of Inspection.

Record Number 71735

Restrooms - Exterior : Restroom , Door Signage

Portable Restroom

Unisex

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 71734

Cooley Landing Park & Educational Center

Restrooms - Exterior : Restroom , Dispensers

Portable Restroom

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Notes : Not Operational at Time of Inspection. Interfers With Grab Bar.

Record Number 71731

Restrooms - Exterior : Restroom , Dispensers

Portable Restroom

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 44.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Notes : Not Operational at Time of Inspection. Interfers With Grab Bar.

Record Number 71732

Cooley Landing Park & Educational Center

Restrooms - Exterior : Restroom , Dispensers

Portable Restroom

Soap

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Notes : Not Operational at Time of Inspection. Interfers With Grab Bar.

Record Number 71733

Restrooms - Exterior : Restroom , Toilet Compartment

Portable Restroom

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 53.50 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 71736

Cooley Landing Park & Educational Center

Restrooms - Exterior : Restroom , Grab Bars

Portable Restroom

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 51.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Notes : Rear Grab Bar Intefers With Toilet Seat Lid.

Record Number 71738

Restrooms - Exterior : Restroom

Portable Restroom

Finding

Rear grab bar interferes with the tank/flushometer.

On-Site Finding Not Compliant

Recommendation

Readjust the rear grab bar so that it does not interfere with the tank/flushometer.

Recommendation See Recommendation

Code Reference ADA 609.3, CA 11B-609.3

Notes : Rear Grab Bar Intefers With Toilet Seat Lid.

Record Number 71739

Cooley Landing Park & Educational Center

Restrooms - Exterior : Restroom , Toilet Compartment

Portable Restroom

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 5.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 71740

Restrooms - Exterior : Restroom , Toilet

Portable Restroom

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 19.50 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 71737

Cooley Landing Park & Educational Center

Assembly Areas - Exterior : Assembly Area

Circle Assembly Area Next to East Patio

Finding

There are not enough accessible seats at the location with respect to the total number of seats available.

On-Site Finding None Found

Recommendation

Provide compliant accessible seating at the location.

Recommendation At least 1.00 seats

Code Reference ADA 221.2 , 802.1, CA 11B-221.2, 802.1

Record Number 71741

Break/Conference Room - Education Center : Break Room

Warming Kitchen

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 69494

Cooley Landing Park & Educational Center

Break/Conference Room - Education Center : Break Room

Warming Kitchen

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 69495

Break/Conference Room - Education Center : Break Room , Sink

Warming Kitchen

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 69496

Cooley Landing Park & Educational Center

Break/Conference Room - Education Center : Break Room

Warming Kitchen

Finding

The table knee clearance does not meet required standards.

On-Site Finding 26.75 inches

Recommendation

Provide compliant tables.

Recommendation At least 27.00 inches

Code Reference ADA 305, 306, 902.2, CA 11B-305, 306, 902.2

Record Number 69492

Break/Conference Room - Education Center : Break Room

Warming Kitchen

Finding

The table knee depth does not meet required standards.

On-Site Finding 14.75 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Code Reference ADA 205, 228, 306.3.3, 308, 309, CA 11B-306.3.2, 306.3.3, 902.2

Record Number 69493

Cooley Landing Park & Educational Center

Picnic Areas - Exterior : Picnic Tables

Picnic Table

Finding

The picnic table surface is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Not Compliant

Recommendation

Provide a compliant picnic table.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309

Record Number 71729

Reach Ranges - Exterior : Reach Range

Park

Trash/Recycle Receptacle

Finding

Element controls are non accessible.

On-Site Finding None Found

Recommendation

Provide compliant controls for the element.

Recommendation See Recommendation

Code Reference ADA 205, 302, 308, 309, 410, CA 11B-309.4

Record Number 71745

Cooley Landing Park & Educational Center

Reach Ranges - Exterior : Reach Range

Park

Trash/Recycle Receptacle

Finding

Element controls are non accessible.

On-Site Finding None Found

Recommendation

Provide compliant controls for the element.

Recommendation See Recommendation

Code Reference ADA 205, 302, 308, 309, 410, CA 11B-309.4

Record Number 71748

Reach Ranges - Exterior : Reach Range , Clear Floor Space Length

Park

Trash/Recycle Receptacle

Finding

The clear floor space length is not compliant.

On-Site Finding 23.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Code Reference ADA 304, 305.3, CA 11B-305, 309.2

Record Number 71746

Cooley Landing Park & Educational Center

Reach Ranges - Exterior : Reach Range , Element

Park

Trash/Recycle Receptacle

Finding

The element is not located on the accessible route.

On-Site Finding None

Recommendation

The element must be located on the accessible route.

Recommendation See Recommendation

Code Reference ADA 206, 304

Record Number 71747

Accessibility Survey



Gloria Well

2401-2449 Gloria Way
East Palo Alto, CA 94303

Date of Inspection

11/12/2017

Prepared By

Disability Access Consultants

Gloria Well

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 87736

Gloria Well

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way

Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 87737

Accessibility Survey



Jack Farrell Park
2500 Fordham Street
East Palo Alto, CA 94303

Date of Inspection

10/3/2017

Prepared By

Disability Access Consultants

Jack Farrell Park

Parking - Exterior : Parking Lot

Parking Lot

Finding

The location of the designated accessible parking space(s) is not located on the shortest accessible route of travel to the facility for which it serves.

On-Site Finding Not on Path

Recommendation

Remove and relocate the designated accessible parking spaces. Accessible paved parking spaces shall be located on the shortest accessible route of travel to the facility for which it serves and shall coincide with the primary route and primary entrances used by the general public.

Recommendation See Recommendation

Code Reference ADA 208, 208.3, 502, CA 11B-208.2

Record Number 62888

Jack Farrell Park

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 62899

Jack Farrell Park

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 62900

Jack Farrell Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Restrooms

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 80.00 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 96.00 inches

Code Reference CA 11B-502.2

Record Number 62892

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Restrooms

Finding

There is an accessible parking space designated in the parking lot. The access aisle is not located on the passenger's side (right side) of the parking space.

On-Site Finding See Above

Recommendation

Provide a compliant access aisle on the passenger side of the accessible parking space.

Recommendation See Recommendation

Code Reference ADA 502, CA 11B-502.3.4

Record Number 62891

Jack Farrell Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Restrooms

Finding

The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.

On-Site Finding None Found

Recommendation

Paint "NO PARKING" in 12 inch white letters.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 62894

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Accessible Space Next to Restrooms

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 62890

Jack Farrell Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Restrooms

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 3.90 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 62889

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Restrooms

Finding

The access aisle exceeds maximum slope.

On-Site Finding 4.00 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 62893

Jack Farrell Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Basketball Court

Finding

The access aisle exceeds maximum slope.

On-Site Finding 2.30 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 62897

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Accessible Space Next to Basketball Court

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 62895

Jack Farrell Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Basketball Court

Finding

The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.

On-Site Finding None Found

Recommendation

Paint "NO PARKING" in 12 inch white letters.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 62898

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space Next to Basketball Court

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 75.50 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 96.00 inches

Code Reference CA 11B-502.2

Record Number 62896

Jack Farrell Park

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to the Accessible Space Next to Basketball Courts

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 62916

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to the Accessible Space Next to Basketball Courts

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 24.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Code Reference ADA 406, 406.3, CA 11B-406.2.2

Record Number 62919

Jack Farrell Park

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to the Accessible Space Next to Basketball Courts

Finding

The width of the curb ramp is less than required.

On-Site Finding 36.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Code Reference ADA 405.5, 406, 406.1, CA 11B-406.5.2

Record Number 62917

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to the Accessible Space Next to Basketball Courts

Finding

The running slope is greater than allowed.

On-Site Finding 11.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Code Reference ADA 405.2, 406, 406.1, CA 11B-406.2.2

Record Number 62918

Jack Farrell Park

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Curb Ramp Next to the Acessible Space Next to Basketball Courts
Bottom Landing**

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 62920

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Curb Ramp Next to the Acessible Space Next to Basketball Courts
Top Landing**

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 62921

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at Gonzaga Street

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 62884

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way at Gonzaga Street

Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 62885

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way Next to Basketball Court
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 62887

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way Next to Basketball Court
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 32.00 percent for 40.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 62886

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel Behind 3rd Base Side Bleachers
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.00 percent for 30.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 62901

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel Behind 3rd Base Side Bleachers
Exterior Walkway**

Finding

The width of the path of travel is insufficient.

On-Site Finding 28.00 inches for 37.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 62902

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel to Baseball Field

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 4.90 percent for 42.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 62908

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel to Baseball Field

Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.00 percent for 42.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 62907

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel to Baseball Field

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 62909

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Patg Next to Large Play Area

Open Area

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 19.60 percent for 7.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 62911

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Park Path from North Park Entrance Around Fields to South Side of Park Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.80 percent for 85.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 62912

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Park Path from North Park Entrance Around Fields to South Side of Park Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 62913

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

**Park Path from Restroom Building to Norh Park Entrance
Tree Limb**

Finding

The vertical clearance height is less than required.

On-Site Finding 74.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 62915

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Park Path from Restroom Building to Norh Park Entrance
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.10 percent for 40.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 62914

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel Around Basketball Court

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.50 percent for 30.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 62922

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel Around Basketball Court

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 62924

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel Around Basketball Court

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Bevel the area or resurface the area to provide a smooth and level path of travel.

Recommendation Up to 0.50 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 62923

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel to Baseball Field 1st Base Field Entrance

Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 62928

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Park Path from Basketball Court to Restrooms Building
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 62946

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Park Path from Basketball Court to Restrooms Building
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 8.10 percent for 12.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 62945

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel to Baseball Field 3rd Base Field Entrance
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 62949

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Park Path to Basketball Court
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 10.00 percent for 45.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 62950

Jack Farrell Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Park Path to Basketball Court

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 62952

Path of Travel - Exterior : Path Of Travel

Park Path to Basketball Court

Exterior Walkway

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 62951

Jack Farrell Park

Ramps - Exterior : Ramp , Ramp Run

Ramp Next to Restroom Building

Run 1

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 12.40 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Code Reference ADA 405, 405.2, CA 11B-405.2

Record Number 62877

Ramps - Exterior : Ramp , Ramp Run

Ramp Next to Restroom Building

Run 1

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Code Reference ADA 405, 405.9, CA 11B-405.9

Record Number 62876

Jack Farrell Park

Ramps - Exterior : Ramp , Handrail

Ramp Next to Restroom Building

Run 1

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 62878

Ramps - Exterior : Ramp , Landing

Ramp Next to Restroom Building

Run 1 Bottom Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 7.80 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Record Number 62879

Jack Farrell Park

Ramps - Exterior : Ramp , Landing

Ramp Next to Restroom Building

Run 1 Top Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 5.80 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Record Number 62881

Ramps - Exterior : Ramp , Landing

Ramp Next to Restroom Building

Run 1 Top Landing

Finding

The length of the top landing does not meet the required minimum length.

On-Site Finding 9.00 inches

Recommendation

Modify or replace the top landing to provide the required minimum length and width.

Recommendation At least 60.00 inches

Code Reference ADA 405.7, 405.7.3, CA 11B-405.7.3

Record Number 62880

Jack Farrell Park

Ramps - Exterior : Ramp , Handrail

Ramp Next to Restroom Building

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505

Record Number 62883

Ramps - Exterior : Ramp , Handrail

Ramp Next to Restroom Building

Run 1 Left Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 62882

Jack Farrell Park

Stairs - Exterior : Stairway , Risers Striping

Stairs Next to Baseball Field

Run 1

Finding

There is no detectable striping on each tread of the exterior stairway.

On-Site Finding None Found

Recommendation

Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-504.4.1

Record Number 62935

Stairs - Exterior : Stairway , Handrails

Stairs Next to Baseball Field

Run 1

Finding

There are no handrails provided on the stairway.

On-Site Finding None Found

Recommendation

Provide compliant handrails.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.2, CA 11B-504.6, 505.2

Record Number 62934

Jack Farrell Park

Doors - Exterior : Door , Clear Floor Space

3rd Base Field Entrance

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 36.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Landing is Grass/Dirt.

Record Number 62905

Doors - Exterior : Door , Clear Floor Space

3rd Base Field Entrance

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 8.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Notes : Landing is Grass/Dirt.

Record Number 62906

Jack Farrell Park

Doors - Exterior : Door , Hardware

3rd Base Field Entrance

Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 62903

Doors - Exterior : Door , Threshold

3rd Base Field Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 2.25 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 62904

Jack Farrell Park

Doors - Exterior : Door , Threshold

1st Base Dugout

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.25 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 67249

Doors - Exterior : Door , Clear Floor Space

1st Base Field Entrance

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 12.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Record Number 67252

Jack Farrell Park

Doors - Exterior : Door , Threshold

1st Base Field Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 67251

Doors - Exterior : Door , Hardware

1st Base Field Entrance

Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 67250

Jack Farrell Park

Doors - Exterior : Door

3rd Base Dugout

Finding

The clear opening width of the doorway is not compliant.

On-Site Finding 30.50 inches

Recommendation

Provide a compliant doorway at the location.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.4.2

Record Number 67255

Doors - Restrooms : Door

Womens Restroom Next to Play Area

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.62 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 67263

Jack Farrell Park

Doors - Restrooms : Door , Hardware

**Womens Restroom Next to Play Area
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 67265

Doors - Restrooms : Door

Concessions

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.62 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 67268

Jack Farrell Park

Doors - Restrooms : Door , Hardware Height

Concessions

Lever

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 47.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Notes : Door Drags on Ground

Record Number 67271

Doors - Restrooms : Door , Hardware

Concessions

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 32.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Notes : Door Drags on Ground

Record Number 67270

Jack Farrell Park

Doors - Restrooms : Door , Hardware

Mens Restroom Next to Play Area

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 12.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 67273

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 62948

Jack Farrell Park

Signage - Restrooms : Signage

Concession Stand

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 67247

Restrooms - Restrooms : Restroom , Wall Signage

Mens Restroom Next to Play Area

Finding

There is signage posted on the latch side of the entry door to the restroom. The signage does not include uppercase characters.

On-Site Finding None Found

Recommendation

Post signage designating the restroom as accessible. Signage shall be mounted at the required height and location and shall include Braille, uppercase characters, raised lettering, the International Symbol of Accessibility symbol and gender use pictogram.

Recommendation See Recommendation

Code Reference ADA 216, 703, 703.2.2, CA 11B-703.2

Notes : Signage Vandalized at Time of Inspection.

Record Number 67254

Jack Farrell Park

Restrooms - Restrooms : Restroom , Door Signage

Mens Restroom Next to Play Area

Male

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 67253

Restrooms - Restrooms : Restroom , Wall Signage

Womens Restroom Next to Play Area

Finding

There is signage posted on the latch side of the entry door to the restroom. The signage does not include uppercase characters.

On-Site Finding None Found

Recommendation

Post signage designating the restroom as accessible. Signage shall be mounted at the required height and location and shall include Braille, uppercase characters, raised lettering, the International Symbol of Accessibility symbol and gender use pictogram.

Recommendation See Recommendation

Code Reference ADA 216, 703, 703.2.2, CA 11B-703.2

Notes : Signage Vandalized at Time of Inspection.

Record Number 67257

Jack Farrell Park

Restrooms - Restrooms : Restroom , Door Signage

Womens Restroom Next to Play Area

Female

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 67256

Restrooms - Restrooms : Restroom , Compartment Door

Womens Restroom Next to Play Area

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 67262

Jack Farrell Park

Restrooms - Restrooms : Restroom , Grab Bar

Womens Restroom Next to Play Area

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 67261

Restrooms - Restrooms : Restroom , Compartment Door

Mens Restroom Next to Play Area

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 67267

Jack Farrell Park

Restrooms - Restrooms : Restroom , Grab Bar

Mens Restroom Next to Play Area

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 67266

Drinking Fountains - Restrooms : Drinking Fountains

Drinking Fountain Next to Restrooms

Finding

The drinking fountain is a protruding object.

On-Site Finding None

Recommendation

Make sure that the fountain is not a protruding object.

Recommendation See Recommendation

Code Reference ADA 211, 305, 306, 307.2, 602, CA 11B-307.2, 602

Record Number 62925

Jack Farrell Park

Drinking Fountains - Restrooms : Drinking Fountain

Drinking Fountain Next to Restrooms

Finding

The height of the water stream is less than required.

On-Site Finding 3.00 inches

Recommendation

Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.

Recommendation At least 4.00 inches

Code Reference ADA 211, 602, 602.6, CA 11B-211, 602

Record Number 62926

Drinking Fountains - Restrooms : Drinking Fountain

Drinking Fountain Next to Restrooms

Finding

The drinking fountain is not set entirely in an alcove.

On-Site Finding None Found

Recommendation

If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.

Recommendation See Recommendation

Code Reference ADA 307.2, 602.1 , CA 11B-602.9

Record Number 62927

Jack Farrell Park

Outdoor Sports Areas - Exterior : Outdoor Sports Area

Baseball Field

Finding

There are not enough accessible seats at the location with respect to the total number of seats available.

On-Site Finding None Found

Recommendation

Provide compliant accessible seating at the location.

Recommendation At least 4.00 seats

Code Reference ADA 221.2 , 802.1, CA 11B-221.2, 802.1

Record Number 67248

Play Area - Exterior : Play Area , Walking Surfaces

Large Play Area

Change in Level

Finding

There is a change in level greater than allowed on the path of travel.

On-Site Finding 1.25 inches

Recommendation

Provide a smooth transition.

Recommendation Up to 0.25 inches

Code Reference ADA 1008.2, 303, 303.2, 303.3, 403.4

Record Number 62933

Jack Farrell Park

Play Area - Exterior : Play Area , Equipment

Large Play Area

Elevated Equipment - Rubberized Surface

Finding

All risers are not closed.

On-Site Finding Not Closed

Recommendation

All risers shall be closed.

Recommendation See Recommendation

Code Reference ADA 1008

Record Number 62929

Play Area - Exterior : Play Area , Ground level Equipment

Large Play Area

Hand Bicycle - Rubberized Surface

Finding

The controls cannot be operated with one hand and/or require tight pinching, grasping, or twisting of the wrist.

On-Site Finding Not Operable

Recommendation

Provide controls that can be operated with one hand and do not require tight pinching, grasping or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 1008, 309.4

Record Number 62931

Jack Farrell Park

Play Area - Exterior : Play Area , Ground level Equipment

Large Play Area

Hand Bicycle - Rubberized Surface

Finding

The point of operation height for the play equipment is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide compliant play equipment.

Recommendation 16.00 - 44.00 inches

Code Reference ADA 1008, 1008.4.2, 308.1

Record Number 62930

Play Area - Exterior : Play Area

Large Play Area

Chain Ladder - Concrete/Solid Surface

Finding

The surface beneath the play area is non-accessible to individuals with mobility impairments.

On-Site Finding Not Accessible

Recommendation

The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2, 1008.2.6, 240

Record Number 62932

Jack Farrell Park

Play Area - Exterior : Play Area

Small Play Area

Finding

The width of the path of travel to the play area is not compliant.

On-Site Finding 10.00 inches

Recommendation

Provide a compliant accessible route to the play area.

Recommendation At least 60.00 inches

Code Reference ADA 1008, 1008.2, 1008.2.4, 240

Record Number 62936

Play Area - Exterior : Play Area

Small Play Area

Finding

The path of travel slope is greater than allowed.

On-Site Finding 7.00 percent

Recommendation

Provide a path of travel with a compliant slope.

Recommendation Up to 6.25 percent

Code Reference ADA 1008, 1008.2, 240, 403.3

Record Number 62937

Jack Farrell Park

Play Area - Exterior : Play Area , Equipment

Small Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

The transfer platform is not located on shortest route from the play areas accessible point of access.

On-Site Finding Not Located on Shortest Route

Recommendation

The transfer platform shall be located on the shortest route from the play areas accessible point of access.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2

Record Number 62938

Play Area - Exterior : Play Area

Small Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

The surface beneath the play area is non-accessible to individuals with mobility impairments.

On-Site Finding Not Accessible

Recommendation

The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2, 1008.2.6, 240

Record Number 62939

Jack Farrell Park

Play Area - Exterior : Play Area , Elevated or Ground Equipment or Play Table

Small Play Area

Rocker - Rubberized Surface

Finding

The cross slope on the route to the transfer platform/play equipment is not compliant.

On-Site Finding 5.00 percent

Recommendation

Modify the cross slope of the route to transfer platform/play equipment.

Recommendation Up to 2.08 percent

Code Reference ADA 1008, 1008.2, 403.3, CA 11B-403.3

Record Number 62940

Play Area - Exterior : Play Area , Elevated or Ground Equipment or Play Table

Small Play Area

Bucket Swings - Concrete/Solid Surface

Finding

The slope on the route to the transfer platform/play equipment is not compliant.

On-Site Finding 6.90 percent

Recommendation

Modify the slope of the route to transfer platform/play equipment.

Recommendation Up to 6.25 percent

Code Reference ADA 1008, 1008.2, 403.3

Record Number 62942

Jack Farrell Park

Play Area - Exterior : Play Area

Small Play Area

Bucket Swings - Concrete/Solid Surface

Finding

The surface beneath the play area is non-accessible to individuals with mobility impairments.

On-Site Finding Not Accessible

Recommendation

The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2, 1008.2.6, 240

Record Number 62941

Play Area - Exterior : Play Area

Small Play Area

Ladder - Concrete/Solid Surface

Finding

The surface beneath the play area is non-accessible to individuals with mobility impairments.

On-Site Finding Not Accessible

Recommendation

The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2, 1008.2.6, 240

Record Number 62943

Jack Farrell Park

Sinks - Restrooms : Sink

Concessions Handwashing Station

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 67258

Sinks - Restrooms : Sink

Concessions Handwashing Station

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 67259

Jack Farrell Park

Sinks - Restrooms : Sink

Concessions Handwashing Station

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 54.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 309, 606, CA 11B-603.5

Record Number 67260

Picnic Areas - Exterior : Picnic Tables

Picnic Tables Next Basketball Court

Finding

The slope of the clear floor space at the table is not compliant.

On-Site Finding 4.00 percent

Recommendation

Provide compliant clear floor space at the table.

Recommendation Up to 2.08 percent

Code Reference ADA 305.3, 902.2, CA 11B-305.2

Record Number 62944

Accessibility Survey



Joel Davis Park

1960 Tate Street
East Palo Alto, CA 94303

Date of Inspection

10/2/2017

Prepared By

Disability Access Consultants

Joel Davis Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way at McNair Street & Oakes Street

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.50 percent for 25.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 61803

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way to Picnic Area Next to Tate Street

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 61804

Joel Davis Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way at McNair Street Next to Picnic Area

Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.80 percent for 20.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 61805

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Park Path Around Picnic Area to Play Area

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.70 percent for 12.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 61806

Joel Davis Park

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

Park Path to Play Area

Tree Limb

Finding

The vertical clearance height is less than required.

On-Site Finding 72.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 61817

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Park Path to Play Area

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 10.00 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 61815

Joel Davis Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Park Path to Play Area

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 61816

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path Around Play Area

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.80 percent for 60.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 61818

Joel Davis Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Tate Street & Oake Street
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.50 percent for 10.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 61824

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Tate Street & Oake Street
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 5.50 percent for 25.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 61825

Joel Davis Park

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 61823

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Play Area

Finding

There is less than the required minimum knee clearance height.

On-Site Finding 24.00 inches

Recommendation

Provide a fountain with the required knee and toe clearances.

Recommendation At least 27.00 inches

Code Reference ADA 211, 306, 602, 602.2, CA 11B-306, 602.2

Record Number 61819

Joel Davis Park

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Play Area

Finding

The water flow trajectory is not parallel to the front of the drinking fountain.

On-Site Finding Not Compliant

Recommendation

Provide a water flow trajectory that is parallel to the front of the drinking fountain.

Recommendation See Recommendation

Code Reference ADA 602.6, CA 11B-602.6

Record Number 61820

Reach Ranges - Exterior : Reach Range , Clear Floor Space Width

Park

Barbeque

Finding

The clear floor space width is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Code Reference ADA 304, 305.3, CA 11B-305

Notes : Landing is Loose Decompsed Granite

Record Number 61807

Joel Davis Park

Reach Ranges - Exterior : Reach Range , Clear Floor Space Length

Park

Barbeque

Finding

The clear floor space length is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Code Reference ADA 304, 305.3, CA 11B-305, 309.2

Notes : Landing is Loose Decompsed Granite

Record Number 61808

Reach Ranges - Exterior : Reach Range , Clear Floor Space Slope

Park

Pet Waste Bag Dispenser

Finding

The clear floor space slope is not compliant.

On-Site Finding 7.30 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.08 percent

Code Reference ADA 304, CA 11B-305.2

Record Number 61810

Joel Davis Park

Reach Ranges - Exterior : Reach Range , Front Approach

Park

Pet Waste Bag Dispenser

Finding

Element reach depth is not compliant.

On-Site Finding 26.00 inches

Recommendation

Make sure that the element is within allowed reach range with recommended reach depth.

Recommendation Up to 25.00 inches

Code Reference ADA 308

Record Number 61809

Reach Ranges - Exterior : Reach Range , Element Highest Point of Operation

Park

Pet Waste Bag Dispenser

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 55.00 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Record Number 61811

Joel Davis Park

Reach Ranges - Exterior : Reach Range , Element

Park

Hot Coal Disposal

Finding

The element is not located on the accessible route.

On-Site Finding None

Recommendation

The element must be located on the accessible route.

Recommendation See Recommendation

Code Reference ADA 206, 304

Notes : Landing is Loose Decompsed Granite

Record Number 61814

Reach Ranges - Exterior : Reach Range , Clear Floor Space Width

Park

Hot Coal Disposal

Finding

The clear floor space width is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Code Reference ADA 304, 305.3, CA 11B-305

Notes : Landing is Loose Decompsed Granite

Record Number 61812

Joel Davis Park

Reach Ranges - Exterior : Reach Range , Clear Floor Space Length

Park

Hot Coal Disposal

Finding

The clear floor space length is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Code Reference ADA 304, 305.3, CA 11B-305, 309.2

Notes : Landing is Loose Decompsed Granite

Record Number 61813

Benches - Exterior : Bench

Benches Next to Play Area

Finding

No clear floor space provided at the bench.

On-Site Finding Not Found

Recommendation

Provide compliant clear floor space for the bench at one end.

Recommendation See Recommendation

Code Reference ADA 305, 903.2 , CA 11B-305, 903.2

Record Number 61821

Joel Davis Park

Benches - Exterior : Bench

Benches Next to Park Path

Finding

No clear floor space provided at the bench.

On-Site Finding Not Found

Recommendation

Provide compliant clear floor space for the bench at one end.

Recommendation See Recommendation

Code Reference ADA 305, 903.2 , CA 11B-305, 903.2

Record Number 61822

Maintenance Yard

Accessibility Survey



Maintenance Yard

150 Tara Street
East Palo Alto, CA 94303

Date of Inspection

10/10/2017

Prepared By

Disability Access Consultants

Maintenance Yard

Parking - Exterior : Parking Lot , Parking Space

Empkoyee/Fleet

Finding

There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.

On-Site Finding None Found

Recommendation

Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".

Recommendation See Recommendation

Code Reference ADA 208, 208.2, CA 11B-208.2, 502

Record Number 68118

Maintenance Yard

Parking - Exterior : Parking Lot , Warning Signage

Empkoyee/Fleet

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding None Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 68119

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 68128

Maintenance Yard

Path of Travel - Public Works : Path Of Travel

Work Room Hallway

Interior Corridor

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 69412

Path of Travel - Public Works : Path Of Travel , Walking Surfaces

Break Room

Floor Mat

Finding

The mats or carpet runners do not adhere to the underlying floor surface and slip, thereby creating a hazardous path of travel.

On-Site Finding Not Accessible

Recommendation

Securely fasten the mats or carpet runners or replace with a mat or carpet runner that grips to the underlying floor surface to provide a firm, stable, continuous and relatively smooth path of travel surface. Mats or carpet runners along the primary path of travel shall provide beveled edges on all sides to prevent roll over.

Recommendation See Recommendation

Code Reference ADA 302, 302.2, CA 11B-302, 403.2

Record Number 69437

Maintenance Yard

Path of Travel - Public Works : Path Of Travel , Protruding Objects

Reception

Fire Extinguisher

Finding

The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.

On-Site Finding 4.62 inches

Recommendation

Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.

Recommendation Up to 4.00 inches

Code Reference ADA 307, 307.2, CA 11B-307.2

Record Number 69448

Stairs - Public Works : Stairway

Stairs Next to Maintenance Manager

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Code Reference ADA 206.2, 210, 402.2, 504, CA 11B-206.2, 210, 402.2, 504

Record Number 68093

Maintenance Yard

Stairs - Public Works : Stairway , Risers

Stairs Next to Maintenance Manager

Run 1

Finding

The under nosing of the treads on the stairway are abrupt.

On-Site Finding See Above

Recommendation

Modify the nosing on the stairway so that the nosing is curved or beveled and do not project more than required over the tread below.

Recommendation See Recommendation

Code Reference ADA 504, 504.5, CA 11B-504.5

Record Number 68095

Stairs - Public Works : Stairway , Risers Striping

Stairs Next to Maintenance Manager

Run 1

Finding

The width of the striping is not compliant, does not contrast, or is too far from the nosing.

On-Site Finding 0.25 inches

Recommendation

Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 504, CA 11B-504.4.1

Record Number 68098

Maintenance Yard

Stairs - Public Works : Stairway , Risers Striping

Stairs Next to Maintenance Manager

Run 1

Finding

The width of the striping is not compliant, does not contrast, or is too far from the nosing.

On-Site Finding 1.12 inches

Recommendation

Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.

Recommendation Up to 1.00 inches

Code Reference ADA 504, CA 11B-504.4.1

Record Number 68097

Stairs - Public Works : Stairway , Stair Run

Stairs Next to Maintenance Manager

Run 1

Finding

Stair run vertical clearance height is not compliant.

On-Site Finding 72.00 inches

Recommendation

Provide compliant vertical clearance for the stair run.

Recommendation At least 80.00 inches

Code Reference ADA 307.4, CA 11B-307.4

Record Number 68094

Maintenance Yard

Stairs - Public Works : Stairway

Stairs Next to Maintenance Manager

Run 1

Finding

The risers on the stairway are not a compliant height.

On-Site Finding 7.25 inches

Recommendation

Modify or replace the stairs to provide compliant riser height.

Recommendation 4.00 - 7.00 inches

Code Reference ADA 504.2, CA 11B-504.2

Record Number 68096

Stairs - Public Works : Stairway , Handrails

Stairs Next to Maintenance Manager

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.75 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 68104

Maintenance Yard

Stairs - Public Works : Stairway , Handrails

Stairs Next to Maintenance Manager

Run 1 Right Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.6

Record Number 68099

Stairs - Public Works : Stairway , Handrails

Stairs Next to Maintenance Manager

Run 1 Right Handrail

Finding

The handrail extension is not parallel with the floor surface at the bottom landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant extension to the handrail.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-505.10.3

Record Number 68102

Maintenance Yard

Stairs - Public Works : Stairway , Handrails

Stairs Next to Maintenance Manager

Run 1 Right Handrail

Finding

The handrail extension is not the required length.

On-Site Finding 0.00 inches

Recommendation

Install a compliant extension to the handrail.

Recommendation At least 12.00 inches

Code Reference ADA 504, CA 11B-505.10.3

Record Number 68103

Stairs - Public Works : Stairway , Handrails

Stairs Next to Maintenance Manager

Run 1 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 68101

Maintenance Yard

Stairs - Public Works : Stairway , Handrails

Stairs Next to Maintenance Manager

Run 1 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 9.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 68100

Stairs - Public Works : Stairway , Risers Striping

Stairs in Break Room

Run 1

Finding

There is no detectable striping on the stairways.

On-Site Finding None Found

Recommendation

Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-504.4.1

Record Number 69415

Maintenance Yard

Stairs - Public Works : Stairway , Run

Stairs in Break Room

Run 1

Finding

The width of the stairway does not meet the minimum required width.

On-Site Finding 36.00 inches

Recommendation

Install a stairway with a minimum width as required.

Recommendation At least 44.00 inches

Code Reference ADA 210, 504, CA 11B-1009.1, 210, 504

Record Number 69414

Stairs - Public Works : Stairway , Handrails

Stairs in Break Room

Run 1 Left Handrail

Finding

The handrail extension is not parallel with the floor surface at the bottom landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant extension to the handrail.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-505.10.3

Record Number 69416

Maintenance Yard

Stairs - Public Works : Stairway , Handrails

Stairs in Break Room

Run 1 Left Handrail

Finding

The handrail extension is not the required length.

On-Site Finding 0.00 inches

Recommendation

Install a compliant extension to the handrail.

Recommendation At least 12.00 inches

Code Reference ADA 504, CA 11B-505.10.3

Record Number 69417

Stairs - Public Works : Stairway , Handrails

Stairs in Break Room

Run 1 Right Handrail

Finding

The handrail extension is not parallel with the floor surface at the bottom landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant extension to the handrail.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-505.10.3

Record Number 69418

Maintenance Yard

Stairs - Public Works : Stairway , Handrails

Stairs in Break Room

Run 1 Right Handrail

Finding

The handrail extension is not the required length.

On-Site Finding 0.00 inches

Recommendation

Install a compliant extension to the handrail.

Recommendation At least 12.00 inches

Code Reference ADA 504, CA 11B-505.10.3

Record Number 69419

Doors - Public Works : Door

Door Between Reception & Stairwell

Finding

The clear opening width of the door is less than required.

On-Site Finding 30.00 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 68086

Maintenance Yard

Doors - Public Works : Door , Clear Floor Space

**Entrance Next to Maintenance Managers Office
Push Side**

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 68090

Doors - Public Works : Door , Latch Side Clearance

**Entrance Next to Maintenance Managers Office
Push Side**

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 7.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 68089

Maintenance Yard

Doors - Public Works : Door , Clear Floor Space

**Entrance Next to Maintenance Managers Office
Pull Side**

Finding

There is no level landing at this door.

On-Site Finding 6.00 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 68091

Doors - Public Works : Door , Hardware

**Entrance Next to Maintenance Managers Office
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 8.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 68088

Maintenance Yard

Doors - Public Works : Door , Clear Floor Space

Door Between Reception & Workroom

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Notes : Cabinet Obstructs Latch Side Clearance.

Record Number 68108

Doors - Public Works : Door , Latch Side Clearance

Door Between Reception & Workroom

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 1.37 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Notes : Cabinet Obstructs Latch Side Clearance.

Record Number 68106

Maintenance Yard

Doors - Public Works : Door , Latch Side Clearance

Door Between Reception & Workroom Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 15.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 68107

Doors - Public Works : Door

Maintenance Managers Office

Finding

The clear opening width of the door is less than required.

On-Site Finding 30.00 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 68129

Maintenance Yard

Doors - Public Works : Door , Clear Floor Space

Maintenance Managers Office

Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 68130

Doors - Public Works : Door , Clear Floor Space

North Yard Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 68162

Maintenance Yard

Doors - Public Works : Door , Latch Side Clearance

North Yard Entrance

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 6.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 68161

Doors - Public Works : Door , Clear Floor Space

North Yard Entrance

Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 68163

Maintenance Yard

Doors - Public Works : Door , Hardware

North Yard Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 68160

Doors - Public Works : Door

Main Entrance

Finding

The clear opening width of the door is less than required.

On-Site Finding 30.25 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 68164

Maintenance Yard

Doors - Public Works : Door , Clear Floor Space

Main Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 68167

Doors - Public Works : Door , Clear Floor Space

Main Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 4.10 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 68168

Maintenance Yard

Doors - Public Works : Door , Hardware

Main Entrance

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 12.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 68165

Doors - Public Works : Door , Threshold

Main Entrance

Finding

The height of the threshold at the entrance door is greater than allowed for a vertical rise.

On-Site Finding 0.50 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 68166

Maintenance Yard

Doors - Public Works : Door

Unisex Restroom in Break Room

Finding

The clear opening width of the door is less than required.

On-Site Finding 25.75 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 69430

Doors - Public Works : Door , Latch Side Clearance

Unisex Restroom in Break Room

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Notes : Key Box Obstructs Latch Side Clearance.

Record Number 69431

Maintenance Yard

Doors - Public Works : Door , Clear Floor Space

Unisex Restroom in Break Room

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 32.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Notes : Key Box Obstructs Latch Side Clearance.

Record Number 69433

Doors - Public Works : Door , Clear Floor Space

Unisex Restroom in Break Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 57.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Toilet Obstructs Latch Side Clearance. Shower Obstructs Clear Floor Space Length.

Record Number 69434

Maintenance Yard

Doors - Public Works : Door , Latch Side Clearance

Unisex Restroom in Break Room

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 10.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Toilet Obstructs Latch Side Clearance. Shower Obstructs Clear Floor Space Length.

Record Number 69432

Doors - Public Works : Door

Break Room Office

Finding

The clear opening width of the door is less than required.

On-Site Finding 30.00 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 69446

Maintenance Yard

Doors - Public Works : Door , Clear Floor Space

Break Room Office

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 56.62 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Desk Obstructs Clear Floor Space Length.

Record Number 69447

Doors - Public Works , 2nd Floor : Door

2nd Floor Unisex Restroom

Finding

The clear opening width of the door is less than required.

On-Site Finding 25.62 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 68131

Maintenance Yard

Doors - Public Works , 2nd Floor : Door , Latch Side Clearance

2nd Floor Unisex Restroom

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 68134

Doors - Public Works , 2nd Floor : Door , Clear Floor Space

2nd Floor Unisex Restroom

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 28.12 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Record Number 68135

Maintenance Yard

Doors - Public Works , 2nd Floor : Door , Clear Floor Space

2nd Floor Unisex Restroom

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 28.62 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Cabinet Obstructs Clear Floor Space Length.

Record Number 68136

Doors - Public Works , 2nd Floor : Door , Threshold

2nd Floor Unisex Restroom

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 68133

Maintenance Yard

Doors - Public Works , 2nd Floor : Door

2nd Floor Office/Break Room

Finding

The clear opening width of the door is less than required.

On-Site Finding 30.00 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 68156

Doors - Public Works , 2nd Floor : Door , Threshold

2nd Floor Office/Break Room

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 68158

Maintenance Yard

Doors - Public Works , 2nd Floor : Door , Threshold

2nd Floor File Storage

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.37 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 69436

Signage - Public Works : Signage , Signage

Entrance Next to Maintenance Managers Office

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 68085

Maintenance Yard

Signage - Public Works : Signage

Door Between Reception & Workroom

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 68120

Signage - Public Works : Signage , Signage

Main Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 68139

Maintenance Yard

Signage - Public Works : Signage

North Yard Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 68155

Signage - Public Works : Signage

Maintenance Managers Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 68169

Maintenance Yard

Signage - Public Works : Signage , Signage

Break Room

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 69399

Signage - Public Works : Signage

Break Room Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 69411

Maintenance Yard

Signage - Public Works , 2nd Floor : Signage

2nd Floor Office/Break Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 68121

Signage - Public Works , 2nd Floor : Signage

2nd Floor File Storage

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 69420

Maintenance Yard

Restrooms - Public Works : Restroom

Unisex Restroom in Break Room

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 42.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Code Reference ADA 304, 304.3, 304.3.1, 603, 603.2.1, CA 11B-304.3

Record Number 69402

Restrooms - Public Works : Restroom

Unisex Restroom in Break Room

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Code Reference ADA 213, 213.2.1, CA 11B-213.2.1

Record Number 69401

Maintenance Yard

Restrooms - Public Works : Restroom , Lavatory

Unisex Restroom in Break Room

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 69407

Restrooms - Public Works : Restroom , Lavatory

Unisex Restroom in Break Room

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 25.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Record Number 69405

Maintenance Yard

Restrooms - Public Works : Restroom , Lavatory

Unisex Restroom in Break Room

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 69408

Restrooms - Public Works : Restroom , Lavatory

Unisex Restroom in Break Room

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 28.12 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Record Number 69404

Maintenance Yard

Restrooms - Public Works : Restroom , Lavatory

Unisex Restroom in Break Room

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 12.62 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Record Number 69406

Restrooms - Public Works : Restroom , Wall Signage

Unisex Restroom in Break Room

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 69410

Maintenance Yard

Restrooms - Public Works : Restroom , Door Signage

Unisex Restroom in Break Room

Unisex

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 69409

Restrooms - Public Works : Restroom , Dispensers

Unisex Restroom in Break Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 47.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 69403

Maintenance Yard

Restrooms - Public Works : Restroom , Grab Bars

Unisex Restroom in Break Room

Finding

There are no grab bars.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Code Reference ADA 603, 604.5, 609, CA 11B-604.5

Record Number 69422

Restrooms - Public Works : Restroom , Toilet Compartment

Unisex Restroom in Break Room

Finding

The location of the seat cover dispenser does not provide sufficient clear floor space.

On-Site Finding Not Accessible

Recommendation

Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.

Recommendation See Recommendation

Code Reference ADA 304, 305.1, 309.2, CA 11B-305.1, 309.2, 603.5

Record Number 69421

Maintenance Yard

Restrooms - Public Works : Restroom , Toilet Compartment

Unisex Restroom in Break Room

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 72.62 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 69428

Restrooms - Public Works : Restroom , Toilet Compartment

Unisex Restroom in Break Room

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 2.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 69429

Maintenance Yard

Restrooms - Public Works : Restroom , Toilet

Unisex Restroom in Break Room

Finding

The height of the toilet seat is not at the required height.

On-Site Finding 16.00 inches

Recommendation

Adjust or modify the toilet so the seat height is at the required accessible height.

Recommendation 17.00 - 19.00 inches

Code Reference ADA 603, 604.4, CA 11B-604.4

Record Number 69424

Restrooms - Public Works : Restroom , Toilet

Unisex Restroom in Break Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 13.25 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 69426

Maintenance Yard

Restrooms - Public Works : Restroom , Toilet

Unisex Restroom in Break Room

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 42.50 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 69427

Restrooms - Public Works : Restroom , Toilet

Unisex Restroom in Break Room

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 16.25 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 69423

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Toilet Compartment

2nd Floor Unisex Restroom

Finding

There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.

On-Site Finding 56.00 inches

Recommendation

Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.

Recommendation At least 60.00 inches

Code Reference ADA 502.4, 603, 604.3.1

Record Number 68109

Restrooms - Public Works , 2nd Floor : Restroom , Grab Bars

2nd Floor Unisex Restroom

Finding

There are no grab bars.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Code Reference ADA 603, 604.5, 609, CA 11B-604.5

Record Number 68110

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Paper Dispenser

2nd Floor Unisex Restroom

Finding

The paper dispenser is located behind the front of toilet seat.

On-Site Finding See Above

Recommendation

Provide a compliant dispenser mounted at 7" to 9" in front of the water closet.

Recommendation See Recommendation

Code Reference ADA 604.7, CA 11B-604.7

Record Number 68117

Restrooms - Public Works , 2nd Floor : Restroom , Toilet

2nd Floor Unisex Restroom

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 33.50 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 68116

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Toilet

2nd Floor Unisex Restroom

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 16.00 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 68115

Restrooms - Public Works , 2nd Floor : Restroom , Toilet

2nd Floor Unisex Restroom

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 13.75 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 68111

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Toilet

2nd Floor Unisex Restroom

Finding

The height of the toilet seat is not at the required height.

On-Site Finding 15.25 inches

Recommendation

Adjust or modify the toilet so the seat height is at the required accessible height.

Recommendation 17.00 - 19.00 inches

Code Reference ADA 603, 604.4, CA 11B-604.4

Record Number 68112

Restrooms - Public Works , 2nd Floor : Restroom , Toilet

2nd Floor Unisex Restroom

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 68114

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom

2nd Floor Unisex Restroom

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 37.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Code Reference ADA 304, 304.3, 304.3.1, 603, 603.2.1, CA 11B-304.3

Record Number 68143

Restrooms - Public Works , 2nd Floor : Restroom

2nd Floor Unisex Restroom

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Code Reference ADA 213, 213.2.1, CA 11B-213.2.1

Record Number 68142

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom

2nd Floor Unisex Restroom

Finding

This restroom is not located on an accessible level or route. This restroom is provided for public use.

On-Site Finding None Found

Recommendation

Modifications are necessary to make certain accessibility is provided. Relocate to an accessible level or provide an accessible path of travel.

Recommendation See Recommendation

Code Reference ADA 206.2.2, 213, 603, CA 11B-213.1

Record Number 68141

Restrooms - Public Works , 2nd Floor : Restroom , Mirror

2nd Floor Unisex Restroom

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 49.25 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 40.00 inches

Code Reference ADA 213, 603, 603.3, CA 11B-603.3

Record Number 68152

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Lavatory

**2nd Floor Unisex Restroom
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 68151

Restrooms - Public Works , 2nd Floor : Restroom , Lavatory

**2nd Floor Unisex Restroom
Lavatory**

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 25.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Record Number 68147

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Lavatory

2nd Floor Unisex Restroom

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 15.50 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Record Number 68148

Restrooms - Public Works , 2nd Floor : Restroom , Lavatory

2nd Floor Unisex Restroom

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 28.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Record Number 68146

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Lavatory

**2nd Floor Unisex Restroom
Lavatory**

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 41.50 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 48.00 inches

Code Reference ADA 213, 305.3, 606, 606.2, CA 11B-305, 606.2

Record Number 68149

Restrooms - Public Works , 2nd Floor : Restroom , Lavatory

**2nd Floor Unisex Restroom
Lavatory**

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 68150

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Wall Signage

2nd Floor Unisex Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 68154

Restrooms - Public Works , 2nd Floor : Restroom , Door Signage

2nd Floor Unisex Restroom

Unisex

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 68153

Maintenance Yard

Restrooms - Public Works , 2nd Floor : Restroom , Dispensers

2nd Floor Unisex Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 46.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 68144

Restrooms - Public Works , 2nd Floor : Restroom , Dispensers

2nd Floor Unisex Restroom

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 41.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 68145

Maintenance Yard

Break/Conference Room - Public Works : Break Room

Maintenance Managers Office

Finding

The table knee depth does not meet required standards.

On-Site Finding 17.75 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Code Reference ADA 205, 228, 306.3.3, 308, 309, CA 11B-306.3.2, 306.3.3, 902.2

Record Number 68138

Break/Conference Room - Public Works : Break Room

Break Room

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 69440

Maintenance Yard

Break/Conference Room - Public Works : Break Room , Sink

Break Room

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 69442

Break/Conference Room - Public Works : Break Room

Break Room

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 69441

Maintenance Yard

Break/Conference Room - Public Works : Break Room

Break Room

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.12 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 69439

Break/Conference Room - Public Works : Break Room

Break Room

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 47.75 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 69444

Maintenance Yard

Break/Conference Room - Public Works : Break Room

Break Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 51.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 69445

Break/Conference Room - Public Works : Break Room

Break Room

Finding

The table knee clearance does not meet required standards.

On-Site Finding 24.25 inches

Recommendation

Provide compliant tables.

Recommendation At least 27.00 inches

Code Reference ADA 305, 306, 902.2, CA 11B-305, 306, 902.2

Record Number 69438

Maintenance Yard

Break/Conference Room - Public Works : Break Room , Appliance

Break Room

Refrigerator

Finding

Appliance Reach Height in the break/conference room is not compliant.

On-Site Finding 49.00 inches

Recommendation

Make sure that the specified appliance reach height is compliant.

Recommendation Up to 48.00 inches

Code Reference ADA 205, 308, 309, CA 11B-205, 308, 309

Record Number 69443

Break/Conference Room - Public Works , 2nd Floor : Break Room

2nd Floor Break Room

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 68124

Maintenance Yard

Break/Conference Room - Public Works , 2nd Floor : Break Room

2nd Floor Break Room

Finding

Sink controls needs twisting to operate.

On-Site Finding Not Compliant

Recommendation

Provide compliant controls for the sink in break/conference room.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309

Record Number 68122

Break/Conference Room - Public Works , 2nd Floor : Break Room

2nd Floor Break Room

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.00 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 68123

Maintenance Yard

Break/Conference Room - Public Works , 2nd Floor : Break Room

2nd Floor Break Room

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 68125

Break/Conference Room - Public Works , 2nd Floor : Break Room , Sink

2nd Floor Break Room

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 68126

Maintenance Yard

Break/Conference Room - Public Works , 2nd Floor : Break Room

2nd Floor Break Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 56.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 68127

Accessible Showers - Public Works : Accessible Shower

Unisex Restroom in Break Room

Finding

There are not enough accessible showers with respect to the total number of showers available.

On-Site Finding None Found

Recommendation

Provide the required amount of compliant accessible showers.

Recommendation At least 1.00 showers

Code Reference ADA 213, 213.3.6, 608, CA 11B-213.3.6

Record Number 69413

Maintenance Yard

Accessible Showers - Public Works , 2nd Floor : Accessible Shower 2nd Floor Unisex Restroom

Finding

There are not enough accessible showers with respect to the total number of showers available.

On-Site Finding None Found

Recommendation

Provide the required amount of compliant accessible showers.

Recommendation At least 1.00 showers

Code Reference ADA 213, 213.3.6, 608, CA 11B-213.3.6

Record Number 68092

Reach Ranges - Exterior : Reach Range

Yard

Eye Washing Station

Finding

This element is a protruding object.

On-Site Finding None Found

Recommendation

Make sure that the element is not a protruding object.

Recommendation See Recommendation

Code Reference ADA 204, 304, 307

Notes : Element Protrudes 5.5" Into the Path of Travel.

Record Number 68140

Maintenance Yard

Benches - Exterior : Bench

Bench Next to North Yard Entrance

Finding

No clear floor space provided at the bench.

On-Site Finding Not Found

Recommendation

Provide compliant clear floor space for the bench at one end.

Recommendation See Recommendation

Code Reference ADA 305, 903.2 , CA 11B-305, 903.2

Record Number 68137

Accessibility Survey



Martin Luther King Jr. Park

435 Daisy Lane
East Palo Alto, CA 94303

Date of Inspection

10/3/2017

Prepared By

Disability Access Consultants

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Parking Lot

Parking Lot

Finding

There is no device at the head of the general parking spaces to prevent vehicles from encroaching into walkways.

On-Site Finding None Found

Recommendation

Install a wheel stop at the head of the general parking spaces.

Recommendation See Recommendation

Code Reference ADA 502, 502.7, CA 11B-502.7.2

Record Number 68013

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 62980

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Right Accessible Space

Finding

The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.

On-Site Finding See Above

Recommendation

Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.

Recommendation See Recommendation

Code Reference ADA 502.3, CA 11B-502.7.1

Record Number 62972

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Right Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 62970

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Right Accessible Space

Finding

There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.

On-Site Finding None Found

Recommendation

Install a wheel stop at the head of the accessible parking space.

Recommendation See Recommendation

Code Reference ADA 502, 502.7, CA 11B-502.7.2

Record Number 62971

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.

On-Site Finding None Found

Recommendation

Install a wheel stop at the head of the accessible parking space.

Recommendation See Recommendation

Code Reference ADA 502, 502.7, CA 11B-502.7.2

Record Number 62974

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 62973

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 2.70 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 62978

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 61.00 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 96.00 inches

Code Reference CA 11B-502.2

Record Number 62977

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

Pavement markings at the designated accessible parking spaces are not compliant.

On-Site Finding 33.00 inches

Recommendation

Provide a compliant pavement marking at the designated accessible parking space.

Recommendation At least 36.00 inches

Code Reference CA 11B-502.6.4

Record Number 62975

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

There is no additional signage marked "van accessible" at the van accessible parking space.

On-Site Finding None Found

Recommendation

Van accessible parking spaces shall provide additional signage that states "van accessible" .

Recommendation See Recommendation

Code Reference ADA 502, 502.6

Record Number 62976

Martin Luther King Jr. Park

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Left Accessible Space

Finding

The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.

On-Site Finding None Found

Recommendation

Paint "NO PARKING" in 12 inch white letters.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 62979

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to Accessible Spaces

Finding

The running slope is greater than allowed.

On-Site Finding 9.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Code Reference ADA 405.2, 406, 406.1, CA 11B-406.2.2

Record Number 68011

Martin Luther King Jr. Park

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to Accessible Spaces

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 13.30 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Code Reference ADA 406, 406.3, CA 11B-406.2.2

Record Number 68012

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to Accessible Spaces

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 68010

Martin Luther King Jr. Park

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp Next to Accessible Spaces

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 62968

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Curb Ramp Next to Accessible Spaces

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 1.00 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Code Reference ADA 406.2

Record Number 62967

Martin Luther King Jr. Park

Curb Ramps - Exterior : Curb Ramp

Left Curb Ramp at Baseball Field Vehicle Entrance

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 68074

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Left Curb Ramp at Baseball Field Vehicle Entrance

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 1.00 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Code Reference ADA 406.2

Record Number 68075

Martin Luther King Jr. Park

Curb Ramps - Exterior : Curb Ramp

Right Curb Ramp at Baseball Field Vehicle Entrance

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 68082

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Right Curb Ramp at Baseball Field Vehicle Entrance

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 68084

Martin Luther King Jr. Park

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Right Curb Ramp at Baseball Field Vehicle Entrance
Bottom Landing**

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 68083

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel to 1st Base Dugout
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 4.80 percent for 10.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 64335

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel to 1st Base Dugout

Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 11.30 percent for 4.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 64334

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

1st Base Dugout

Dugout Ceiling

Finding

The vertical clearance height is less than required.

On-Site Finding 75.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 64351

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

1st Base Dugout

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 24.87 inches for 15.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 64350

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Parking Lot Around Baseball Outfield to Concessions Stand

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.50 percent for 165.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 68032

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from Baseball Field to Soccer Field

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.90 percent for 16.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 68033

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

3rd Base Dugout

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 24.50 inches for 15.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 68036

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Path of Travel from the Accessible Spaces

Access Aisle

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 68037

Path of Travel - Exterior : Path Of Travel , Drop Offs

Soccer Field- Path of Travel from West Bleachers Around North End to East Bleachers

Guardrail

Finding

The guardrail height is not compliant.

On-Site Finding 41.25 inches

Recommendation

Provide compliant guardrails.

Recommendation At least 42.00 inches

Code Reference IBC 1003.2.12.1, CA 11B-1013.3

Record Number 68047

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel

Soccer Field- Path of Travel from West Bleachers Around North End to East Bleachers

Exterior Walkway

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 68046

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Soccer Field- Path of Travel from West Bleachers Around North End to East Bleachers

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.60 percent for 106.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 68045

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Concession Stand to Soccer Field West Bleachers
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.90 percent for 5.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 68049

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Concession Stand to Soccer Field West Bleachers
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 7.50 percent for 22.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 68048

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Concession Stand to Soccer Field West Bleachers
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 68050

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Concession Stand to Soccer Field West Bleachers
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 68051

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Parking Lot Around Baseball Outfield to Concessions Stand - Continued

Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.20 percent for 12.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 68060

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Parking Lot Around Baseball Outfield to Concessions Stand - Continued

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 4.40 percent for 8.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 68061

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Soccer Field West Bleachers to Baseball Field Outfield Path

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 68062

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel to Picnic Tables North of Play Area

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 68073

Martin Luther King Jr. Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Baseball Field Spectator Area

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.50 percent for 8.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 68076

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Baseball Field Spectator Area

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 12.00 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 68077

Martin Luther King Jr. Park

Path of Travel - Restrooms & Concessions : Path Of Travel , Walking Surfaces

Concessions Stand

Rug

Finding

The carpeting is loose and bulging and not securely fastened to the underlying surface, thereby creating a hazardous path of travel.

On-Site Finding Not Accessible

Recommendation

Securely stretch and fasten the carpeting or replace the carpeting to provide a firm, stable, continuous and relatively smooth path of travel surface.

Recommendation See Recommendation

Code Reference ADA 302, 302.2, CA 11B-302.2, 403.2

Record Number 68031

Path of Travel - Restrooms & Concessions : Path Of Travel

Concesion Stand Entrance

Exterior Walkway

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 68069

Martin Luther King Jr. Park

Ramps - Exterior : Ramp , Handrail

Ramp Next to Baseball Field Outfield

Run 1

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 64338

Ramps - Exterior : Ramp , Ramp Run

Ramp Next to Baseball Field Outfield

Run 1

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Code Reference ADA 405, 405.9, CA 11B-405.9

Record Number 64336

Martin Luther King Jr. Park

Ramps - Exterior : Ramp , Ramp Run

Ramp Next to Baseball Field Outfield

Run 1

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding 4.62 inches

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 405.9.2

Record Number 64337

Ramps - Exterior : Ramp , Landing

Ramp Next to Baseball Field Outfield

Run 1 Bottom Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 2.50 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Record Number 64339

Martin Luther King Jr. Park

Ramps - Exterior : Ramp , Handrail

Ramp Next to Baseball Field Outfield

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 405.9.1, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 64340

Ramps - Exterior : Ramp , Handrail

Ramp Next to Baseball Field Outfield

Run 2

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 64343

Martin Luther King Jr. Park

Ramps - Exterior : Ramp , Ramp Run

Ramp Next to Baseball Field Outfield

Run 2

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding 4.50 inches

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 405.9.2

Record Number 64342

Ramps - Exterior : Ramp , Ramp Run

Ramp Next to Baseball Field Outfield

Run 2

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Code Reference ADA 405, 405.9, CA 11B-405.9

Record Number 64341

Martin Luther King Jr. Park

Doors - Exterior : Door , Threshold

Park Entrance from the Public Right Away at Daisy Lane

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.70 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 63003

Doors - Exterior : Door

3rd Base Dugout

Finding

The vertical clearance height of the open doorway is not compliant.

On-Site Finding 75.00 inches

Recommendation

Provide a compliant open doorway at the location.

Recommendation At least 80.00 inches

Code Reference ADA 307.4

Record Number 64333

Martin Luther King Jr. Park

Doors - Exterior : Door

1st Base Dugout

Finding

The vertical clearance height of the open doorway is not compliant.

On-Site Finding 76.00 inches

Recommendation

Provide a compliant open doorway at the location.

Recommendation At least 80.00 inches

Code Reference ADA 307.4

Record Number 68017

Doors - Exterior : Door , Clear Floor Space

3rd Base Dugout Field Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.70 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Notes : Landing Accumulates Water

Record Number 68035

Martin Luther King Jr. Park

Doors - Exterior : Door , Hardware

3rd Base Dugout Field Entrance

Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 68034

Doors - Exterior : Door , Clear Floor Space

1st Base Dugout Field Entrance

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 26.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Bench Obstructs Clear Floor Space Length.

Record Number 68067

Martin Luther King Jr. Park

Doors - Exterior : Door , Clear Floor Space

1st Base Dugout Field Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 4.40 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 68068

Doors - Exterior : Door , Hardware

1st Base Dugout Field Entrance

None

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Notes : Hardware Broken at Time of Inspection.

Record Number 68065

Martin Luther King Jr. Park

Doors - Exterior : Door , Hardware

1st Base Dugout Field Entrance

None

Finding

Door hardware broken or missing.

On-Site Finding Not Found

Recommendation

Provide compliant accessible door hardware.

Recommendation See Recommendation

Code Reference ADA 404.2.7, CA 11B-404.2.7

Notes : Hardware Broken at Time of Inspection.

Record Number 68064

Doors - Exterior : Door , Threshold

1st Base Dugout Field Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.25 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 68066

Martin Luther King Jr. Park

Doors - Restrooms & Concessions : Door , Clear Floor Space

Mens Restroom Next to Picnic Area

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.80 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 63006

Doors - Restrooms & Concessions : Door , Hardware

Mens Restroom Next to Picnic Area

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 63005

Martin Luther King Jr. Park

Doors - Restrooms & Concessions : Door , Clear Floor Space

Concessions Stand

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.70 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 68020

Doors - Restrooms & Concessions : Door , Hardware Height

Concessions Stand

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 55.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Notes : No Hardware on Pull Side of the Door.

Record Number 68019

Martin Luther King Jr. Park

Doors - Restrooms & Concessions : Door , Clear Floor Space

Womens Restroom Next to Picnic Area

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 3.20 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 68081

Doors - Restrooms & Concessions : Door , Hardware

Womens Restroom Next to Picnic Area

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 68079

Martin Luther King Jr. Park

Doors - Restrooms & Concessions : Door , Threshold

Womens Restroom Next to Picnic Area

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 68080

Counters - Restrooms & Concessions : Counter

Concesion Stand Interior Food Counter

Finding

The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.

On-Site Finding 35.00 inches

Recommendation

Provide a portion of counter at the compliant height.

Recommendation 28.00 - 34.00 inches

Code Reference ADA 902, 904, CA 11B-904.4

Record Number 68070

Martin Luther King Jr. Park

Counters - Restrooms & Concessions : Counter

Concesion Stand Interior Food Counter

Finding

The clear floor space width at the counter is not compliant.

On-Site Finding 29.25 inches

Recommendation

Provide compliant clear floor space at the counter.

Recommendation At least 30.00 inches

Code Reference ADA 305, 904.3, CA 11B-305, 904.4

Record Number 68071

Counters - Restrooms & Concessions : Counter

Concesion Stand Interior Food Counter

Finding

The knee clearance depth provided is not compliant.

On-Site Finding 15.00 inches

Recommendation

Provide compliant knee clearance depth at the counter for a forward approach.

Recommendation At least 19.00 inches

Code Reference ADA 306.3.3, 904.3.2, CA 11B-306.3.3, 904.4.2

Record Number 68072

Martin Luther King Jr. Park

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 62996

Signage - Restrooms & Concessions : Signage

Concessions Stand

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 68021

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Toilet Compartment

Mens Restroom Next to Picnic Area

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 45.00 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 68008

Restrooms - Restrooms & Concessions : Restroom

Mens Restroom Next to Picnic Area

Finding

Seat cover dispenser interferes with use of grab bar.

On-Site Finding Interferes

Recommendation

Move the seat cover dispenser so it does not interfere with the use of the grab bars.

Recommendation See Recommendation

Code Reference ADA 609.3

Record Number 68009

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Toilet Compartment
Mens Restroom Next to Picnic Area

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 54.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 62963

Restrooms - Restrooms & Concessions : Restroom , Compartment Door
Mens Restroom Next to Picnic Area

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 62959

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom

Mens Restroom Next to Picnic Area

Finding

The inside handle is not located near the latch.

On-Site Finding None Found

Recommendation

Adjust the inside handle so that it is located near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 62962

Restrooms - Restrooms & Concessions : Restroom , Compartment Door

Mens Restroom Next to Picnic Area

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 62960

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Compartment Door
Mens Restroom Next to Picnic Area

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 309.4, 404, 404.2.7, 604.8, CA 11B-404.2.7, 604.8.1.2

Record Number 62961

Restrooms - Restrooms & Concessions : Restroom
Mens Restroom Next to Picnic Area

Finding

Rear grab bar interferes with the tank/flushometer.

On-Site Finding Not Compliant

Recommendation

Readjust the rear grab bar so that it does not interfere with the tank/flushometer.

Recommendation See Recommendation

Code Reference ADA 609.3, CA 11B-609.3

Record Number 62957

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom

Mens Restroom Next to Picnic Area

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 36.50 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 33.00 - 36.00 inches

Code Reference ADA 603, 609.4, CA 11B-609.4

Record Number 62958

Restrooms - Restrooms & Concessions : Restroom , Toilet

Mens Restroom Next to Picnic Area

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 62956

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Wall Mounted Mirror
Mens Restroom Next to Picnic Area

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 40.75 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 35.00 inches

Code Reference ADA 603.3, CA 11B-603.3

Record Number 62999

Restrooms - Restrooms & Concessions : Restroom , Lavatory

Mens Restroom Next to Picnic Area
Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 62998

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Wall Signage

Mens Restroom Next to Picnic Area

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 63001

Restrooms - Restrooms & Concessions : Restroom , Door Signage

Mens Restroom Next to Picnic Area

Male

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 73.62 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 63000

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Dispensers

Mens Restroom Next to Picnic Area

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 49.25 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 62997

Restrooms - Restrooms & Concessions : Restroom , Wall Mounted Mirror

Womens Restroom Next to Picnic Area

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 41.50 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 35.00 inches

Code Reference ADA 603.3, CA 11B-603.3

Record Number 68042

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Lavatory

**Womens Restroom Next to Picnic Area
Lavatory**

Finding

The height of the counter surface is greater than allowed.

On-Site Finding 34.37 inches

Recommendation

Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.

Recommendation Up to 34.00 inches

Code Reference ADA 213, 606, 606.3, CA 11B-213, 606.3

Record Number 68039

Restrooms - Restrooms & Concessions : Restroom , Lavatory

**Womens Restroom Next to Picnic Area
Lavatory**

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 15.37 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
center

Code Reference CA 11B-606.6

Record Number 68040

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Lavatory

**Womens Restroom Next to Picnic Area
Lavatory**

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 68041

Restrooms - Restrooms & Concessions : Restroom , Wall Signage

Womens Restroom Next to Picnic Area

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 68044

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Door Signage

Womens Restroom Next to Picnic Area

Female

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 71.37 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 68043

Restrooms - Restrooms & Concessions : Restroom , Dispensers

Womens Restroom Next to Picnic Area

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 50.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 68038

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Toilet Compartment
Womens Restroom Next to Picnic Area

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 46.00 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 68053

Restrooms - Restrooms & Concessions : Restroom
Womens Restroom Next to Picnic Area

Finding

Seat cover dispenser interferes with use of grab bar.

On-Site Finding Interferes

Recommendation

Move the seat cover dispenser so it does not interfere with the use of the grab bars.

Recommendation See Recommendation

Code Reference ADA 609.3

Record Number 68054

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Compartment Door

Womens Restroom Next to Picnic Area

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 68057

Restrooms - Restrooms & Concessions : Restroom , Compartment Door

Womens Restroom Next to Picnic Area

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 68058

Martin Luther King Jr. Park

Restrooms - Restrooms & Concessions : Restroom , Toilet Compartment
Womens Restroom Next to Picnic Area

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 53.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 68059

Restrooms - Restrooms & Concessions : Restroom
Womens Restroom Next to Picnic Area

Finding

Rear grab bar interferes with the tank/flushometer.

On-Site Finding Not Compliant

Recommendation

Readjust the rear grab bar so that it does not interfere with the tank/flushometer.

Recommendation See Recommendation

Code Reference ADA 609.3, CA 11B-609.3

Record Number 68056

Martin Luther King Jr. Park

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Concession Stand

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Code Reference ADA 211.2, 305, 602, CA 11B-211.2, 602

Record Number 62991

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Concession Stand

Finding

The drinking fountain is not set entirely in an alcove.

On-Site Finding None Found

Recommendation

If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.

Recommendation See Recommendation

Code Reference ADA 307.2, 602.1 , CA 11B-602.9

Record Number 62995

Martin Luther King Jr. Park

Drinking Fountains - Exterior : Drinking Fountains

Drinking Fountain Next to Concession Stand

Finding

The drinking fountain is a protruding object.

On-Site Finding None

Recommendation

Make sure that the fountain is not a protruding object.

Recommendation See Recommendation

Code Reference ADA 211, 305, 306, 307.2, 602, CA 11B-307.2, 602

Record Number 62992

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Concession Stand

Finding

The water flow trajectory is not parallel to the front of the drinking fountain.

On-Site Finding Not Compliant

Recommendation

Provide a water flow trajectory that is parallel to the front of the drinking fountain.

Recommendation See Recommendation

Code Reference ADA 602.6, CA 11B-602.6

Record Number 62994

Martin Luther King Jr. Park

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Concession Stand

Finding

The spout outlet height is greater than required.

On-Site Finding 37.00 inches

Recommendation

Provide a spout outlet that does not exceed the required height.

Recommendation Up to 36.00 inches

Code Reference ADA 211, 602, 602.4, CA 11B-602.4

Record Number 62993

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Play Area

Finding

The water flow trajectory is not parallel to the front of the drinking fountain.

On-Site Finding Not Compliant

Recommendation

Provide a water flow trajectory that is parallel to the front of the drinking fountain.

Recommendation See Recommendation

Code Reference ADA 602.6, CA 11B-602.6

Record Number 64348

Martin Luther King Jr. Park

Drinking Fountains - Exterior : Drinking Fountains

Drinking Fountain Next to Play Area

Finding

The clear floor space slope is not compliant.

On-Site Finding 3.00 percent

Recommendation

Provide compliant clear floor space at the drinking fountain.

Recommendation Up to 2.08 percent

Code Reference ADA 211, 305, 305.2, 306, 602, CA 11B-602.2

Record Number 64349

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Play Area

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Code Reference ADA 211.2, 305, 602, CA 11B-211.2, 602

Record Number 64346

Martin Luther King Jr. Park

Drinking Fountains - Exterior : Drinking Fountain

Drinking Fountain Next to Play Area

Finding

The height of the water stream is less than required.

On-Site Finding 2.00 inches

Recommendation

Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.

Recommendation At least 4.00 inches

Code Reference ADA 211, 602, 602.6, CA 11B-211, 602

Record Number 64347

Outdoor Sports Areas - Exterior : Outdoor Sports Area

Baseball Field

Finding

There are not enough accessible seats at the location with respect to the total number of seats available.

On-Site Finding None Found

Recommendation

Provide compliant accessible seating at the location.

Recommendation At least 4.00 seats

Code Reference ADA 221.2 , 802.1, CA 11B-221.2, 802.1

Record Number 68014

Martin Luther King Jr. Park

Outdoor Sports Areas - Exterior : Outdoor Sports Area , Concession Stand

Baseball Field Concession Stand

Finding

The height of the concession counter is greater than 34 inches.

On-Site Finding 34.50 inches

Recommendation

Lower the concession counter to a height between 28 inches and 34 inches above the ground level .

Recommendation Up to 34.00 inches

Code Reference ADA 904, CA 11B-904.4

Record Number 68015

Outdoor Sports Areas - Exterior : Outdoor Sports Area

Soccer Field

Finding

There are not enough accessible seats at the location with respect to the total number of seats available.

On-Site Finding None Found

Recommendation

Provide compliant accessible seating at the location.

Recommendation At least 4.00 seats

Code Reference ADA 221.2 , 802.1, CA 11B-221.2, 802.1

Record Number 63007

Martin Luther King Jr. Park

Play Area - Exterior : Play Area

Play Area

Finding

The play area is not located on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the play area.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2, 240, 402.1

Record Number 62981

Play Area - Exterior : Play Area , Elevated or Ground Equipment or Play Table

Play Area

Finding

The vertical clearance height on route to the transfer platform/play equipment is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 1008, 1008.2, 307.4

Record Number 62982

Martin Luther King Jr. Park

Play Area - Exterior : Play Area

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

Clear floor space is not centered and not parallel to the platform.

On-Site Finding Not Compliant

Recommendation

Provide compliant clear floor space which is centered and is parallel to the platform.

Recommendation See Recommendation

Code Reference ADA 1008.3.1.3, 305.3

Record Number 62989

Play Area - Exterior : Play Area , Equipment

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

At least one means of support for transferring to the transfer platform is not provided at the steps.

On-Site Finding Not Provided

Recommendation

Provide at least one means of support for transferring to assist when transferring.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.3.1.4

Record Number 62983

Martin Luther King Jr. Park

Play Area - Exterior : Play Area , Equipment

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

At least one means of support for transferring to the transfer platform is not provided at the steps.

On-Site Finding Not Provided

Recommendation

Provide at least one means of support for transferring to assist when transferring.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.3.2.3

Record Number 62988

Play Area - Exterior : Play Area , Equipment

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

The width of the steps is not compliant.

On-Site Finding 8.00 inches

Recommendation

Provide steps with a compliant width.

Recommendation At least 24.00 inches

Code Reference ADA 1008, 1008.3.2.1

Record Number 62985

Martin Luther King Jr. Park

Play Area - Exterior : Play Area , Equipment

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

The height of the steps is not compliant.

On-Site Finding 27.00 inches

Recommendation

Provide steps with a compliant riser height.

Recommendation Up to 8.00 inches

Code Reference ADA 1008, 1008.3.2.2

Record Number 62986

Play Area - Exterior : Play Area , Equipment

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

All risers are not closed.

On-Site Finding Not Closed

Recommendation

All risers shall be closed.

Recommendation See Recommendation

Code Reference ADA 1008

Record Number 62987

Martin Luther King Jr. Park

Play Area - Exterior : Play Area , Equipment

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

The transfer platform is not located on shortest route from the play areas accessible point of access.

On-Site Finding Not Located on Shortest Route

Recommendation

The transfer platform shall be located on the shortest route from the play areas accessible point of access.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2

Record Number 62984

Play Area - Exterior : Play Area

Play Area

Elevated Equipment - Concrete/Solid Surface

Finding

The surface beneath the play area is non-accessible to individuals with mobility impairments.

On-Site Finding Not Accessible

Recommendation

The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.

Recommendation See Recommendation

Code Reference ADA 1008, 1008.2, 1008.2.6, 240

Record Number 62990

Martin Luther King Jr. Park

Emergency Warning Systems - Restrooms & Concessions : Emergency Warning Systems

Visual Alarms

Finding

There are some visual warning devices, though visual warning devices are not located throughout the facility.

On-Site Finding Some Found

Recommendation

Install visual warning devices integrated with the facility's alarm system in all common areas such as hallways, classrooms and general use rooms, accessible restrooms and other accessible rooms.

Recommendation See Recommendation

Code Reference ADA 215, 702, CA 11B-215, 702

Record Number 68063

Break/Conference Room - Restrooms & Concessions : Break Room

Concession Stand

Finding

No visual alarms found at the location.

On-Site Finding None Found

Recommendation

Provide visual alarms at the location.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309

Record Number 68052

Martin Luther King Jr. Park

Sinks - Restrooms & Concessions : Sink
Concessions Stand Hand Washing Station

Finding

There is not enough clear floor space at the sink.

On-Site Finding 28.75 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 30.00 inches

Code Reference ADA 205, 228, 308, 309

Notes : Supply Lines Not Completely Wrapped.

Record Number 68028

Sinks - Restrooms & Concessions : Sink
Concessions Stand Hand Washing Station

Finding

Sink counter height is not compliant.

On-Site Finding 34.75 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Notes : Supply Lines Not Completely Wrapped.

Record Number 68026

Martin Luther King Jr. Park

Sinks - Restrooms & Concessions : Sink
Concessions Stand Hand Washing Station

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Notes : Supply Lines Not Completely Wrapped.

Record Number 68027

Sinks - Restrooms & Concessions : Sink
Concessions Stand Hand Washing Station

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Notes : Supply Lines Not Completely Wrapped.

Record Number 68029

Martin Luther King Jr. Park

Picnic Areas - Exterior : Picnic Tables

Picnic Tables North of Play Area

Finding

The picnic table surface is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Not Compliant

Recommendation

Provide a compliant picnic table.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309

Record Number 64344

Picnic Areas - Exterior : Picnic Tables

Picnic Tables South of Play Area

Finding

The picnic table surface is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Not Compliant

Recommendation

Provide a compliant picnic table.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309

Record Number 68030

Martin Luther King Jr. Park

Reach Ranges - Exterior : Reach Range , Clear Floor Space Slope

Picnic Tables North of Play Area

Barbeque

Finding

The clear floor space slope is not compliant.

On-Site Finding 2.80 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.08 percent

Code Reference ADA 304, CA 11B-305.2

Notes : Landing is Dirt/Grass/Gravel.

Record Number 64352

Reach Ranges - Exterior : Reach Range , Clear Floor Space Slope

Picnic Tables North of Play Area

Hot Coal Disposal

Finding

The clear floor space slope is not compliant.

On-Site Finding 2.50 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.08 percent

Code Reference ADA 304, CA 11B-305.2

Notes : Landing is Dirt/Grass/Gravel.

Record Number 64354

Martin Luther King Jr. Park

Reach Ranges - Exterior : Reach Range , Front Approach

Picnic Tables North of Play Area

Hot Coal Disposal

Finding

Element reach depth is not compliant.

On-Site Finding 35.50 inches

Recommendation

Make sure that the element is within allowed reach range with recommended reach depth.

Recommendation Up to 25.00 inches

Code Reference ADA 308

Notes : Landing is Dirt/Grass/Gravel.

Record Number 64353

Reach Ranges - Exterior : Reach Range , Element Highest Point of Operation

Picnic Tables North of Play Area

Hot Coal Disposal

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 14.00 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Notes : Landing is Dirt/Grass/Gravel.

Record Number 64355

Martin Luther King Jr. Park

Reach Ranges - Exterior : Reach Range , Element Highest Point of Operation

**Picnic Tables South of Play Area
Hot Coal Disposal**

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 14.00 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Record Number 68024

Reach Ranges - Exterior : Reach Range , Front Approach

**Picnic Tables South of Play Area
Hot Coal Disposal**

Finding

Element reach depth is not compliant.

On-Site Finding 36.50 inches

Recommendation

Make sure that the element is within allowed reach range with recommended reach depth.

Recommendation Up to 25.00 inches

Code Reference ADA 308

Record Number 68022

Martin Luther King Jr. Park

Reach Ranges - Exterior : Reach Range , Clear Floor Space Slope

Picnic Tables South of Play Area

Hot Coal Disposal

Finding

The clear floor space slope is not compliant.

On-Site Finding 2.50 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.08 percent

Code Reference ADA 304, CA 11B-305.2

Record Number 68023

Reach Ranges - Exterior : Reach Range , Clear Floor Space Slope

Picnic Tables South of Play Area

Barbeque

Finding

The clear floor space slope is not compliant.

On-Site Finding 2.40 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.08 percent

Code Reference ADA 304, CA 11B-305.2

Record Number 68025

Martin Luther King Jr. Park

Benches - Exterior : Bench

3rd Base Dugout

Finding

Clear floor space slope is not compliant for the bench.

On-Site Finding 3.10 percent

Recommendation

Provide compliant clear floor space at the bench.

Recommendation Up to 2.08 percent

Code Reference ADA 305, 903.2 , CA 11B-903.2

Record Number 64332

Accessibility Survey



Newbridge Pocket Park

Bay Road & Newbridge Street
East Palo Alto, CA 94303

Date of Inspection

11/3/2017

Prepared By

Disability Access Consultants

Newbridge Pocket Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Bay Road to Newbridge Street - East Side of Park
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 85467

Newbridge Pocket Park

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Bay Road to Newbridge Street - West Side of Park
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 85468

Pad "D"

Accessibility Survey



Pad "D"

1791 E Bayshore Road
East Palo Alto, CA 94303

Date of Inspection

11/6/2017

Prepared By

Disability Access Consultants

Pad "D"

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Finding

There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.

On-Site Finding None Found

Recommendation

Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".

Recommendation See Recommendation

Code Reference ADA 208, 208.2, CA 11B-208.2, 502

Record Number 86430

Pad "D"

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Entrance from Clarke Avenue

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 86431

Pad "D"

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at East Bayshore Road

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 86426

Pad "D"

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at East Bayshore Road
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86427

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Parking Lot
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86428

Pad "D"

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Parking Lot
Curb**

Finding

There is a curb on the designated path of travel.

On-Site Finding Curb Found

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 206, 302, 303, 303.4, 402, 403.4, 406

Record Number 86429

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at Clarke Avenue

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 86432

Pad "D"

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Clarke Avenue
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86433

Accessibility Survey



Parole Reentry Nonprofit Office/Water Building

2277 University Avenue
East Palo Alto, CA 94303

Date of Inspection

10/5/2017

Prepared By

Disability Access Consultants

Parole Reentry Nonprofit Office/Water Building

Parking - Exterior : Parking Lot

Parking Lot

Finding

The location of the designated accessible parking space(s) is not located on the shortest accessible route of travel to the facility for which it serves.

On-Site Finding Not on Path

Recommendation

Remove and relocate the designated accessible parking spaces. Accessible paved parking spaces shall be located on the shortest accessible route of travel to the facility for which it serves and shall coincide with the primary route and primary entrances used by the general public.

Recommendation See Recommendation

Code Reference ADA 208, 208.3, 502, CA 11B-208.2

Record Number 65233

Parole Reentry Nonprofit Office/Water Building

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 65239

Parole Reentry Nonprofit Office/Water Building

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 2.70 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 65237

Parole Reentry Nonprofit Office/Water Building

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 5.00 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 65235

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 65236

Parole Reentry Nonprofit Office/Water Building

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 65234

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 65238

Parole Reentry Nonprofit Office/Water Building

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Path of Travel from the Accessible Space

Crosswalk from the Access Aisle

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 65272

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Accessible Space

Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 7.80 percent for 3.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 65270

Parole Reentry Nonprofit Office/Water Building

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Accessible Space
Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.50 percent for 12.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 65271

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from the Public Right of Way
Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 5.40 percent for 8.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 65294

Parole Reentry Nonprofit Office/Water Building

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way
Step**

Finding

There is a step or curb on the path of travel preventing access.

On-Site Finding Item Found

Recommendation

Provide a ramp or other means of vertical access.

Recommendation See Recommendation

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 65295

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 12.80 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Code Reference ADA 405, 405.2, CA 11B-405.2

Record Number 65259

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The cross slope of the ramp is greater than the allowed cross slope.

On-Site Finding 3.00 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 2.08 percent

Code Reference ADA 403, 405.3, CA 11B-405.3

Record Number 65260

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Code Reference ADA 405, 405.9, CA 11B-405.9

Record Number 65258

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 65261

Ramps - Exterior : Ramp , Landing

Ramp to the Main Entrance

Run 1 Top Landing

Finding

The width of the landing is less than required.

On-Site Finding 54.00 inches

Recommendation

Modify or replace the landing on the ramp to provide the required length in the direction of the run of the ramp and required inches in width.

Recommendation At least 60.00 inches

Code Reference ADA 405, 405.7.2, CA 11B-405.7.2

Record Number 65262

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Landing

Ramp to the Main Entrance

Run 1 Top Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 3.50 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Record Number 65263

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1 Right Handrail

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 41.50 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 405, 405.8, 505.4, CA 11B-405.8, 505.4

Record Number 65269

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1 Right Handrail

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.6

Record Number 65265

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1 Right Handrail

Finding

The handrails rotate within their fittings.

On-Site Finding Rotates

Recommendation

Anchor the handrails in their fittings so that they are stable and fixed in a secure position.

Recommendation See Recommendation

Code Reference ADA 405.8, 505, 505.9

Record Number 65264

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 405.9.1, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 65266

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 65267

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Handrail

Ramp to the Main Entrance

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 2.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 65268

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Rear Entrance

Run 1

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 12.10 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Code Reference ADA 405, 405.2, CA 11B-405.2

Record Number 65288

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Handrail

Ramp to the Rear Entrance

Run 1

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 65289

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Rear Entrance

Run 1

Finding

The width of the ramp is less than required.

On-Site Finding 41.75 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Record Number 65286

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Ramp Run

Ramp to the Rear Entrance

Run 1

Finding

Ramp run does not have enough vertical clearance height.

On-Site Finding 77.00 inches

Recommendation

Provide compliant vertical clearance for the ramp run.

Recommendation At least 80.00 inches

Code Reference ADA 307.4, CA 11B-307.4

Record Number 65287

Ramps - Exterior : Ramp , Landing

Ramp to the Rear Entrance

Run 1 Top Landing

Finding

The width of the landing is less than required.

On-Site Finding 44.00 inches

Recommendation

Modify or replace the landing on the ramp to provide the required length in the direction of the run of the ramp and required inches in width.

Recommendation At least 60.00 inches

Code Reference ADA 405, 405.7.2, CA 11B-405.7.2

Record Number 65290

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Landing

Ramp to the Rear Entrance

Run 1 Top Landing

Finding

The distance between the latch side of the door and the edge of the landing does not meet the required minimum distance.

On-Site Finding 5.50 inches

Recommendation

Modify or replace the top landing on the ramp to provide a top landing with a level surface and provides the required minimum distance from the latch side of the door the edge of the landing.

Recommendation At least 42.00 inches

Code Reference ADA 404, 405, CA 11B-405.7.5

Record Number 65291

Ramps - Exterior : Ramp , Handrail

Ramp to the Rear Entrance

Run 1 Left Handrail

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 47.00 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 405, 405.8, 505.4, CA 11B-405.8, 505.4

Record Number 65293

Parole Reentry Nonprofit Office/Water Building

Ramps - Exterior : Ramp , Handrail

Ramp to the Rear Entrance

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 405.9.1, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 65292

Stairs - Exterior : Stairway , Risers

Stairs to Main Entrance

Run 1

Finding

The height of the risers are not uniform.

On-Site Finding Not Uniform

Recommendation

Modify or replace the stairs to provide uniform riser height.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-504.2

Record Number 65281

Parole Reentry Nonprofit Office/Water Building

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1

Finding

There are no handrails provided on the stairway.

On-Site Finding None Found

Recommendation

Provide compliant handrails.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.2, CA 11B-504.6, 505.2

Record Number 65280

Doors - Parole/Reentry : Door , Clear Floor Space

Conference Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 55.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 65227

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Clear Floor Space

Main Entrance

Push Side

Finding

There is no level landing at this door.

On-Site Finding 31.00 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 65244

Doors - Parole/Reentry : Door , Latch Side Clearance

Main Entrance

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 2.25 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 65243

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Threshold

Main Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 65242

Doors - Parole/Reentry : Door , Hardware

Main Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 8.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 65240

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Hardware

Main Entrance

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Record Number 65241

Doors - Parole/Reentry : Door

Mens Restroom Next to Conference Room

Finding

The clear opening width of the door is less than required.

On-Site Finding 27.37 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65245

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Clear Floor Space

Mens Restroom Next to Conference Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 13.12 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Lavatory Obstructs Clear Floor Space Length.

Record Number 65247

Doors - Parole/Reentry : Door , Latch Side Clearance

Mens Restroom Next to Conference Room

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 14.62 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Lavatory Obstructs Clear Floor Space Length.

Record Number 65246

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door

Interns Office

Finding

The clear opening width of the door is less than required.

On-Site Finding 30.00 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65249

Doors - Parole/Reentry : Door , Clear Floor Space

Interns Office

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 35.62 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Record Number 65251

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Clear Floor Space

Interns Office

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 58.20 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length.

Record Number 65252

Doors - Parole/Reentry : Door , Hardware

Interns Office

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Record Number 65250

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Latch Side Clearance

Rear Entrance

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 13.25 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65256

Doors - Parole/Reentry : Door , Hardware

Rear Entrance

Single Knob

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7, CA 11B-404.2.7

Record Number 65253

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Hardware

Rear Entrance

Single Knob

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 12.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 65254

Doors - Parole/Reentry : Door , Threshold

Rear Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 65255

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Clear Floor Space

Therapists Office

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 65274

Doors - Parole/Reentry : Door , Clear Floor Space

Therapists Office

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 36.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 65275

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Hardware

Therapists Office

Single Knob

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7, CA 11B-404.2.7

Record Number 65273

Doors - Parole/Reentry : Door , Clear Floor Space

Community Workers Office

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 65279

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Hardware

Community Workers Office

Single Knob

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7, CA 11B-404.2.7

Record Number 65278

Doors - Parole/Reentry : Door , Latch Side Clearance

Information Counter Gate

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 1.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65285

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Hardware

Information Counter Gate

Finger Pull - 1.5

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7, CA 11B-404.2.7

Record Number 65283

Doors - Parole/Reentry : Door , Hardware Height

Information Counter Gate

Finger Pull - 1.5

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 29.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Record Number 65284

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door

Womens Restroom Next to Conference Room

Finding

The clear opening width of the door is less than required.

On-Site Finding 27.37 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65306

Doors - Parole/Reentry : Door , Clear Floor Space

Womens Restroom Next to Conference Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 48.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Lavatory Obstructs Latch Side Clearance. Toilet Obstructs Clear Floor Space Length.

Record Number 65309

Parole Reentry Nonprofit Office/Water Building

Doors - Parole/Reentry : Door , Latch Side Clearance

Womens Restroom Next to Conference Room

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 8.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Lavatory Obstructs Latch Side Clearance. Toilet Obstructs Clear Floor Space Length.

Record Number 65308

Counters - Parole/Reentry : Counter

Information Counter

Finding

The counter is a protruding object.

On-Site Finding See Above

Recommendation

Adjust the counter so that it is no longer a protruding object.

Recommendation See Recommendation

Code Reference ADA 307.2, 902

Record Number 65311

Parole Reentry Nonprofit Office/Water Building

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 65257

Signage - Parole/Reentry : Signage , Signage

Main Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 65248

Parole Reentry Nonprofit Office/Water Building

Signage - Parole/Reentry : Signage , Signage

Front Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 65276

Signage - Parole/Reentry : Signage , Signage

Conference Room

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 65277

Parole Reentry Nonprofit Office/Water Building

Signage - Parole/Reentry : Signage

Community Workers Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 65310

Signage - Parole/Reentry : Signage

Therapists Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 65312

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom

Mens Restroom Next to Conference Room

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 50.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Code Reference ADA 304, 304.3, 304.3.1, 603, 603.2.1, CA 11B-304.3

Record Number 65229

Restrooms - Parole/Reentry : Restroom

Mens Restroom Next to Conference Room

Finding

The entrance door swings into the turning space within the restroom.

On-Site Finding 23.00 inches

Recommendation

Reverse the door swing, or modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 48.00 inches

Code Reference ADA 304, 305.3, 603.2, 603.2.3, CA 11B-603.2.3

Record Number 65230

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom , Mirror

Mens Restroom Next to Conference Room

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 40.37 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 40.00 inches

Code Reference ADA 213, 603, 603.3, CA 11B-603.3

Record Number 65232

Restrooms - Parole/Reentry : Restroom , Lavatory

Mens Restroom Next to Conference Room

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Supply Lines Not Completely Wrapped.

Record Number 65231

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom

Womens Restroom Next to Conference Room

Finding

The entrance door swings into the turning space within the restroom.

On-Site Finding 27.25 inches

Recommendation

Reverse the door swing, or modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 48.00 inches

Code Reference ADA 304, 305.3, 603.2, 603.2.3, CA 11B-603.2.3

Notes : Lavatory And Toilet Obstruct Turning Space Diameter.

Record Number 65297

Restrooms - Parole/Reentry : Restroom

Womens Restroom Next to Conference Room

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 48.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Code Reference ADA 304, 304.3, 304.3.1, 603, 603.2.1, CA 11B-304.3

Notes : Lavatory And Toilet Obstruct Turning Space Diameter.

Record Number 65296

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom , Lavatory

**Womens Restroom Next to Conference Room
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 65298

Restrooms - Parole/Reentry : Restroom , Grab Bar

Womens Restroom Next to Conference Room

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 65305

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom , Grab Bars

Womens Restroom Next to Conference Room

Finding

The distance from the rear wall to the side grab bar is greater than allowed.

On-Site Finding 12.25 inches

Recommendation

Remount the side grab bar so it meets the distance requirements from the back wall.

Recommendation Up to 12.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1

Record Number 65304

Restrooms - Parole/Reentry : Restroom , Toilet

Womens Restroom Next to Conference Room

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 65301

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom , Toilet

Womens Restroom Next to Conference Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 26.37 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 65302

Restrooms - Parole/Reentry : Restroom , Toilet

Womens Restroom Next to Conference Room

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 30.25 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 65303

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom , Toilet

Womens Restroom Next to Conference Room

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 16.87 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 65299

Restrooms - Parole/Reentry : Restroom , Grab Bar

Mens Restroom Next to Conference Room

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 65316

Parole Reentry Nonprofit Office/Water Building

Restrooms - Parole/Reentry : Restroom , Toilet

Mens Restroom Next to Conference Room

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 44.00 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 65315

Restrooms - Parole/Reentry : Restroom , Toilet

Mens Restroom Next to Conference Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 21.00 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 65314

Parole Reentry Nonprofit Office/Water Building

Reach Ranges - Parole/Reentry : Reach Range , Element Highest Point of Operation

Reentry Computer

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 27.50 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 28.00 - 34.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Record Number 65282

Benches - Exterior : Bench

Benches Next to Main Entrance

Finding

Clear floor space slope is not compliant for the bench.

On-Site Finding 2.80 percent

Recommendation

Provide compliant clear floor space at the bench.


Recommendation Up to 2.08 percent

Code Reference ADA 305, 903.2 , CA 11B-903.2

Record Number 65228

Police Department-Office

Accessibility Survey

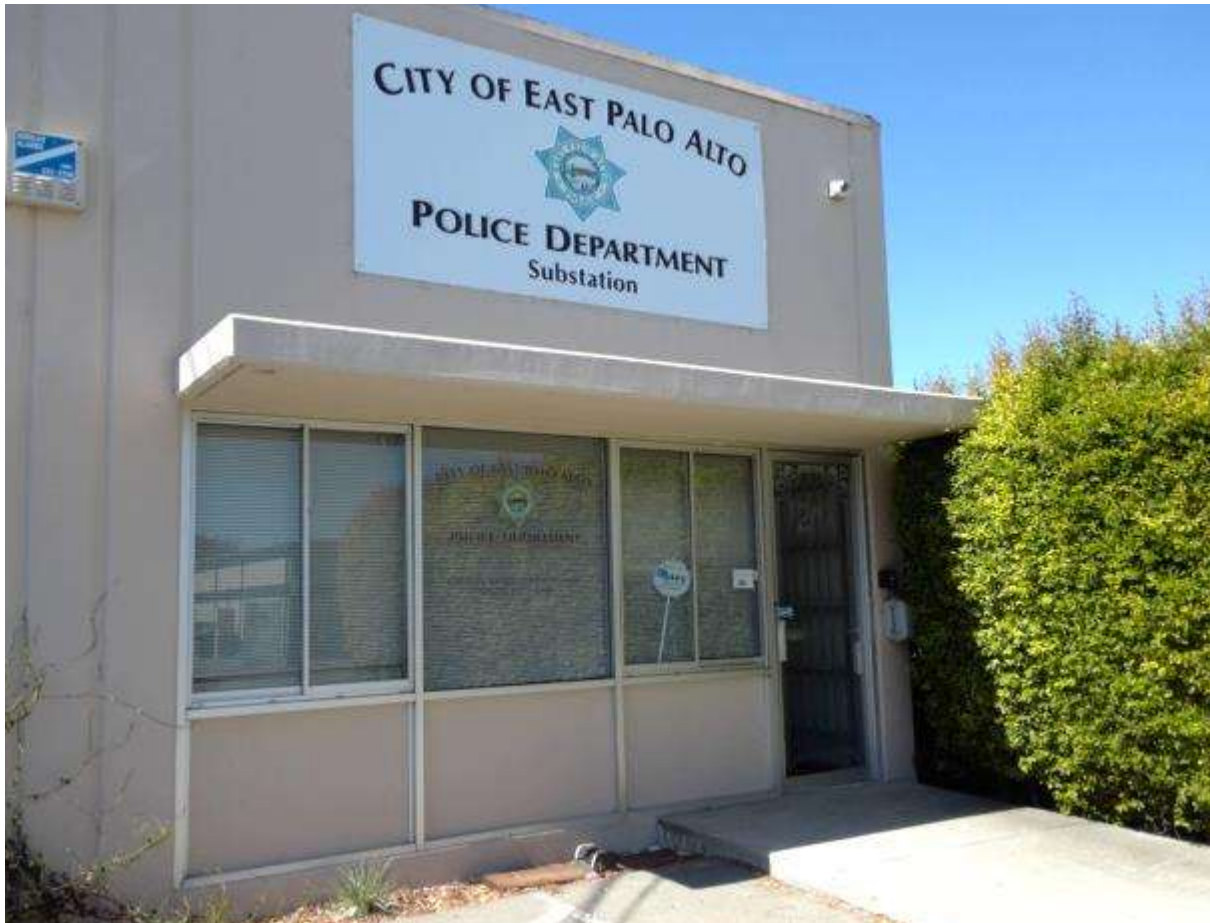

Police Department-Office

219 Demeter Street
East Palo Alto, CA 94303

Date of Inspection

10/5/2017

Prepared By

Disability Access Consultants

Police Department-Office

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Finding

There is no designated "van accessible" parking space provided in the parking lot.

On-Site Finding None Found

Recommendation

Provide a compliant van accessible space.

Recommendation See Recommendation

Code Reference ADA 208, 208.2.4, 502.7, CA 11B-208.2.4, 502.7

Record Number 65317

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 65328

Police Department-Office

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.

On-Site Finding None Found

Recommendation

Paint "NO PARKING" in 12 inch white letters.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 65327

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 65325

Police Department-Office

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 65321

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The hatched lines are striped greater than 36" on center or are not painted a contrasting color.

On-Site Finding Not on 36" center

Recommendation

Re-stripe the hatched lines in a contrasting color up to 36" on center.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 65326

Police Department-Office

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 3.80 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 65324

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 4.10 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 65319

Police Department-Office

Parking - Exterior : Parking Lot

Parking Lot

Accessible Space

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 56.00 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 60.00 inches

Code Reference ADA 502, 502.3.1, 502.4

Record Number 65322

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

Accessible Space

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 180.00 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 65320

Police Department-Office

Parking - Exterior : Parking Lot

Parking Lot

Accessible Space

Finding

The accessible parking space does not meet the minimum requirements for width.

On-Site Finding 112.00 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 132.00 inches

Code Reference ADA 502, 502.2

Record Number 65318

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Main Entrance

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 65339

Police Department-Office

Curb Ramps - Exterior : Curb Ramp

Curb Ramp at the Main Entrance

Finding

The curb ramp projects into vehicular traffic lanes, parking spaces, or parking access aisles.

On-Site Finding Projects

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 406, 406.4, 406.5

Record Number 65338

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp at the Main Entrance

Bottom Landing

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 4.50 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 65340

Police Department-Office

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp at the Main Entrance

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 65341

Path of Travel - Criminal Investigations Division : Path Of Travel , Vertical Hazards

Mens Restroom

Cupboard

Finding

The vertical clearance height is less than required.

On-Site Finding 55.62 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 66774

Police Department-Office

Path of Travel - Criminal Investigations Division : Path Of Travel , Vertical Hazards

Womens Restroom

Cupboard

Finding

The vertical clearance height is less than required.

On-Site Finding 55.62 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 66777

Path of Travel - Criminal Investigations Division : Path Of Travel , Protruding Objects

Meeting Room

Fire Extinguisher

Finding

The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.

On-Site Finding 5.00 inches

Recommendation

Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.

Recommendation Up to 4.00 inches

Code Reference ADA 307, 307.2, CA 11B-307.2

Record Number 66830

Police Department-Office

Path of Travel - Exterior : Path Of Travel , Grates

Path of Travel from the Public Right of Way

Grate Next to Sidewalk

Finding

There is grating with elongated openings greater than allowed on the primary path of travel.

On-Site Finding 0.75 inches

Recommendation

Replace the grating with a grating that provides openings that are compliant. If the grating has elongated openings, the grating shall be set where the elongated openings are perpendicular to the dominant direction of travel.

Recommendation Up to 0.50 inches

Code Reference ADA 302, 302.3

Record Number 65337

Path of Travel - Exterior : Path Of Travel , Grates

Path of Travel from the Public Right of Way

Grate Next to Sidewalk

Finding

The elongated openings of the grating are not perpendicular to the dominant direction of travel.

On-Site Finding Not Accessible

Recommendation

Replace the grating with a grating that provides openings that are compliant. If the grating has elongated openings, the grating shall be set where the elongated openings are perpendicular to the dominant direction of travel.

Recommendation See Recommendation

Code Reference ADA 302, 302.3

Record Number 65336

Police Department-Office

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from the Public Right of Way
Vehicular Traffic**

Finding

The pedestrian route adjoins vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5

Record Number 65335

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 8.40 percent for 3.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 65333

Police Department-Office

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 8.60 percent for 3.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 65334

Doors - Criminal Investigations Division : Door , Latch Side Clearance

**Right Office Across from Restrooms
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 8.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : File Obstructs Latch Side Clearance.

Record Number 66791

Police Department-Office

Doors - Criminal Investigations Division : Door , Clear Floor Space

Reception Entrance

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 32.12 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length.

Record Number 66799

Doors - Criminal Investigations Division : Door

Evidence Warehouse Entrance Next to Offices

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.75 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 66800

Police Department-Office

Doors - Criminal Investigations Division : Door , Clear Floor Space

Main Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 66819

Doors - Criminal Investigations Division : Door , Clear Floor Space

Main Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.40 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 66820

Police Department-Office

Doors - Criminal Investigations Division : Door , Hardware

Main Entrance

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 3.75 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 66817

Doors - Criminal Investigations Division : Door , Hardware Height

Main Entrance

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 48.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Record Number 66815

Police Department-Office

Doors - Criminal Investigations Division : Door , Hardware

Main Entrance

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Record Number 66816

Doors - Criminal Investigations Division : Door , Threshold

Main Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 66818

Police Department-Office

Doors - Criminal Investigations Division : Door , Hardware

Main Entrance

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 66814

Doors - Criminal Investigations Division : Door , Latch Side Clearance

Shower Next to Reception Entrance

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 6.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 66828

Police Department-Office

Doors - Criminal Investigations Division : Door

Door Between Meeting Room & Evidence Warehouse

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.75 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 66834

Doors - Criminal Investigations Division : Door , Latch Side Clearance

Door Between Meeting Room & Evidence Warehouse

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 10.37 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 66837

Police Department-Office

Doors - Criminal Investigations Division : Door , Hardware

**Door Between Meeting Room & Evidence Warehouse
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 66836

Doors - Criminal Investigations Division : Door , Hardware

**Warehouse Gate
Lever**

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 66838

Police Department-Office

Doors - Criminal Investigations Division : Door , Clear Floor Space

Left Office Across from Restrooms

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 18.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length.

Record Number 66840

Doors - Criminal Investigations Division : Door , Clear Floor Space

Evidence Warehouse Exterior Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 5.90 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 66845

Police Department-Office

Doors - Criminal Investigations Division : Door , Threshold

Evidence Warehouse Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.87 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 66844

Doors - Criminal Investigations Division : Door , Hardware Height

Evidence Warehouse Exterior Entrance

Lever

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 49.50 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Record Number 66843

Police Department-Office

Doors - Criminal Investigations Division : Door , Clear Floor Space

Criminal Investigations - Offices

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 35.25 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Record Number 66849

Doors - Criminal Investigations Division : Door , Latch Side Clearance

Criminal Investigations - Offices

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 4.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Furniture Obstructs Clear Floor Space Length.

Record Number 66848

Police Department-Office

Doors - Criminal Investigations Division : Door , Clear Floor Space

Meeting Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 52.37 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length.

Record Number 66856

Doors - Criminal Investigations Division : Door , Hardware

Meeting Room

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Record Number 66855

Police Department-Office

Doors - Criminal Investigations Division : Door , Latch Side Clearance

Commander 1

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 0.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Furniture/Equipment Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 66858

Doors - Criminal Investigations Division : Door , Clear Floor Space

Commander 1

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 48.25 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture/Equipment Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 66859

Police Department-Office

Doors - Criminal Investigations Division : Door

Womens Restroom

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.50 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 66860

Doors - Criminal Investigations Division : Door , Clear Floor Space

Womens Restroom

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 27.25 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Lockers Obstructs Clear Floor Space Length.

Record Number 66862

Police Department-Office

Doors - Criminal Investigations Division : Door

Mens Restroom

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.50 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 66863

Doors - Criminal Investigations Division : Door , Latch Side Clearance

Mens Restroom

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Notes : Lockers Obstructs Clear Floor Space Length.

Record Number 66866

Police Department-Office

Doors - Criminal Investigations Division : Door , Clear Floor Space

Mens Restroom

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 21.62 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Lockers Obstructs Clear Floor Space Length.

Record Number 66867

Doors - Criminal Investigations Division : Door , Hardware

Mens Restroom

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 7.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 66865

Police Department-Office

Counters - Criminal Investigations Division : Counter

Reception Counter

Finding

The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.

On-Site Finding 43.12 inches

Recommendation

Provide a portion of counter at the compliant height.

Recommendation 28.00 - 34.00 inches

Code Reference ADA 902, 904, CA 11B-904.4

Notes : Counter Protrudes 5.75" Into the Path of Travel.

Record Number 66787

Counters - Criminal Investigations Division : Counter

Reception Counter

Finding

The counter is a protruding object.

On-Site Finding See Above

Recommendation

Adjust the counter so that it is no longer a protruding object.

Recommendation See Recommendation

Code Reference ADA 307.2, 902

Notes : Counter Protrudes 5.75" Into the Path of Travel.

Record Number 66788

Police Department-Office

Signage - Criminal Investigations Division : Signage

Criminal Investigations - Offices

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66776

Signage - Criminal Investigations Division : Signage

Reception Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66786

Police Department-Office

Signage - Criminal Investigations Division : Signage

Commander 1

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66789

Signage - Criminal Investigations Division : Signage

Meeting Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66802

Police Department-Office

Signage - Criminal Investigations Division : Signage

Evidence Warehouse Exterior Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66803

Signage - Criminal Investigations Division : Signage

Office Vestibule Next to Evidence Warehouse

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66826

Police Department-Office

Signage - Criminal Investigations Division : Signage

Shower Next to Reception Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66829

Signage - Criminal Investigations Division : Signage , Signage

Main Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 66831

Police Department-Office

Signage - Criminal Investigations Division : Signage

Left & Right Offices Across from Restrooms

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66832

Signage - Criminal Investigations Division : Signage

Door Between Meeting Room & Evidence Warehouse

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66846

Police Department-Office

Signage - Criminal Investigations Division : Signage

Interview Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66851

Signage - Criminal Investigations Division : Signage , Signage

Main Entrance Doorbell

Finding

There is no informational signage.

On-Site Finding Not Found

Recommendation

Install informational signage to each accessible element or room or location.

Recommendation See Recommendation

Code Reference ADA 216.3 , 703.5, CA 11B-216.3, 703.5

Notes : Signage Does Not Contain Tactile Characters.

Record Number 66852

Police Department-Office

Signage - Criminal Investigations Division : Signage

Evidence Warehouse Entrance Next to Offices

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66853

Signage - Criminal Investigations Division : Signage

Door Between Warehouses

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 66877

Police Department-Office

Signage - Criminal Investigations Division : Signage , Signage

Main Entrance Emergency Call Station

Finding

There is no informational signage.

On-Site Finding Not Found

Recommendation

Install informational signage to each accessible element or room or location.

Recommendation See Recommendation

Code Reference ADA 216.3 , 703.5, CA 11B-216.3, 703.5

Record Number 66897

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 66797

Police Department-Office

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Mens Restroom

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 41.00 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Notes : Lockers Obstruct Path of Travel Width & Compartment Length.

Record Number 66805

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Mens Restroom

Finding

The location of the seat cover dispenser does not provide sufficient clear floor space.

On-Site Finding Not Accessible

Recommendation

Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.

Recommendation See Recommendation

Code Reference ADA 304, 305.1, 309.2, CA 11B-305.1, 309.2, 603.5

Notes : Lockers Obstruct Path of Travel Width & Compartment Length.

Record Number 66804

Police Department-Office

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Mens Restroom

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 72.62 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 66812

Restrooms - Criminal Investigations Division : Restroom , Grab Bar

Mens Restroom

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 66811

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Grab Bars

Mens Restroom

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 23.75 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 66810

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Mens Restroom

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 13.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 66813

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Toilet

Mens Restroom

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 40.12 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 66808

Restrooms - Criminal Investigations Division : Restroom , Toilet

Mens Restroom

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 32.75 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 66809

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Toilet

Mens Restroom

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 18.50 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 66806

Restrooms - Criminal Investigations Division : Restroom

Womens Restroom

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 57.25 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Code Reference ADA 304, 304.3, 304.3.1, 603, 603.2.1, CA 11B-304.3

Record Number 66868

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Womens Restroom

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 66874

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Womens Restroom

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 26.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Record Number 66872

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Womens Restroom

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 17.25 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Record Number 66873

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Womens Restroom

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 28.25 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Record Number 66871

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Wall Signage
Womens Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 66876

Restrooms - Criminal Investigations Division : Restroom , Door Signage
Womens Restroom

Female

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 60.37 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 66875

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Dispensers

Womens Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 58.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 66869

Restrooms - Criminal Investigations Division : Restroom , Dispensers

Womens Restroom

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 43.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 66870

Police Department-Office

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Womens Restroom

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 41.00 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Notes : Lockers Obstruct Path of Travel Width & Compartment Length.

Record Number 66879

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Womens Restroom

Finding

The location of the seat cover dispenser does not provide sufficient clear floor space.

On-Site Finding Not Accessible

Recommendation

Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.

Recommendation See Recommendation

Code Reference ADA 304, 305.1, 309.2, CA 11B-305.1, 309.2, 603.5

Notes : Lockers Obstruct Path of Travel Width & Compartment Length.

Record Number 66878

Police Department-Office

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Womens Restroom

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 72.87 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 66887

Restrooms - Criminal Investigations Division : Restroom , Grab Bar

Womens Restroom

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 66886

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Grab Bars

Womens Restroom

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 53.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Record Number 66884

Restrooms - Criminal Investigations Division : Restroom , Grab Bars

Womens Restroom

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 23.50 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 66885

Police Department-Office

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Womens Restroom

Finding

The toilet paper dispenser is not mounted at the required height.

On-Site Finding 18.00 inches

Recommendation

Remount the toilet paper dispenser in the compartment to the required height.

Recommendation At least 19.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 66888

**Restrooms - Criminal Investigations Division : Restroom , Toilet
Compartment**

Womens Restroom

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 14.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 66889

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Toilet

Womens Restroom

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 35.00 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 66883

Restrooms - Criminal Investigations Division : Restroom , Toilet

Womens Restroom

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 38.62 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 66882

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Toilet

Womens Restroom

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 19.25 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 66880

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Mens Restroom

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 26.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Notes : Supply Lines Not Completely Wrapped.

Record Number 66893

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Mens Restroom

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Supply Lines Not Completely Wrapped.

Record Number 66895

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Mens Restroom

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 16.12 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
center

Code Reference CA 11B-606.6

Notes : Supply Lines Not Completely Wrapped.

Record Number 66894

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Lavatory

Mens Restroom

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 28.75 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Notes : Supply Lines Not Completely Wrapped.

Record Number 66892

Restrooms - Criminal Investigations Division : Restroom , Wall Signage

Mens Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 66896

Police Department-Office

Restrooms - Criminal Investigations Division : Restroom , Dispensers

Mens Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 52.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 66890

Restrooms - Criminal Investigations Division : Restroom , Dispensers

Mens Restroom

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 44.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 66891

Police Department-Office

Break/Conference Room - Criminal Investigations Division : Break Room
Meeting Room

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 66795

Break/Conference Room - Criminal Investigations Division : Break Room
Meeting Room

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.00 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 66793

Police Department-Office

Break/Conference Room - Criminal Investigations Division : Break Room , Sink

Meeting Room

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 66796

Break/Conference Room - Criminal Investigations Division : Break Room

Meeting Room

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 66794

Police Department-Office

Break/Conference Room - Criminal Investigations Division : Break Room Meeting Room

Finding

The table knee depth does not meet required standards.

On-Site Finding 17.25 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Code Reference ADA 205, 228, 306.3.3, 308, 309, CA 11B-306.3.2, 306.3.3, 902.2

Record Number 66792

Break/Conference Room - Criminal Investigations Division : Break Room Break Area Next to Restrooms

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 66822

Police Department-Office

Break/Conference Room - Criminal Investigations Division : Break Room , Sink

Break Area Next to Restrooms

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 66824

Break/Conference Room - Criminal Investigations Division : Break Room

Break Area Next to Restrooms

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.00 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 66821

Police Department-Office

Break/Conference Room - Criminal Investigations Division : Break Room
Break Area Next to Restrooms

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 66823

Break/Conference Room - Criminal Investigations Division : Break Room
Break Area Next to Restrooms

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 57.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 66825

Police Department-Office

Lockers - Criminal Investigations Division : Lockers

Mens Restroom

Finding

No accessible lockers were found.

On-Site Finding Not Available

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Code Reference ADA 225.2.1 , 811, CA 11B-225.2.1, 811

Record Number 66841

Lockers - Criminal Investigations Division : Lockers

Womens Restroom

Finding

No accessible lockers were found.

On-Site Finding Not Available

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Code Reference ADA 225.2.1 , 811, CA 11B-225.2.1, 811

Record Number 66850

Police Department-Office

Accessible Showers - Criminal Investigations Division : Accessible Shower , Seat

Shower Next to Reception Entrance

Finding

There is no folding seat in the accessible shower.

On-Site Finding No Seat

Recommendation

Provide a compliant folding seat in the accessible shower.

Recommendation See Recommendation

Code Reference ADA 608, CA 11B-608.4, 610.3

Record Number 66780

Accessible Showers - Criminal Investigations Division : Accessible Shower , Shower Compartment

Shower Next to Reception Entrance

Finding

The shower compartment width is not compliant.

On-Site Finding 42.25 inches

Recommendation

Modify or replace the shower to provide a compliant accessible shower compartment.

Recommendation At least 44.00 inches

Code Reference ADA 213, 608, CA 11B-608.2

Record Number 66778

Police Department-Office

Accessible Showers - Criminal Investigations Division : Accessible Shower , Transfer Space Length

Shower Next to Reception Entrance

Finding

There is not enough transfer space available at the shower.

On-Site Finding 42.50 inches

Recommendation

Provide compliant transfer space for the accessible shower.

Recommendation At least 48.00 inches

Code Reference ADA 608.2.1

Record Number 66779

Accessible Showers - Criminal Investigations Division : Accessible Shower , Grab Bars

Shower Next to Reception Entrance

Finding

The grab bars in the accessible shower are not mounted at a compliant height.

On-Site Finding 3.12 inches

Recommendation

Remount the grab bars in the accessible shower to a compliant height and location.

Recommendation 33.00 - 36.00 inches

Code Reference ADA 608, CA 11B-608.3, 609.4

Record Number 66783

Police Department-Office

Accessible Showers - Criminal Investigations Division : Accessible Shower , Shower Unit

Shower Next to Reception Entrance

Finding

The hand-held sprayer unit is not mounted at the required height above the finished floor.

On-Site Finding 68.00 inches

Recommendation

Provide a compliant hand-held sprayer unit with a hose.

Recommendation Up to 48.00 inches

Code Reference ADA 213, 608, CA 11B-608.5

Record Number 66781

Accessible Showers - Criminal Investigations Division : Accessible Shower , Shower Unit

Shower Next to Reception Entrance

Finding

The length of the hose for the hand-held sprayer unit is not compliant.

On-Site Finding 55.00 inches

Recommendation

Provide a compliant hand-held sprayer unit with a hose.

Recommendation At least 59.00 inches

Code Reference ADA 213, 608, 608.6, CA 11B-608.6

Record Number 66782

Police Department-Office

Accessible Showers - Criminal Investigations Division : Accessible Shower , Water Valve

Shower Next to Reception Entrance

Finding

The water control valve is not mounted at a compliant height.

On-Site Finding 21.00 inches

Recommendation

Remount the water control valve.

Recommendation 39.00 - 41.00 inches

Code Reference ADA 213, 608, 608.5, CA 11B-608.5

Record Number 66785

Accessible Showers - Criminal Investigations Division : Accessible Shower , Water Valve

Shower Next to Reception Entrance

Finding

The water valve distance from seat wall is not compliant.

On-Site Finding 39.00 inches

Recommendation

Provide a compliant water valve.

Recommendation 19.00 - 27.00 inches

Code Reference ADA 213, 608, 608.6, CA 11B-608.5

Record Number 66784

Police Department-Office

Reach Ranges - Criminal Investigations Division : Reach Range , Clear Floor Space Slope

Main Entrance

Emergency Call Station

Finding

The clear floor space slope is not compliant.

On-Site Finding 4.00 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.08 percent

Code Reference ADA 304, CA 11B-305.2

Notes : Bush Obstruct Use.

Record Number 65329

Reach Ranges - Criminal Investigations Division : Reach Range

Main Entrance

Emergency Call Station

Finding

Element controls are non accessible.

On-Site Finding None Found

Recommendation

Provide compliant controls for the element.

Recommendation See Recommendation

Code Reference ADA 205, 302, 308, 309, 410, CA 11B-309.4

Notes : Bush Obstruct Use.

Record Number 65330

Police Department-Office

Reach Ranges - Criminal Investigations Division : Reach Range , Clear Floor Space Slope

Main Entrance

Doorbell

Finding

The clear floor space slope is not compliant.

On-Site Finding 3.30 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.08 percent

Code Reference ADA 304, CA 11B-305.2

Record Number 65331

Reach Ranges - Criminal Investigations Division : Reach Range , Element Highest Point of Operation

Main Entrance

Doorbell

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 59.25 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Record Number 65332

Accessibility Survey



Police Department-Office-3 Coaches

141 Demeter Street
Eatst Palo Alto, CA 94303

Date of Inspection

10/4/2017

Prepared By

Disability Access Consultants

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Warning Signage

Visitors Parking Lot

Warning Sign

Finding

There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.

On-Site Finding Incorrect Wording

Recommendation

Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8.2

Notes : Signage States: "Unauthorized Vehicles...May Be Towed...".

Record Number 64229

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Parking Space

Visitors Parking Lot

Accessible Space

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 64228

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Warning Signage

Visitors Parking Lot

Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 64225

Parking - Exterior : Parking Lot , Parking Space

Visitors Parking Lot

Accessible Space

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 64222

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Parking Space

Visitors Parking Lot

Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 17.00 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 64227

Parking - Exterior : Parking Lot , Parking Space

Visitors Parking Lot

Accessible Space

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 206.00 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 64224

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Parking Space

Visitors Parking Lot

Accessible Space

Finding

The vertical clearance of the accessible parking space is less than required.

On-Site Finding 79.50 inches

Recommendation

Provide sufficient vertical clearance at each accessible parking space.

Recommendation At least 98.00 inches

Code Reference ADA 502, 502.5

Record Number 64223

Parking - Exterior : Parking Lot , Parking Space

Staff Parking Lot

Finding

There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.

On-Site Finding None Found

Recommendation

Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".

Recommendation See Recommendation

Code Reference ADA 208, 208.2, CA 11B-208.2, 502

Record Number 65052

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot

Patrol Parking Lot

Finding

The location of the designated accessible parking space(s) is not located on the shortest accessible route of travel to the facility for which it serves.

On-Site Finding Not on Path

Recommendation

Remove and relocate the designated accessible parking spaces. Accessible paved parking spaces shall be located on the shortest accessible route of travel to the facility for which it serves and shall coincide with the primary route and primary entrances used by the general public.

Recommendation See Recommendation

Code Reference ADA 208, 208.3, 502, CA 11B-208.2

Record Number 65079

Parking - Exterior : Parking Lot , Parking Space

Patrol Parking Lot

Right Accesible Space

Finding

There is no vertically-mounted signage at the designated accessible parking space showing the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Provide a permanently posted reflectorized sign that includes an International Symbol of Accessibility symbol at the head of the parking space. The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign.

Recommendation See Recommendation

Code Reference ADA 502, 502.6, 703.7.2.1, CA 11B-502.6, 703.7.2.1

Record Number 65081

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Parking Space

**Patrol Parking Lot
Right Accesible Space**

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 206.00 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 65082

Parking - Exterior : Parking Lot , Parking Space

**Patrol Parking Lot
Right Accesible Space**

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 3.80 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 65080

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Warning Signage

**Patrol Parking Lot
Right Accesible Space**

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 65083

Parking - Exterior : Parking Lot , Parking Space

**Patrol Parking Lot
Left Accesible Space**

Finding

The access aisle at the parking space is not outlined in blue.

On-Site Finding Not Outlined in blue

Recommendation

Outline the access aisle in blue color.

Recommendation See Recommendation

Code Reference CA 11B-502.3.4

Record Number 65092

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Warning Signage

Patrol Parking Lot
Left Accessible Space

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 65086

Parking - Exterior : Parking Lot , Parking Space

Patrol Parking Lot
Left Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 65084

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Parking Space

Patrol Parking Lot
Left Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 19.00 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 65091

Parking - Exterior : Parking Lot , Parking Space

Patrol Parking Lot
Left Accessible Space

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 206.00 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 65085

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Parking Space

**Patrol Parking Lot
Left Accessible Space**

Finding

There is no additional signage marked "van accessible" at the van accessible parking space.

On-Site Finding None Found

Recommendation

Van accessible parking spaces shall provide additional signage that states "van accessible" .

Recommendation See Recommendation

Code Reference ADA 502, 502.6

Record Number 65088

Parking - Exterior : Parking Lot , Parking Space

**Patrol Parking Lot
Left Accessible Space**

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 60.25 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 96.00 inches

Code Reference CA 11B-502.2

Record Number 65089

Police Department-Office-3 Coaches

Parking - Exterior : Parking Lot , Parking Space

Patrol Parking Lot Left Accessible Space

Finding

The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.

On-Site Finding 44.00 inches

Recommendation

Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.

Recommendation At least 60.00 inches

Code Reference ADA 502, 502.6, CA 11B-502.6

Record Number 65087

Curb Ramps - Exterior : Curb Ramp

Curb Ramp from the Crosswalk from the Public Right of Way

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 64232

Police Department-Office-3 Coaches

Curb Ramps - Exterior : Curb Ramp , Landings and Transition

**Curb Ramp from the Crosswalk from the Public Right of Way
Bottom Landing**

Finding

The overlayment causes a noncompliant change in level.

On-Site Finding 0.37 inches

Recommendation

Ensure the change in elevation is within the recommended height.

Recommendation 0.25 - 0.50 inches

Code Reference ADA 303.2, 303.3, CA 11B-303.2, 303.3

Record Number 64234

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Curb Ramp from the Crosswalk from the Public Right of Way
Bottom Landing**

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 64233

Police Department-Office-3 Coaches

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to Wellness Centee

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 64317

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to Wellness Centee

Finding

The running slope is greater than allowed.

On-Site Finding 13.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Code Reference ADA 405.2, 406, 406.1, CA 11B-406.2.2

Record Number 64318

Police Department-Office-3 Coaches

Path of Travel - Administration : Path Of Travel , Walking Surfaces

Unisex Restroom Next to Reception

Floor Mat

Finding

The mats or carpet runners do not adhere to the underlying floor surface and slip, thereby creating a hazardous path of travel.

On-Site Finding Not Accessible

Recommendation

Securely fasten the mats or carpet runners or replace with a mat or carpet runner that grips to the underlying floor surface to provide a firm, stable, continuous and relatively smooth path of travel surface. Mats or carpet runners along the primary path of travel shall provide beveled edges on all sides to prevent roll over.

Recommendation See Recommendation

Code Reference ADA 302, 302.2, CA 11B-302, 403.2

Record Number 64124

Path of Travel - Administration : Path Of Travel , Walking Surfaces

Administration Building Front Walkway to Patrol Building

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 47.25 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 64198

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from the Visitors Parking Lot Accessible Space
Access Aisle**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 64152

Path of Travel - Exterior : Path Of Travel , Grates

**Path of Travel from the Public Right of Way
Grate in Crosswalk to Partrol Lot**

Finding

There is grating with elongated openings greater than allowed on the primary path of travel.

On-Site Finding 0.87 inches

Recommendation

Replace the grating with a grating that provides openings that are compliant. If the grating has elongated openings, the grating shall be set where the elongated openings are perpendicular to the dominant direction of travel.

Recommendation Up to 0.50 inches

Code Reference ADA 302, 302.3

Record Number 64157

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Grates

Path of Travel from the Public Right of Way

Grate in Crosswalk to Patrol Lot

Finding

The elongated openings of the grating are not perpendicular to the dominant direction of travel.

On-Site Finding Not Accessible

Recommendation

Replace the grating with a grating that provides openings that are compliant. If the grating has elongated openings, the grating shall be set where the elongated openings are perpendicular to the dominant direction of travel.

Recommendation See Recommendation

Code Reference ADA 302, 302.3

Record Number 64156

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Path of Travel from the Public Right of Way

Vehicular Traffic

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 64153

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Path of Travel from the Public Right of Way

Crosswalk from the Public Right of Way

Finding

The pedestrian route adjoins vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5

Record Number 64154

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Path of Travel from the Public Right of Way

Crosswalk to Patrol Lot

Finding

The pedestrian route adjoins vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5

Record Number 64155

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from the Patrol Parking Lot Accessible Spaces
Crosswalk**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 65116

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from the Patrol Parking Lot Accessible Spaces
Sidewalk Adjoins Vehicular Traffic**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 65117

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Patrol Parking Lot Accessible Spaces
Gate Guide Track**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Bevel the area or resurface the area to provide a smooth and level path of travel.

Recommendation Up to 0.50 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 65115

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Patrol Parking Lot Accessible Spaces
Open Area**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.90 percent for 20.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 65114

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from Staff Parking Lot to Wellness Center
Vehicular Traffic**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 65149

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Staff Parking Lot to Wellness Center
Curb**

Finding

There is a curb on the designated path of travel.

On-Site Finding Curb Found

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 206, 302, 303, 303.4, 402, 403.4, 406

Record Number 65147

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Staff Parking Lot to Wellness Center
Stairs**

Finding

There is a step or curb on the path of travel preventing access.

On-Site Finding Item Found

Recommendation

Provide a ramp or other means of vertical access.

Recommendation See Recommendation

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 65148

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

**Path of Travel from Staff Parking Lot to Patrol Building
Vehicular Traffic**

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 65154

Police Department-Office-3 Coaches

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Staff Parking Lot to Patrol Building
Curb**

Finding

There is a curb on the designated path of travel.

On-Site Finding Curb Found

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 206, 302, 303, 303.4, 402, 403.4, 406

Record Number 65152

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Staff Parking Lot to Patrol Building
Stairs**

Finding

There is a step or curb on the path of travel preventing access.

On-Site Finding Item Found

Recommendation

Provide a ramp or other means of vertical access.

Recommendation See Recommendation

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 65153

Police Department-Office-3 Coaches

Path of Travel - Patrol : Path Of Travel , Walking Surfaces

Patrol Building East Walkway

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 47.12 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 65078

Path of Travel - Wellness Center : Path Of Travel , Walking Surfaces

Wellness Center Walkway

Exterior Walkway

Finding

The width of the path of travel is insufficient.

On-Site Finding 47.00 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 64235

Police Department-Office-3 Coaches

Path of Travel - Wellness Center : Path Of Travel , Drop Offs

Ramp to Wellness Center

Guardrail

Finding

The guardrail height is not compliant.

On-Site Finding 41.75 inches

Recommendation

Provide compliant guardrails.

Recommendation At least 42.00 inches

Code Reference IBC 1003.2.12.1, CA 11B-1013.3

Record Number 64319

Ramps - Administration : Ramp , Ramp Run

Ramp to the Main Entrance

Run 2

Finding

The width of the ramp is less than required.

On-Site Finding 46.50 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Record Number 64172

Police Department-Office-3 Coaches

Ramps - Administration : Ramp , Ramp Run

Ramp to the Main Entrance

Run 2

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding 4.25 inches

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 405.9.2

Record Number 64173

Ramps - Administration : Ramp , Handrail

Ramp to the Main Entrance

Run 2

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 64174

Police Department-Office-3 Coaches

Ramps - Administration : Ramp , Landing

Ramp to the Main Entrance

Run 2 Top Landing

Finding

The length of the top landing does not meet the required minimum length.

On-Site Finding 47.00 inches

Recommendation

Modify or replace the top landing to provide the required minimum length and width.

Recommendation At least 60.00 inches

Code Reference ADA 405.7, 405.7.3, CA 11B-405.7.3

Record Number 64175

Ramps - Administration : Ramp , Handrail

Ramp to the Main Entrance

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 64177

Police Department-Office-3 Coaches

Ramps - Administration : Ramp , Handrail

Ramp to the Main Entrance

Run 2 Right Handrail

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.6

Record Number 64176

Ramps - Administration : Ramp , Handrail

Ramp to the Main Entrance

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505

Record Number 64178

Police Department-Office-3 Coaches

Ramps - Administration : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 9.40 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Code Reference ADA 405, 405.2, CA 11B-405.2

Record Number 64181

Ramps - Administration : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The cross slope of the ramp is greater than the allowed cross slope.

On-Site Finding 2.80 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 2.08 percent

Code Reference ADA 403, 405.3, CA 11B-405.3

Record Number 64182

Police Department-Office-3 Coaches

Ramps - Administration : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding 4.12 inches

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 405.9.2

Record Number 64180

Ramps - Administration : Ramp , Handrail

Ramp to the Main Entrance

Run 1

Finding

There are no handrails.

On-Site Finding None Found

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2

Record Number 64183

Police Department-Office-3 Coaches

Ramps - Administration : Ramp , Ramp Run

Ramp to the Main Entrance

Run 1

Finding

The width of the ramp is less than required.

On-Site Finding 45.00 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Record Number 64179

Ramps - Administration : Ramp , Landing

Ramp to the Main Entrance

Run 1 Intermediate Landing

Finding

The ramp changes direction at this landing. The length of the landing is less than the required minimum length.

On-Site Finding 46.50 inches

Recommendation

Modify or replace the landing to meet the minimum required width and length.

Recommendation At least 72.00 inches

Code Reference ADA 405.7, 405.7.4

Record Number 64184

Police Department-Office-3 Coaches

Ramps - Administration : Ramp , Landing

Ramp to the Main Entrance

Run 1 Bottom Landing

Finding

The length of the bottom landing does not meet the required minimum length.

On-Site Finding 61.25 inches

Recommendation

Modify or replace the bottom landing to provide the required minimum length and width.

Recommendation At least 72.00 inches

Code Reference ADA 405, 405.7.3, CA 11B-405.7.3.1

Record Number 64185

Ramps - Wellness Center : Ramp , Ramp Run

Ramp to Wellness Center

Run 1

Finding

The width of the ramp is less than required.

On-Site Finding 44.25 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Record Number 64137

Police Department-Office-3 Coaches

Ramps - Wellness Center : Ramp , Handrail

Ramp to Wellness Center

Run 1

Finding

There are no handrails.

On-Site Finding None Found

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2

Record Number 64138

Ramps - Wellness Center : Ramp , Landing

Ramp to Wellness Center

Run 1 Intermediate Landing

Finding

The ramp changes direction. The width of the landing does not meet the minimum required width.

On-Site Finding 45.25 inches

Recommendation

Modify or replace the landing to provide the minimum required length and width.

Recommendation At least 60.00 inches

Code Reference ADA 405, 504.7.4

Record Number 64139

Police Department-Office-3 Coaches

Ramps - Wellness Center : Ramp , Landing

Ramp to Wellness Center

Run 1 Intermediate Landing

Finding

The ramp changes direction at this landing. The length of the landing is less than the required minimum length.

On-Site Finding 46.50 inches

Recommendation

Modify or replace the landing to meet the minimum required width and length.

Recommendation At least 72.00 inches

Code Reference ADA 405.7, 405.7.4

Record Number 64140

Ramps - Wellness Center : Ramp , Ramp Run

Ramp to Wellness Center

Run 2

Finding

The width of the ramp is less than required.

On-Site Finding 47.00 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Record Number 64141

Police Department-Office-3 Coaches

Ramps - Wellness Center : Ramp , Ramp Run

Ramp to Wellness Center

Run 2

Finding

Ramp run does not have enough vertical clearance height.

On-Site Finding 0.00 inches

Recommendation

Provide compliant vertical clearance for the ramp run.

Recommendation At least 80.00 inches

Code Reference ADA 307.4, CA 11B-307.4

Record Number 64142

Ramps - Wellness Center : Ramp , Handrail

Ramp to Wellness Center

Run 2

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 64144

Police Department-Office-3 Coaches

Ramps - Wellness Center : Ramp , Ramp Run

Ramp to Wellness Center

Run 2

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding 4.25 inches

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation 2.00 - 4.00 inches

Code Reference ADA 405.9.2

Record Number 64143

Ramps - Wellness Center : Ramp , Landing

Ramp to Wellness Center

Run 2 Top Landing

Finding

The width of the landing is less than required.

On-Site Finding 47.20 inches

Recommendation

Modify or replace the landing on the ramp to provide the required length in the direction of the run of the ramp and required inches in width.

Recommendation At least 60.00 inches

Code Reference ADA 405, 405.7.2, CA 11B-405.7.2

Record Number 64145

Police Department-Office-3 Coaches

Ramps - Wellness Center : Ramp , Handrail

Ramp to Wellness Center

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505

Record Number 64150

Ramps - Wellness Center : Ramp , Handrail

Ramp to Wellness Center

Run 2 Right Handrail

Finding

The ends of the handrails end abruptly.

On-Site Finding Not Compliant

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending the required distance beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1

Record Number 64147

Police Department-Office-3 Coaches

Ramps - Wellness Center : Ramp , Handrail

Ramp to Wellness Center

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 64148

Ramps - Wellness Center : Ramp , Handrail

Ramp to Wellness Center

Run 2 Right Handrail

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.6

Record Number 64146

Police Department-Office-3 Coaches

Ramps - Wellness Center : Ramp , Handrail

Ramp to Wellness Center

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 0.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 64149

Stairs - Administration : Stairway

Stairs to Strategy Conference Room Exteeior Entrance

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Code Reference ADA 206.2, 210, 402.2, 504, CA 11B-206.2, 210, 402.2, 504

Record Number 64273

Police Department-Office-3 Coaches

Stairs - Administration : Stairway , Handrails

Stairs to Strategy Conference Room Exteeior Entrance

Run 1

Finding

There is no handrail provided on one side of the stairway.

On-Site Finding None Found

Recommendation

Provide compliant handrails on the stairway.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-504.6, 505.2

Record Number 64274

Stairs - Administration : Stairway , Risers

Stairs to Strategy Conference Room Exteeior Entrance

Run 1

Finding

The height of the risers are not uniform.

On-Site Finding Not Uniform

Recommendation

Modify or replace the stairs to provide uniform riser height.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-504.2

Record Number 64276

Police Department-Office-3 Coaches

Stairs - Administration : Stairway , Risers

Stairs to Strategy Conference Room Exteeior Entrance

Run 1

Finding

The treads do not have a compliant depth.

On-Site Finding 1.00 inches

Recommendation

Modify or replace the stairs to provide compliant treads.

Recommendation At least 11.00 inches

Code Reference ADA 504, 504.2, CA 11B-504.2

Record Number 64275

Stairs - Administration : Stairway , Handrails

Stairs to Strategy Conference Room Exteeior Entrance

Run 1 Right Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10, CA 11B-504.6, 505.10

Record Number 64278

Police Department-Office-3 Coaches

Stairs - Administration : Stairway , Handrail

Stairs to Strategy Conference Room Exteeior Entrance

Run 1 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 64277

Stairs - Administration : Stairway , Handrails

Stairs to Strategy Conference Room Exteeior Entrance

Run 1 Right Handrail

Finding

The handrail extension is not parallel with the floor surface at the bottom landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant extension to the handrail.

Recommendation See Recommendation

Code Reference ADA 504, CA 11B-505.10.3

Record Number 64279

Police Department-Office-3 Coaches

Stairs - Administration : Stairway , Run

Stairs Next to Main Entrance

Run 1

Finding

The width of the stairway does not meet the minimum required width.

On-Site Finding 41.00 inches

Recommendation

Install a stairway with a minimum width as required.

Recommendation At least 44.00 inches

Code Reference ADA 210, 504, CA 11B-1009.1, 210, 504

Record Number 65159

Stairs - Administration : Stairway , Handrails

Stairs Next to Main Entrance

Run 1 Left Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 65160

Police Department-Office-3 Coaches

Stairs - Administration : Stairway , Handrails

Stairs Next to Main Entrance

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 41.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 65161

Stairs - Administration : Stairway , Handrails

Stairs Next to Main Entrance

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 41.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 65164

Police Department-Office-3 Coaches

Stairs - Administration : Stairway , Handrails

Stairs Next to Main Entrance

Run 1 Right Handrail

Finding

There are no top handrail extensions provided on the stairway.

On-Site Finding None Found

Recommendation

Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.1, 505.10.2, CA 11B-505.10.2

Record Number 65162

Stairs - Administration : Stairway , Handrails

Stairs Next to Main Entrance

Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 65163

Police Department-Office-3 Coaches

Stairs - Administration : Stairway , Risers

Stairs Next to Main Entrance

Run 2

Finding

The risers on the stairway are open.

On-Site Finding Not Closed

Recommendation

Close the riser openings on the stairway. Open risers are not permitted.

Recommendation See Recommendation

Code Reference ADA 504, 504.3, CA 11B-504.3

Record Number 65166

Stairs - Administration : Stairway , Handrails

Stairs Next to Main Entrance

Run 2

Finding

There are no handrails provided on the stairway.

On-Site Finding None Found

Recommendation

Provide compliant handrails.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.2, CA 11B-504.6, 505.2

Record Number 65165

Police Department-Office-3 Coaches

Stairs - Patrol : Stairway

Stairs to Patrol Building from Patrol Parking Lot

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Code Reference ADA 206.2, 210, 402.2, 504, CA 11B-206.2, 210, 402.2, 504

Record Number 65051

Stairs - Patrol : Stairway , Handrails

Stairs to Patrol Building from Patrol Parking Lot

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 40.75 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 64211

Police Department-Office-3 Coaches

Stairs - Patrol : Stairway , Handrails

**Stairs to Patrol Building from Patrol Parking Lot
Run 1 Left Handrail**

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 64210

Stairs - Patrol : Stairway , Handrails

**Stairs to Patrol Building from Patrol Parking Lot
Run 1 Right Handrail**

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 64213

Police Department-Office-3 Coaches

Stairs - Patrol : Stairway , Handrails

**Stairs to Patrol Building from Patrol Parking Lot
Run 1 Right Handrail**

Finding

The handrails are not mounted at the required height.

On-Site Finding 40.25 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 64214

Stairs - Patrol : Stairway , Handrails

**Stairs to Patrol Building from Patrol Parking Lot
Run 1 Right Handrail**

Finding

The diameter of the handrails is not within the required range.

On-Site Finding 18.00 inches

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.

Recommendation 1.25 - 2.00 inches

Code Reference ADA 504.6 , 505, 505.7.1, CA 11B-505.7

Record Number 64212

Police Department-Office-3 Coaches

Stairs - Patrol : Stairway

Stairs to Patrol Building from Staff Parking Lot

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Code Reference ADA 206.2, 210, 402.2, 504, CA 11B-206.2, 210, 402.2, 504

Record Number 65122

Stairs - Patrol : Stairway , Handrails

Stairs to Patrol Building from Staff Parking Lot

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 41.75 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 65125

Police Department-Office-3 Coaches

Stairs - Patrol : Stairway , Handrails

Stairs to Patrol Building from Staff Parking Lot

Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 65124

Stairs - Patrol : Stairway , Handrails

Stairs to Patrol Building from Staff Parking Lot

Run 1 Right Handrail

Finding

There are no top handrail extensions provided on the stairway.

On-Site Finding None Found

Recommendation

Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.1, 505.10.2, CA 11B-505.10.2

Record Number 65123

Police Department-Office-3 Coaches

Stairs - Patrol : Stairway , Handrails

Stairs to Patrol Building from Staff Parking Lot

Run 1 Left Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10, CA 11B-504.6, 505.10

Record Number 65127

Stairs - Patrol : Stairway , Handrail

Stairs to Patrol Building from Staff Parking Lot

Run 1 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 65126

Police Department-Office-3 Coaches

Stairs - Wellness Center : Stairway , Handrails

Stairs to Wellness Center Next to Weightroom

Run 1 Left Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10, CA 11B-504.6, 505.10

Record Number 64187

Stairs - Wellness Center : Stairway , Handrails

Stairs to Wellness Center Next to Weightroom

Run 1 Left Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 64186

Police Department-Office-3 Coaches

Stairs - Wellness Center : Stairway , Handrails

Stairs to Wellness Center Next to Weightroom

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 39.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 64191

Stairs - Wellness Center : Stairway , Handrails

Stairs to Wellness Center Next to Weightroom

Run 1 Right Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.6

Record Number 64188

Police Department-Office-3 Coaches

Stairs - Wellness Center : Stairway , Handrails

Stairs to Wellness Center Next to Weightroom

Run 1 Right Handrail

Finding

There are no top handrail extensions provided on the stairway.

On-Site Finding None Found

Recommendation

Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.1, 505.10.2, CA 11B-505.10.2

Record Number 64189

Stairs - Wellness Center : Stairway , Handrails

Stairs to Wellness Center Next to Weightroom

Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 64190

Police Department-Office-3 Coaches

Stairs - Wellness Center : Stairway , Handrails

**Stairs Next to Wellness Center from Patrol Lot
Run 1 Right Handrail**

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 64203

Stairs - Wellness Center : Stairway , Handrails

**Stairs Next to Wellness Center from Patrol Lot
Run 1 Right Handrail**

Finding

There are no top handrail extensions provided on the stairway.

On-Site Finding None Found

Recommendation

Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.1, 505.10.2, CA 11B-505.10.2

Record Number 64202

Police Department-Office-3 Coaches

Stairs - Wellness Center : Stairway , Handrails

**Stairs Next to Wellness Center from Patrol Lot
Run 1 Right Handrail**

Finding

The handrails are not mounted at the required height.

On-Site Finding 40.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 64204

Stairs - Wellness Center : Stairway , Handrails

**Stairs Next to Wellness Center from Patrol Lot
Run 1 Left Handrail**

Finding

The handrails are not mounted at the required height.

On-Site Finding 40.75 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 504, 504.6 , 505.4, CA 11B-504.6, 505

Record Number 64208

Police Department-Office-3 Coaches

Stairs - Wellness Center : Stairway , Handrails

**Stairs Next to Wellness Center from Patrol Lot
Run 1 Left Handrail**

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.3, CA 11B-505.10.3

Record Number 64206

Stairs - Wellness Center : Stairway , Handrails

**Stairs Next to Wellness Center from Patrol Lot
Run 1 Left Handrail**

Finding

The diameter of the handrails is not within the required range.

On-Site Finding 1.00 inches

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.

Recommendation 1.25 - 2.00 inches

Code Reference ADA 504.6 , 505, 505.7.1, CA 11B-505.7

Record Number 64205

Police Department-Office-3 Coaches

Stairs - Wellness Center : Stairway , Handrails

**Stairs Next to Wellness Center from Patrol Lot
Run 1 Left Handrail**

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Code Reference ADA 504, 504.6 , 505.10.2, CA 11B-505.10.2

Record Number 64207

Doors - Administration : Door , Clear Floor Space

**Unisex Restroom in Office Next to Police Chief
Push Side**

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 0.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Record Number 64117

Police Department-Office-3 Coaches

Doors - Administration : Door , Latch Side Clearance

**Unisex Restroom in Office Next to Police Chief
Push Side**

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 64116

Doors - Administration : Door , Clear Floor Space

**Unisex Restroom in Office Next to Police Chief
Pull Side**

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 64118

Police Department-Office-3 Coaches

Doors - Administration : Door , Hardware

**Unisex Restroom in Office Next to Police Chief
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 64115

Doors - Administration : Door

Strategy Conference Room - Exterior Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.75 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64119

Police Department-Office-3 Coaches

Doors - Administration : Door , Latch Side Clearance

Strategy Conference Room - Exterior Entrance

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 34.25 inches

Recommendation

Provide the recommended latch side clearance on the pull side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, 404.2.4

Record Number 64122

Doors - Administration : Door , Clear Floor Space

Strategy Conference Room - Exterior Entrance

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 49.62 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 64123

Police Department-Office-3 Coaches

Doors - Administration : Door , Threshold

Strategy Conference Room - Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed for a vertical rise.

On-Site Finding 0.50 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 64121

Doors - Administration : Door , Clear Floor Space

Front Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 64169

Police Department-Office-3 Coaches

Doors - Administration : Door , Latch Side Clearance

Front Entrance

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 9.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 64167

Doors - Administration : Door , Latch Side Clearance

Front Entrance

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 13.25 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Telephone Obstructs Latch Side Clearance.

Record Number 64168

Police Department-Office-3 Coaches

Doors - Administration : Door , Clear Floor Space

Front Entrance

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 46.25 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Telephone Obstructs Latch Side Clearance.

Record Number 64170

Doors - Administration : Door , Hardware

Front Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 64166

Police Department-Office-3 Coaches

Doors - Administration : Door

Entrance Next to Reception

Finding

The clear opening width of the door is less than required.

On-Site Finding 29.75 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64217

Doors - Administration : Door , Clear Floor Space

Entrance Next to Reception

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 34.75 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 36.00 inches

Code Reference ADA 404, CA 11B-404.2.4

Notes : Counter Obstructs Latch Side Clearance.

Record Number 64220

Police Department-Office-3 Coaches

Doors - Administration : Door , Latch Side Clearance

Entrance Next to Reception

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 3.25 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Notes : Counter Obstructs Latch Side Clearance.

Record Number 64219

Doors - Administration : Door , Hardware

Entrance Next to Reception

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 64218

Police Department-Office-3 Coaches

Doors - Administration : Door , Latch Side Clearance

**Seargents Office Next to Records Supervisor
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 8.62 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 64239

Doors - Administration : Door , Clear Floor Space

**Seargents Office Next to Records Supervisor
Pull Side**

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 44.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 64240

Police Department-Office-3 Coaches

Doors - Administration : Door , Latch Side Clearance

Records Clerk II / Court Liason

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 13.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Furniture Obstructs Latch Side Clearance.

Record Number 64242

Doors - Administration : Door , Latch Side Clearance

Unisex Restroom Next to Reception

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 7.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Notes : Shelf Obstructs Latch Side Clearance.

Record Number 64265

Police Department-Office-3 Coaches

Doors - Administration : Door , Hardware

Unisex Restroom Next to Reception

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 64264

Doors - Administration : Door , Latch Side Clearance

Office Next to Police Chief

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 4.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 64298

Police Department-Office-3 Coaches

Doors - Administration : Door , Hardware

**Office Next to Police Chief
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 64297

Doors - Administration : Door

Entrance Next to Police Chiefs Office

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.62 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64314

Police Department-Office-3 Coaches

Doors - Administration : Door , Clear Floor Space

Entrance Next to Police Chiefs Office

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 46.75 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 64316

Doors - Administration : Door , Latch Side Clearance

Police Chiefs Office

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 11.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 64323

Police Department-Office-3 Coaches

Doors - Administration : Door , Clear Floor Space

Records Supervisor

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 48.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 64326

Doors - Administration : Door , Latch Side Clearance

Records Supervisor

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 5.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 64325

Police Department-Office-3 Coaches

Doors - Patrol : Door

North Entrance from Patrol Parking Lot

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.50 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65053

Doors - Patrol : Door , Latch Side Clearance

North Entrance from Patrol Parking Lot

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 10.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : First Aid Kit Obstructs Latch Side Clearance.

Record Number 65057

Police Department-Office-3 Coaches

Doors - Patrol : Door , Clear Floor Space

**North Entrance from Patrol Parking Lot
Push Side**

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Notes : First Aid Kit Obstructs Latch Side Clearance.

Record Number 65058

Doors - Patrol : Door , Clear Floor Space

**North Entrance from Patrol Parking Lot
Pull Side**

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 49.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65059

Police Department-Office-3 Coaches

Doors - Patrol : Door , Threshold

North Entrance from Patrol Parking Lot

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 65056

Doors - Patrol : Door , Hardware

**North Entrance from Patrol Parking Lot
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 8.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 65055

Police Department-Office-3 Coaches

Doors - Patrol : Door

Womens Locker Room - Exterior Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.00 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65062

Doors - Patrol : Door , Clear Floor Space

Womens Locker Room - Exterior Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 65065

Police Department-Office-3 Coaches

Doors - Patrol : Door , Threshold

Womens Locker Room - Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 65064

Doors - Patrol : Door , Clear Floor Space

Interview Room

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 65068

Police Department-Office-3 Coaches

Doors - Patrol : Door , Clear Floor Space

Interview Room

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 42.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65067

Doors - Patrol : Door , Clear Floor Space

Interview Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 41.25 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Office Equipment Obstructs Clear Floor Space Length.

Record Number 65069

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

**Patrol Building Security Gate Next to Visitors Parking Lot
Push Side**

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 3.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65075

Doors - Patrol : Door , Latch Side Clearance

**Patrol Building Security Gate Next to Visitors Parking Lot
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 2.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65076

Police Department-Office-3 Coaches

Doors - Patrol : Door , Hardware

Patrol Building Security Gate Next to Visitors Parking Lot

Push / Pull

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 65074

Doors - Patrol : Door

Mens Locker Room - Patrol Office Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.37 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65109

Police Department-Office-3 Coaches

Doors - Patrol : Door

Mens Locker Room - Patrol Office Entrance

Finding

The vertical clearance height of the door is less than required.

On-Site Finding 77.87 inches

Recommendation

Extend the height of the doorway to provide the required clearance height.

Recommendation At least 78.00 inches

Code Reference ADA 307, 307.4, 404, 404.2.3, CA 11B-307, 404, 404.2.3

Record Number 65110

Doors - Patrol : Door , Clear Floor Space

Mens Locker Room - Patrol Office Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 65112

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

**Mens Locker Room - Patrol Office Entrance
Push Side**

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 11.25 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 65111

Doors - Patrol : Door

Patrol Sargents Office

Finding

The clear opening width of the door is less than required.

On-Site Finding 29.75 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65113

Police Department-Office-3 Coaches

Doors - Patrol : Door

Womens Locker Room - Offices Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.12 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65118

Doors - Patrol : Door , Hardware

Womens Locker Room - Offices Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 65120

Police Department-Office-3 Coaches

Doors - Patrol : Door , Threshold

Womens Locker Room - Offices Entrance

Finding

The height of the threshold at the entrance door is greater than allowed for a vertical rise.

On-Site Finding 0.37 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 65121

Doors - Patrol : Door

Womens Locker Room - Briefing/Booking Entrance

Finding

The clear opening width of the door is less than required.

On-Site Finding 29.75 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65150

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

**Womens Locker Room - Briefing/Booking Entrance
Push Side**

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 5.25 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 65151

Doors - Patrol : Door , Latch Side Clearance

**Mens Locker Room -Briefing/Bookings Entrance
Push Side**

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 6.75 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 65157

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

**Mens Locker Room -Briefing/Bookings Entrance
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 9.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65158

Doors - Patrol : Door

Patrol Offices - Staff Parking Lot Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.00 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65167

Police Department-Office-3 Coaches

Doors - Patrol : Door , Clear Floor Space

**Patrol Offices - Staff Parking Lot Entrance
Push Side**

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 39.25 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Cubicle Obstructs Clear Floor Space Length.

Record Number 65170

Doors - Patrol : Door , Clear Floor Space

**Patrol Offices - Staff Parking Lot Entrance
Push Side**

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Notes : Cubicle Obstructs Clear Floor Space Length.

Record Number 65171

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

**Patrol Offices - Staff Parking Lot Entrance
Pull Side**

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 22.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65169

Doors - Patrol : Door , Clear Floor Space

**Patrol Offices - Staff Parking Lot Entrance
Pull Side**

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 46.37 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 65172

Police Department-Office-3 Coaches

Doors - Patrol : Door

Patrol Offices - Entrance from Patrol Parkin Lot

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.50 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65182

Doors - Patrol : Door , Clear Floor Space

Patrol Offices - Entrance from Patrol Parkin Lot

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 65186

Police Department-Office-3 Coaches

Doors - Patrol : Door , Clear Floor Space

**Patrol Offices - Entrance from Patrol Parkin Lot
Pull Side**

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 50.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65187

Doors - Patrol : Door , Threshold

Patrol Offices - Entrance from Patrol Parkin Lot

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 65185

Police Department-Office-3 Coaches

Doors - Patrol : Door , Hardware

**Patrol Offices - Entrance from Patrol Parkin Lot
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 20.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 65184

Doors - Patrol : Door

Womens Locker Room Restroom

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.37 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65188

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

Womens Locker Room Restroom

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 5.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Notes : Lavatory Obstructs Latch Side Clearance.

Record Number 65190

Doors - Patrol : Door

Commanders Office

Finding

The clear opening width of the door is less than required.

On-Site Finding 29.87 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65192

Police Department-Office-3 Coaches

Doors - Patrol : Door

Commanders Office

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 65193

Doors - Patrol : Door

Mens Locker Room - Exterior Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.00 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65194

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

Mens Locker Room - Exterior Entrance

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.25 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65197

Doors - Patrol : Door , Clear Floor Space

Mens Locker Room - Exterior Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Code Reference ADA 302.1, 403.2, CA 11B-302.1, 403.2

Record Number 65198

Police Department-Office-3 Coaches

Doors - Patrol : Door , Clear Floor Space

Mens Locker Room - Exterior Entrance

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 47.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 65199

Doors - Patrol : Door , Hardware

Mens Locker Room - Exterior Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 8.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 65196

Police Department-Office-3 Coaches

Doors - Patrol : Door

Mens Locker Room Restroom

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.75 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 65222

Doors - Patrol : Door , Clear Floor Space

Mens Locker Room Restroom

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 24.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Lavatory Obstructs Clear Floor Space Length.

Record Number 65225

Police Department-Office-3 Coaches

Doors - Patrol : Door , Latch Side Clearance

Mens Locker Room Restroom

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 5.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 65224

Doors - Wellness Center : Door

Wellness Center Cardio/Break Room Exterior Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.00 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64130

Police Department-Office-3 Coaches

Doors - Wellness Center : Door , Clear Floor Space

**Wellness Center Cardio/Break Room Exterior Entrance
Pull Side**

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 46.80 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 64134

Doors - Wellness Center : Door , Threshold

Wellness Center Cardio/Break Room Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 4.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 64133

Police Department-Office-3 Coaches

Doors - Wellness Center : Door , Hardware

**Wellness Center Cardio/Break Room Exteior Entrance
Lever**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 64132

Doors - Wellness Center : Door

Wellness Center Entrance Next to Patrol Lot

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 76.25 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64192

Police Department-Office-3 Coaches

Doors - Wellness Center : Door , Clear Floor Space

**Wellness Center Entrance Next to Patrol Lot
Pull Side**

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 46.62 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 64197

Doors - Wellness Center : Door , Threshold

Wellness Center Entrance Next to Patrol Lot

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.37 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 64196

Police Department-Office-3 Coaches

Doors - Wellness Center : Door

**Wellness Center Entrance Next to Patrol Lot
Lever**

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 64195

Doors - Wellness Center : Door , Hardware Height

**Wellness Center Entrance Next to Patrol Lot
Lever**

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 33.50 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Record Number 64194

Police Department-Office-3 Coaches

Doors - Wellness Center : Door

Door Between Wellness Center Cardio/Break Room & Weight Room

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 76.00 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64199

Doors - Wellness Center : Door , Clear Floor Space

Door Between Wellness Center Cardio/Break Room & Weight Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 24.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Equipment Obstructs Clear Floor Space Length.

Record Number 64201

Police Department-Office-3 Coaches

Doors - Wellness Center : Door

Unisex Restroom in Wellness Center

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 76.75 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64215

Doors - Wellness Center : Door

Wellness Center Break Room

Finding

The vertical clearance height of the open doorway is not compliant.

On-Site Finding 78.75 inches

Recommendation

Provide a compliant open doorway at the location.

Recommendation At least 80.00 inches

Code Reference ADA 307.4

Record Number 64247

Police Department-Office-3 Coaches

Doors - Wellness Center : Door , Threshold

Wellness Center Break Room

Finding

The height of the threshold at the entrance door is greater than allowed for a vertical rise.

On-Site Finding 0.37 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 64248

Doors - Wellness Center : Door

Wellness Center Weight Room Exterior Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 75.75 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 64249

Police Department-Office-3 Coaches

Doors - Wellness Center : Door

Wellness Center Weight Room Exterior Entrance

Finding

The vertical clearance height of the door is less than required.

On-Site Finding 77.37 inches

Recommendation

Extend the height of the doorway to provide the required clearance height.

Recommendation At least 78.00 inches

Code Reference ADA 307, 307.4, 404, 404.2.3, CA 11B-307, 404, 404.2.3

Record Number 64250

Doors - Wellness Center : Door , Clear Floor Space

Wellness Center Weight Room Exterior Entrance

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 47.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Record Number 64254

Police Department-Office-3 Coaches

Doors - Wellness Center : Door , Threshold

Wellness Center Weight Room Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 2.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 64253

Doors - Wellness Center : Door , Hardware

Wellness Center Weight Room Exterior Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 64251

Police Department-Office-3 Coaches

Doors - Wellness Center : Door , Hardware Height

**Wellness Center Weight Room Exterior Entrance
Lever**

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 32.50 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 404, 404.2.7, CA 11B-404.2.7

Record Number 64252

Doors - Wellness Center : Door , Threshold

Wellness Center Cardio/Breakroom

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.25 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 64282

Police Department-Office-3 Coaches

Counters - Administration : Counter

Information Counter

Finding

The length of the counter or desk does not comply with length requirements. No equivalent facilitation is provided in the area.

On-Site Finding 35.75 inches

Recommendation

Provide a counter or desk with the required length.

Recommendation At least 36.00 inches

Code Reference CA 11B-904.4

Notes : Counter Protrudes 16" Into the Path of Travel.

Record Number 64245

Counters - Administration : Counter

Information Counter

Finding

The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.

On-Site Finding 37.25 inches

Recommendation

Provide a portion of counter at the compliant height.

Recommendation 28.00 - 34.00 inches

Code Reference ADA 902, 904, CA 11B-904.4

Notes : Counter Protrudes 16" Into the Path of Travel.

Record Number 64244

Police Department-Office-3 Coaches

Counters - Administration : Counter

Information Counter

Finding

The counter is a protruding object.

On-Site Finding See Above

Recommendation

Adjust the counter so that it is no longer a protruding object.

Recommendation See Recommendation

Code Reference ADA 307.2, 902

Notes : Counter Protrudes 16" Into the Path of Travel.

Record Number 64246

Signage - Administration : Signage

Office Next to Police Chief

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64129

Police Department-Office-3 Coaches

Signage - Administration : Signage

Records Clerk II / Court Liason

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64136

Signage - Administration : Signage

Safety Coordinator

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64151

Police Department-Office-3 Coaches

Signage - Administration : Signage

Records Supervisor

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64171

Signage - Administration : Signage

Seargents Office Next to Records Supervisor

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64221

Police Department-Office-3 Coaches

Signage - Administration : Signage , Signage

Directional Signage to the Restrooms

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 64230

Signage - Administration : Signage , Signage

Strategy Conference Room - Exterior Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 64237

Police Department-Office-3 Coaches

Signage - Administration : Signage , Signage

Entrance Next to Police Chiefs Office

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 64280

Signage - Administration : Signage

Police Chiefs Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64294

Police Department-Office-3 Coaches

Signage - Administration : Signage

Break Area Next to Reception

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64300

Signage - Administration : Signage

Large Office Next to Reception

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64320

Police Department-Office-3 Coaches

Signage - Administration : Signage , Signage

Strategy Conference Room - Hallway Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 64321

Signage - Patrol : Signage , Signage

Patrol Offices - Entrance from Patrol Parkin Lot

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 65060

Police Department-Office-3 Coaches

Signage - Patrol : Signage , Signage

Interview Room

Finding

There is no informational signage.

On-Site Finding Not Found

Recommendation

Install informational signage to each accessible element or room or location.

Recommendation See Recommendation

Code Reference ADA 216.3 , 703.5, CA 11B-216.3, 703.5

Record Number 65061

Signage - Patrol : Signage

Commanders Office, Patrol Sargents Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 65155

Police Department-Office-3 Coaches

Signage - Patrol : Signage , Signage

North Entrance from Patrol Parking Lot

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 65200

Signage - Patrol : Signage , Signage

Patrol Offices - Staff Parking Lot Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 65221

Police Department-Office-3 Coaches

Signage - Wellness Center : Signage , Signage

Wellness Center Entrance Next to Patrol Lot

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 64231

Signage - Wellness Center : Signage , Signage

Wellness Center Weight Room Exterior Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 64243

Police Department-Office-3 Coaches

Signage - Wellness Center : Signage

Wellness Center Break Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 64299

Signage - Wellness Center : Signage , Signage

Wellness Center Cardio/Break Room Exterior Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 64301

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom

Unisex Restroom in Office Next to Police Chief

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Code Reference ADA 213, 213.2.1, CA 11B-213.2.1

Record Number 64107

Restrooms - Administration : Restroom , Mirror

Unisex Restroom in Office Next to Police Chief

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 40.37 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 40.00 inches

Code Reference ADA 213, 603, 603.3, CA 11B-603.3

Record Number 64111

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Lavatory

**Unisex Restroom in Office Next to Police Chief
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 64110

Restrooms - Administration : Restroom , Lavatory

**Unisex Restroom in Office Next to Police Chief
Lavatory**

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 15.12 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
center

Code Reference CA 11B-606.6

Record Number 64109

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Wall Signage

Unisex Restroom in Office Next to Police Chief

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 64113

Restrooms - Administration : Restroom , Door Signage

Unisex Restroom in Office Next to Police Chief

Unisex

Finding

Signage does not include contrasting gender use symbols.

On-Site Finding None Found

Recommendation

Provide compliant contrasting gender use unisex signage.

Recommendation See Recommendation

Code Reference CA 11B-703.7.2.6.3

Record Number 64112

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Dispensers

Unisex Restroom in Office Next to Police Chief

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 49.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 64108

Restrooms - Administration : Restroom , Toilet Compartment

Unisex Restroom in Office Next to Police Chief

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 59.50 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 64128

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Grab Bar

Unisex Restroom in Office Next to Police Chief

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 64127

Restrooms - Administration : Restroom , Toilet

Unisex Restroom in Office Next to Police Chief

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 38.00 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 64126

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Grab Bar

Unisex Restroom Next to Reception

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 64262

Restrooms - Administration : Restroom , Grab Bars

Unisex Restroom Next to Reception

Finding

The length of the side grab bar is less than required.

On-Site Finding 36.00 inches

Recommendation

Replace the side grab bar with a compliant grab bar.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1

Record Number 64259

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Grab Bars

Unisex Restroom Next to Reception

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 38.50 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Record Number 64260

Restrooms - Administration : Restroom , Grab Bars

Unisex Restroom Next to Reception

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 8.75 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 64261

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Toilet

Unisex Restroom Next to Reception

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 36.50 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 64258

Restrooms - Administration : Restroom

Unisex Restroom Next to Reception

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Code Reference ADA 213, 213.2.1, CA 11B-213.2.1

Record Number 64266

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Mirror

Unisex Restroom Next to Reception

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 40.50 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 40.00 inches

Code Reference ADA 213, 603, 603.3, CA 11B-603.3

Record Number 64269

Restrooms - Administration : Restroom , Lavatory

Unisex Restroom Next to Reception

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 64268

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Lavatory

**Unisex Restroom Next to Reception
Lavatory**

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 17.50 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
 center

Code Reference CA 11B-606.6

Record Number 64267

Restrooms - Administration : Restroom , Wall Signage

Unisex Restroom Next to Reception

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 64272

Police Department-Office-3 Coaches

Restrooms - Administration : Restroom , Door Signage

Unisex Restroom Next to Reception

Unisex

Finding

Signage does not include contrasting gender use symbols.

On-Site Finding None Found

Recommendation

Provide compliant contrasting gender use unisex signage.

Recommendation See Recommendation

Code Reference CA 11B-703.7.2.6.3

Record Number 64271

Restrooms - Administration : Restroom , Door Signage

Unisex Restroom Next to Reception

Unisex

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 60.50 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 64270

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Toilet Compartment

Mens Locker Room Restroom

Finding

The latch side approach to the compartment designated to be accessible in the restroom is not wide enough.

On-Site Finding 40.62 inches

Recommendation

Provide a latch-side approach to the compartment designated to be accessible with a clear, unobstructed access width.

Recommendation At least 44.00 inches

Code Reference ADA 603, 604.8.1.2, CA 11B-604.8.1.2, 604.8.2.2

Record Number 65093

Restrooms - Patrol : Restroom , Grab Bars

Mens Locker Room Restroom

Finding

There is no side grab bar at the toilet compartment.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Code Reference ADA 603, 604.5, 604.8.1.5, CA 11B-604.5

Record Number 65094

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Toilet Compartment

Mens Locker Room Restroom

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 60.75 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 65107

Restrooms - Patrol : Restroom

Mens Locker Room Restroom

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4.1, 604.8.1.2, 604.8.2.2, CA 11B-404, 604.8.1.2

Record Number 65106

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom

Mens Locker Room Restroom

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Code Reference ADA 604.8.1.2, CA 11B-604.8.1.2

Record Number 65100

Restrooms - Patrol : Restroom

Mens Locker Room Restroom

Finding

The inside handle is not located near the latch.

On-Site Finding None Found

Recommendation

Adjust the inside handle so that it is located near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 65105

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Compartment Door

Mens Locker Room Restroom

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Code Reference ADA 304.4, 603, 604.8, CA 11B-604.8.1

Record Number 65101

Restrooms - Patrol : Restroom , Compartment Door

Mens Locker Room Restroom

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 65098

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Compartment Door

Mens Locker Room Restroom

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 309.4, 404, 404.2.7, 604.8, CA 11B-404.2.7, 604.8.1.2

Record Number 65103

Restrooms - Patrol : Restroom , Compartment Door

Mens Locker Room Restroom

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 0.00 inches

Recommendation

Remove and relocate the door hardware.

Recommendation 34.00 - 44.00 inches

Code Reference ADA 213, 404, 404.2.7, 604, 604.8, CA 11B-404.2.7, 604.8.1.2

Record Number 65104

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Compartment Door

Mens Locker Room Restroom

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 65102

Restrooms - Patrol : Restroom , Compartment Door

Mens Locker Room Restroom

Finding

The clear opening width of the doorway to the compartment is less than required.

On-Site Finding 0.00 inches

Recommendation

Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, 604.8, CA 11B-404.2.3, 604.8.1.2

Record Number 65099

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Grab Bar

Mens Locker Room Restroom

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 65097

Restrooms - Patrol : Restroom , Toilet Compartment

Mens Locker Room Restroom

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 15.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 65108

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Toilet

Mens Locker Room Restroom

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 30.00 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 65096

Restrooms - Patrol : Restroom

Womens Locker Room Restroom

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 57.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Code Reference ADA 304, 304.3, 304.3.1, 603, 603.2.1, CA 11B-304.3

Notes : Lavatory Obstructs Turning Space Diameter.

Record Number 65128

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Mirror

Womens Locker Room Restroom

Finding

Width of the full length mirror is not compliant.

On-Site Finding 15.00 inches

Recommendation

Provide a compliant full length mirror.

Recommendation At least 18.00 inches

Code Reference ADA 603.3

Record Number 65138

Restrooms - Patrol : Restroom , Lavatory

Womens Locker Room Restroom

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 13.25 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
center

Code Reference CA 11B-606.6

Record Number 65134

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

**Womens Locker Room Restroom
Lavatory**

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 26.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Record Number 65132

Restrooms - Patrol : Restroom , Lavatory

**Womens Locker Room Restroom
Lavatory**

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 26.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Record Number 65133

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

**Womens Locker Room Restroom
Lavatory**

Finding

The height of the counter surface is greater than allowed.

On-Site Finding 35.00 inches

Recommendation

Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.

Recommendation Up to 34.00 inches

Code Reference ADA 213, 606, 606.3, CA 11B-213, 606.3

Record Number 65131

Restrooms - Patrol : Restroom , Lavatory

**Womens Locker Room Restroom
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 65137

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

**Womens Locker Room Restroom
Lavatory**

Finding

The lavatory is in an enclosed cabinet, thereby preventing an accessible forward approach.

On-Site Finding Not Accessible

Recommendation

Lavatories in restrooms must provide clear floor space in front of the lavatory for an accessible forward approach and shall provide the minimum required primary age group knee and toe clearances. If sufficient clear floor space and compliant clearances can not be provided, remove the lavatory cabinet and replace with an accessible wall-mounted lavatory unit.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.2, CA 11B-305, 306, 606.2

Record Number 65130

Restrooms - Patrol : Restroom , Lavatory

**Womens Locker Room Restroom
Lavatory**

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 65136

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

**Womens Locker Room Restroom
Lavatory**

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 22.50 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 30.00 inches

Code Reference ADA 213, 305.3, 606, 606.2, CA 11B-305, 606.2

Record Number 65135

Restrooms - Patrol : Restroom , Wall Signage

Womens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65143

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Wall Signage

Womens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65144

Restrooms - Patrol : Restroom , Door Signage

Womens Locker Room Restroom

Female

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 65139

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Wall Signage

Womens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65145

Restrooms - Patrol : Restroom , Wall Signage

Womens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65146

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Door Signage

Womens Locker Room Restroom

Female

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 65.25 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 65140

Restrooms - Patrol : Restroom , Door Signage

Womens Locker Room Restroom

Female

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 65141

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Door Signage

Womens Locker Room Restroom

Female

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 64.25 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 65142

Restrooms - Patrol : Restroom , Dispensers

Womens Locker Room Restroom

Feminine Products

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 46.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Notes : Interferes With Grab Bar.

Record Number 65129

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Toilet Compartment

Womens Locker Room Restroom

Finding

There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.

On-Site Finding 44.62 inches

Recommendation

Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.

Recommendation At least 60.00 inches

Code Reference ADA 502.4, 603, 604.3.1

Record Number 65173

Restrooms - Patrol : Restroom , Toilet Compartment

Womens Locker Room Restroom

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 62.62 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 308.1, 603.4, CA 11B-308, 603.4, 604.8.3

Record Number 65179

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Grab Bar

Womens Locker Room Restroom

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 65178

Restrooms - Patrol : Restroom , Grab Bars

Womens Locker Room Restroom

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 53.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Record Number 65176

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Grab Bars

Womens Locker Room Restroom

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 23.50 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 65177

Restrooms - Patrol : Restroom , Toilet Compartment

Womens Locker Room Restroom

Finding

The toilet paper dispenser is located above the provided grab bar.

On-Site Finding Above Grab Bar

Recommendation

Remount the dispenser below the grab bar at 19" minimum.

Recommendation Relocate Dispenser

Code Reference ADA 603, CA 11B-604.7

Record Number 65181

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Toilet Compartment

Womens Locker Room Restroom

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Code Reference ADA 603, 609.3, CA 11B-309.4, 609.3

Record Number 65180

Restrooms - Patrol : Restroom , Toilet

Womens Locker Room Restroom

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 27.25 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 65175

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Urinal

Mens Locker Room Restroom

Finding

The width between urinal shields in the restroom is less than required.

On-Site Finding 28.87 inches

Recommendation

Modify or replace the urinal shields in the restroom to provide the required shield-width clearance.

Recommendation At least 30.00 inches

Code Reference ADA 305.3, 605, 605.3

Record Number 65212

Restrooms - Patrol : Restroom , Urinal

Mens Locker Room Restroom

Finding

There is less than the required clear floor space provided in front of the urinal in the restroom to allow an accessible forward approach.

On-Site Finding 28.87 inches

Recommendation

Provide the required minimum clear floor space in front of the urinal designated to be accessible in the restroom, for a forward approach.

Recommendation At least 30.00 inches

Code Reference ADA 305.3, 605, 605.3, CA 11B-305.3, 605.3

Record Number 65211

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Mirror

Mens Locker Room Restroom

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 41.62 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 40.00 inches

Code Reference ADA 213, 603, 603.3, CA 11B-603.3

Record Number 65210

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 65209

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

The height of the counter surface is greater than allowed.

On-Site Finding 35.00 inches

Recommendation

Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.

Recommendation Up to 34.00 inches

Code Reference ADA 213, 606, 606.3, CA 11B-213, 606.3

Record Number 65203

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 26.12 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Record Number 65205

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 26.12 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Record Number 65204

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 28.50 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 30.00 inches

Code Reference ADA 213, 305.3, 606, 606.2, CA 11B-305, 606.2

Record Number 65206

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 40.87 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 48.00 inches

Code Reference ADA 213, 305.3, 606, 606.2, CA 11B-305, 606.2

Record Number 65207

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 65208

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Lavatory

Mens Locker Room Restroom

Lavatory

Finding

The lavatory is in an enclosed cabinet, thereby preventing an accessible forward approach.

On-Site Finding Not Accessible

Recommendation

Lavatories in restrooms must provide clear floor space in front of the lavatory for an accessible forward approach and shall provide the minimum required primary age group knee and toe clearances. If sufficient clear floor space and compliant clearances can not be provided, remove the lavatory cabinet and replace with an accessible wall-mounted lavatory unit.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.2, CA 11B-305, 306, 606.2

Record Number 65202

Restrooms - Patrol : Restroom , Wall Signage

Mens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65217

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Wall Signage

Mens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65218

Restrooms - Patrol : Restroom , Door Signage

Mens Locker Room Restroom

Male

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 65213

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Door Signage

Mens Locker Room Restroom

Male

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 65.37 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 65214

Restrooms - Patrol : Restroom , Door Signage

Mens Locker Room Restroom

Male

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 60.62 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 65215

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Wall Signage

Mens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65219

Restrooms - Patrol : Restroom , Wall Signage

Mens Locker Room Restroom

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 65220

Police Department-Office-3 Coaches

Restrooms - Patrol : Restroom , Door Signage

Mens Locker Room Restroom

Male

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 66.25 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 65216

Restrooms - Patrol : Restroom , Dispensers

Mens Locker Room Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 47.25 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 65201

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom

Unisex Restroom in Wellness Center

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Code Reference ADA 213, 213.2.1, CA 11B-213.2.1

Record Number 64283

Restrooms - Wellness Center : Restroom

Unisex Restroom in Wellness Center

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding None Found

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 304, 309, 309.4, 404.2.7, 603, CA 11B-309.4, 404.2.7

Record Number 64284

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Mirror

Unisex Restroom in Wellness Center

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 46.50 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 40.00 inches

Code Reference ADA 213, 603, 603.3, CA 11B-603.3

Record Number 64291

Restrooms - Wellness Center : Restroom , Lavatory

Unisex Restroom in Wellness Center

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 26.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Code Reference ADA 213, 306.3.1, 606, 606.2, CA 11B-306.3.1, 606.2

Notes : Control Type is Push/Twist

Record Number 64287

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Lavatory

Unisex Restroom in Wellness Center

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Control Type is Push/Twist

Record Number 64290

Restrooms - Wellness Center : Restroom , Lavatory

Unisex Restroom in Wellness Center

Lavatory

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 14.62 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Notes : Control Type is Push/Twist

Record Number 64288

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Lavatory

Unisex Restroom in Wellness Center

Lavatory

Finding

The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.

On-Site Finding Not Accessible

Recommendation

Install accessible faucet controls. Lever-operated, push-type, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.

Recommendation See Recommendation

Code Reference ADA 213, 309.4, 606, CA 11B-213, 309.4, 606

Notes : Control Type is Push/Twist

Record Number 64286

Restrooms - Wellness Center : Restroom , Lavatory

Unisex Restroom in Wellness Center

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Control Type is Push/Twist

Record Number 64289

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Wall Signage

Unisex Restroom in Wellness Center

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 64293

Restrooms - Wellness Center : Restroom , Door Signage

Unisex Restroom in Wellness Center

Unisex

Finding

There is no gender use signage on the entrance door.

On-Site Finding None Found

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation See Recommendation

Code Reference CA 11B-216.8, 703.7.2.6

Record Number 64292

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Dispensers

Unisex Restroom in Wellness Center

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 50.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 64285

Restrooms - Wellness Center : Restroom , Toilet Compartment

Unisex Restroom in Wellness Center

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 53.75 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 64302

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom

Unisex Restroom in Wellness Center

Finding

Seat cover dispenser interferes with use of grab bar.

On-Site Finding Interferes

Recommendation

Move the seat cover dispenser so it does not interfere with the use of the grab bars.

Recommendation See Recommendation

Code Reference ADA 609.3

Record Number 64303

Restrooms - Wellness Center : Restroom , Grab Bar

Unisex Restroom in Wellness Center

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 64312

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Grab Bars

Unisex Restroom in Wellness Center

Finding

The height of the side grab bar is not at the correct height.

On-Site Finding 32.62 inches

Recommendation

Remount the grab bar so it is at the correct height.

Recommendation 33.00 - 36.00 inches

Code Reference ADA 603, 609, 609.4, CA 11B-604.5, 609.4

Record Number 64310

Restrooms - Wellness Center : Restroom , Grab Bars

Unisex Restroom in Wellness Center

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 49.62 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Code Reference ADA 603, 604.5.1, 609, CA 11B-604.5.1, 609

Record Number 64308

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Grab Bars

Unisex Restroom in Wellness Center

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 19.37 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 64309

Restrooms - Wellness Center : Restroom

Unisex Restroom in Wellness Center

Finding

Rear grab bar interferes with the tank/flushometer.

On-Site Finding Not Compliant

Recommendation

Readjust the rear grab bar so that it does not interfere with the tank/flushometer.

Recommendation See Recommendation

Code Reference ADA 609.3, CA 11B-609.3

Record Number 64311

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom

Unisex Restroom in Wellness Center

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 32.50 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 33.00 - 36.00 inches

Code Reference ADA 603, 609.4, CA 11B-609.4

Record Number 64313

Restrooms - Wellness Center : Restroom , Toilet

Unisex Restroom in Wellness Center

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 64306

Police Department-Office-3 Coaches

Restrooms - Wellness Center : Restroom , Toilet

Unisex Restroom in Wellness Center

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 19.25 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 64304

Restrooms - Wellness Center : Restroom , Toilet

Unisex Restroom in Wellness Center

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 21.12 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 64307

Police Department-Office-3 Coaches

Emergency Warning Systems - Patrol : Emergency Warning Systems

Visual Alarms

Finding

There are some visual warning devices, though visual warning devices are not located throughout the facility.

On-Site Finding Some Found

Recommendation

Install visual warning devices integrated with the facility's alarm system in all common areas such as hallways, classrooms and general use rooms, accessible restrooms and other accessible rooms.

Recommendation See Recommendation

Code Reference ADA 215, 702, CA 11B-215, 702

Notes : No Visual Alarms in Administration Building Restrooms, No Visual Alarm in Interview Room.

Record Number 65191

Break/Conference Room - Administration : Break Room , Sink

Break Area Next to Reception

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 64162

Police Department-Office-3 Coaches

Break/Conference Room - Administration : Break Room

Break Area Next to Reception

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.00 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 64158

Break/Conference Room - Administration : Break Room

Break Area Next to Reception

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 64160

Police Department-Office-3 Coaches

Break/Conference Room - Administration : Break Room

Break Area Next to Reception

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 64159

Break/Conference Room - Administration : Break Room , Sink

Break Area Next to Reception

Finding

There is not enough clear floor space at the sink.

On-Site Finding 26.00 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 30.00 inches

Code Reference ADA 205, 228, 308, 309

Record Number 64161

Police Department-Office-3 Coaches

Break/Conference Room - Administration : Break Room

Break Area Next to Reception

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 54.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 64163

Break/Conference Room - Administration : Break Room

Break Area Next to Reception

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 41.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 64164

Police Department-Office-3 Coaches

Break/Conference Room - Patrol : Break Room

Interview Room

Finding

The table knee depth does not meet required standards.

On-Site Finding 13.50 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Code Reference ADA 205, 228, 306.3.3, 308, 309, CA 11B-306.3.2, 306.3.3, 902.2

Record Number 65077

Break/Conference Room - Wellness Center : Break Room , Sink

Wellness Center Break Room

Finding

There is not enough clear floor space at the sink.

On-Site Finding 27.00 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 30.00 inches

Code Reference ADA 205, 228, 308, 309

Record Number 64329

Police Department-Office-3 Coaches

Break/Conference Room - Wellness Center : Break Room

Wellness Center Break Room

Finding

Sink counter height does not meet the standards.

On-Site Finding 34.50 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 64328

Break/Conference Room - Wellness Center : Break Room , Sink

Wellness Center Break Room

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Code Reference ADA 606.5, CA 11B-606.5

Record Number 64330

Police Department-Office-3 Coaches

Lockers - Administration : Lockers

Unisex Restroom in Office Next to Police Chief

Finding

No accessible lockers were found.

On-Site Finding Not Available

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Code Reference ADA 225.2.1 , 811, CA 11B-225.2.1, 811

Record Number 64295

Accessible Showers - Patrol : Accessible Shower

Mens Locker Room Restroom

Finding

There are not enough accessible showers with respect to the total number of showers available.

On-Site Finding None Found

Recommendation

Provide the required amount of compliant accessible showers.

Recommendation At least 1.00 showers

Code Reference ADA 213, 213.3.6, 608, CA 11B-213.3.6

Record Number 65073

Police Department-Office-3 Coaches

Accessible Showers - Patrol : Accessible Shower

Womens Locker Room Restroom

Finding

There are not enough accessible showers with respect to the total number of showers available.

On-Site Finding None Found

Recommendation

Provide the required amount of compliant accessible showers.

Recommendation At least 1.00 showers

Code Reference ADA 213, 213.3.6, 608, CA 11B-213.3.6

Record Number 65226

Reach Ranges - Administration : Reach Range , Side Approach

Administration Building

Emergency Call Station

Finding

Element reach depth is not compliant.

On-Site Finding 44.50 inches

Recommendation

Make sure that the element is within allowed reach range with recommended reach depth.

Recommendation Up to 24.00 inches

Code Reference ADA 308

Notes : Element Protrudes 7.5" Into the Path of Travel.

Record Number 65070

Police Department-Office-3 Coaches

Reach Ranges - Administration : Reach Range , Element Highest Point of Operation

**Administration Building
Emergency Call Station**

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 0.00 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 15.00 - 48.00 inches

Code Reference ADA 308, 309, CA 11B-308, 309

Notes : Element Protrudes 7.5" Into the Path of Travel.

Record Number 65072

Reach Ranges - Administration : Reach Range

**Administration Building
Emergency Call Station**

Finding

This element is a protruding object.

On-Site Finding None Found

Recommendation

Make sure that the element is not a protruding object.

Recommendation See Recommendation

Code Reference ADA 204, 304, 307

Notes : Element Protrudes 7.5" Into the Path of Travel.

Record Number 65071

Accessibility Survey



Rail Spur Trail

Rail Spur Trail
East Palo Alto, CA 94303

Date of Inspection

11/9/2017

Prepared By

Disability Access Consultants

Rail Spur Trail

Path of Travel - Exterior : Path Of Travel , Drop Offs

**Path of Travel from Bay Road South Side Trail Head to Pulgas Avenue
West Side Trail Head**

Drop Off

Finding

There is no edge protection at the drop off.

On-Site Finding Not Accessible

Recommendation

Install edge protection on the walking surface at the required minimum height.

Recommendation See Recommendation

Code Reference ADA 303.5, CA 11B-303.5

Record Number 87339

Path of Travel - Exterior : Path Of Travel , Drop Offs

**Path of Travel from Bay Road South Side Trail Head to Pulgas Avenue
West Side Trail Head**

Drop Off

Finding

There is no edge protection at the drop off.

On-Site Finding Not Accessible

Recommendation

Install edge protection on the walking surface at the required minimum height.

Recommendation See Recommendation

Code Reference ADA 303.5, CA 11B-303.5

Record Number 87340

Rail Spur Trail

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

**Path of Travel from Bay Road South Side Trail Head to Pulgas Avenue
West Side Trail Head**

Tree Limb

Finding

The vertical clearance height is less than required.

On-Site Finding 36.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 87341

Path of Travel - Exterior : Path Of Travel , Vertical Hazards

**Path of Travel from Bay Road South Side Trail Head to Pulgas Avenue
West Side Trail Head**

Tree Limb

Finding

The vertical clearance height is less than required.

On-Site Finding 77.00 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 87342

Rail Spur Trail

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Bay Road South Side Trail Head to Pulgas Avenue West Side Trail Head

Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 5.90 percent for 20.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 87338

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from Public Right of Way at North Side of Bay Road

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 87344

Rail Spur Trail

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from Public Right of Way at North Side of Bay Road Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 87345

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Pulgas Avenue Crossing Crosswalk

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Code Reference ADA 705, CA 11B-247.1.2.5, 705.1.2.5

Record Number 87347

Rail Spur Trail

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Pulgas Avenue Crossing

Curb

Finding

There is a curb on the designated path of travel.

On-Site Finding Curb Found

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Code Reference ADA 206, 302, 303, 303.4, 402, 403.4, 406

Record Number 87346

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from Public Right of Way at East Side of Pulgas Avenue

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 87352

Rail Spur Trail

Signage - Exterior : Signage , Signage

Directional Signage to Crosswalk

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Code Reference ADA 216, 216.3 , 703, 703.5, CA 11B-216.3, 703.5

Record Number 87343

Trails - Exterior : Trails , Signage

Rail Spur Trail

Bay Road South Side Trail Head - Trail Head - Directional/Location

Finding

Trail signage does not indicate length of trail.

On-Site Finding See Above

Recommendation

Provide compliant signage for the trail that includes length of trail.

Recommendation See Recommendation

Code Reference ADA 1017.11, F247.4.1

Record Number 87348

Rail Spur Trail

Trails - Exterior : Trails , Signage

Rail Spur Trail

Bay Road North Side Trail Head - Trail Head - Directional/Location

Finding

There is no compliant signage.

On-Site Finding See Above

Recommendation

Provide compliant signage with characters and numbers that are properly sized for viewing distance.

Recommendation See Recommendation

Code Reference ADA 1017.11, F247.4.1

Record Number 87349

Trails - Exterior : Trails , Signage

Rail Spur Trail

Pulgas Avenue West Side Trail Head - Trail Head - Directional/Location

Finding

There is no compliant signage.

On-Site Finding See Above

Recommendation

Provide compliant signage with characters and numbers that are properly sized for viewing distance.

Recommendation See Recommendation

Code Reference ADA 1017.11, F247.4.1

Record Number 87350

Rail Spur Trail

Trails - Exterior : Trails , Signage

Rail Spur Trail

Pulgas Avenue West Side Trail Head - Trail Head - Directional/Location

Finding

Trail signage does not indicate length of trail.

On-Site Finding See Above

Recommendation

Provide compliant signage for the trail that includes length of trail.

Recommendation See Recommendation

Code Reference ADA 1017.11, F247.4.1

Record Number 87351

Senior Center

Accessibility Survey



Senior Center

560 Bell Street
East Palo Alto, CA 94303

Date of Inspection

10/30/2017

Prepared By

Disability Access Consultants

Senior Center

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

Warning Sign

Finding

There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.

On-Site Finding Not Found

Recommendation

Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at _____ or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.

Recommendation See Recommendation

Code Reference CA 11B-502.8

Record Number 81851

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

There is an accessible parking space designated in the parking lot. There is no access aisle located at the parking space.

On-Site Finding No Access Aisle

Recommendation

Provide a compliant access aisle at the parking space. Parking spaces shall each provide an access aisle that may be shared.

Recommendation See Recommendation

Code Reference ADA 502, 502.3, 502.3.4, CA 11B-502.2

Record Number 81824

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.

On-Site Finding See Above

Recommendation

Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.

Recommendation See Recommendation

Code Reference ADA 502.3, CA 11B-502.7.1

Record Number 81825

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.90 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 81823

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 204.75 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 81826

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

1st Accessible Space from Left

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 81822

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

1st Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 81827

Senior Center

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

4th Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 81831

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

4th Accessible Space from Left

Finding

The hatched lines are striped greater than 36" on center or are not painted a contrasting color.

On-Site Finding Not on 36" center

Recommendation

Re-stripe the hatched lines in a contrasting color up to 36" on center.

Recommendation See Recommendation

Code Reference CA 11B-502.3.3

Record Number 81835

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

4th Accessible Space from Left

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 205.25 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 81830

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

4th Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 81828

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

4th Accessible Space from Left

Finding

The access aisle exceeds maximum slope.

On-Site Finding 2.60 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 81834

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

4th Accessible Space from Left

Finding

The access aisle does not meet the minimum required width.

On-Site Finding 92.00 inches

Recommendation

Re-stripe the access aisle to meet the minimum required width and length for the space type.

Recommendation At least 96.00 inches

Code Reference CA 11B-502.2

Record Number 81832

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

4th Accessible Space from Left

Finding

The path of travel from the accessible parking space is not on the primary route used by the general public and does not lead to the primary entrance of the facility from the parking lot.

On-Site Finding None Found

Recommendation

Remove and relocate the designated accessible parking spaces. Accessible paved parking spaces shall be located on the shortest accessible route of travel to the facility for which it serves and shall coincide with the primary route and primary entrances used by the general public.

Recommendation See Recommendation

Code Reference ADA 208, 208.3, 502

Record Number 81829

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

5rth Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 81837

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

5rth Accessible Space from Left

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 205.50 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 81838

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

5rth Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 81839

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

5rth Accessible Space from Left

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 81836

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

2nd Accessible Space from Left

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Code Reference ADA 502, 502.2, CA 11B-502.2

Record Number 81840

Senior Center

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

2nd Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 81845

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

2nd Accessible Space from Left

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 204.50 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 81844

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

2nd Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 81841

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

2nd Accessible Space from Left

Finding

There is an accessible parking space designated in the parking lot. There is no access aisle located at the parking space.

On-Site Finding No Access Aisle

Recommendation

Provide a compliant access aisle at the parking space. Parking spaces shall each provide an access aisle that may be shared.

Recommendation See Recommendation

Code Reference ADA 502, 502.3, 502.3.4, CA 11B-502.2

Record Number 81842

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

2nd Accessible Space from Left

Finding

The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.

On-Site Finding See Above

Recommendation

Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.

Recommendation See Recommendation

Code Reference ADA 502.3, CA 11B-502.7.1

Record Number 81843

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

Parking space has signage however sign is faded, damaged or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Replace or repaint the sign.

Recommendation See Recommendation

Code Reference ADA 502.6

Record Number 81850

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

There is an accessible parking space designated in the parking lot. There is no access aisle located at the parking space.

On-Site Finding No Access Aisle

Recommendation

Provide a compliant access aisle at the parking space. Parking spaces shall each provide an access aisle that may be shared.

Recommendation See Recommendation

Code Reference ADA 502, 502.3, 502.3.4, CA 11B-502.2

Record Number 81847

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Code Reference ADA 502, 502.4, CA 11B-502.4

Record Number 81846

Senior Center

Parking - Exterior : Parking Lot , Parking Space

Parking Lot

3rd Accessible Space from Left

Finding

The accessible parking space provided in the parking lot does not meet the minimum requirement for length.

On-Site Finding 205.50 inches

Recommendation

Re-stripe the accessible parking space.

Recommendation At least 216.00 inches

Code Reference CA 11B-502.2

Record Number 81848

Parking - Exterior : Parking Lot , Warning Signage

Parking Lot

3rd Accessible Space from Left

Finding

There is no \$250.00 fine sign at the parking space.

On-Site Finding Not Found

Recommendation

Provide a \$250.00 fine sign at the parking space below the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference CA 11B-502.6.2

Record Number 81849

Senior Center

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to Accessible Parking

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Code Reference ADA 406, 406.5

Record Number 82184

Curb Ramps - Exterior : Curb Ramp

Curb Ramp Next to Accessible Parking

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Code Reference CA 11B-406.5.12, CA MUTCD

Record Number 82183

Senior Center

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp Next to Accessible Parking

Bottom Landing

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 3.80 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, 406.1, 406.2, 406.4, CA 11B-406.3.2

Record Number 82185

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Curb Ramp Next to Accessible Parking

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope.
Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Code Reference ADA 402.2, 406.4, CA 11B-406.5.3

Record Number 82186

Senior Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bell Street
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 81786

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bell Street
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 81787

Senior Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bell Street
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 6.70 percent for 25.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 81784

Path of Travel - Exterior : Path Of Travel

**Path of Travel from the Public Right of Way at Bell Street
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 81785

Senior Center

Path of Travel - Exterior : Path Of Travel

**Path of Travel from 111B Exterior Entrance
Exterior Walkway**

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Code Reference ADA 302.3

Record Number 85558

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Parking Lot to South Side of Building
Exterior Walkway**

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.50 percent for 12.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 85559

Senior Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Parking Lot to South Side of Building
Exterior Walkway**

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 3.30 percent for 12.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Code Reference ADA 402, 403.3, CA 11B-403.3

Record Number 85560

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Parking Lot to South Side of Building
Change in Level**

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Code Reference ADA 303, 403.4, CA 11B-303, 403.4

Record Number 85562

Senior Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from Parking Lot to South Side of Building
Exterior Walkway**

Finding

The width of the path of travel is insufficient.

On-Site Finding 46.00 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Code Reference ADA 403.5.1, CA 11B-403.5.1

Record Number 85561

Path of Travel - Senior Center : Path Of Travel , Vertical Hazards

Kitchen

Exhaust Hood

Finding

The vertical clearance height is less than required.

On-Site Finding 77.75 inches

Recommendation

Provide recommended vertical clearance.

Recommendation At least 80.00 inches

Code Reference ADA 307, 307.4, CA 11B-307.4

Record Number 82194

Senior Center

Path of Travel - Senior Center : Path Of Travel , Walking Surfaces

Kitchen

Interior Aisle Serving One Side

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.40 percent for 5.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Code Reference ADA 402, 403.3, CA 11B-402, 403.3

Record Number 82193

Ramps - Senior Center : Ramp , Ramp Run

Ramp to the Multipurpose Room Stage

Run 1

Finding

The width of the ramp is less than required.

On-Site Finding 46.50 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Record Number 82221

Senior Center

Ramps - Senior Center : Ramp , Handrail

Ramp to the Multipurpose Room Stage

Run 1

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 82222

Ramps - Senior Center : Ramp , Landing

Ramp to the Multipurpose Room Stage

Run 1 Intermediate Landing

Finding

The ramp changes direction at this landing. The length of the landing is less than the required minimum length.

On-Site Finding 69.50 inches

Recommendation

Modify or replace the landing to meet the minimum required width and length.

Recommendation At least 72.00 inches

Code Reference ADA 405.7, 405.7.4

Record Number 82223

Senior Center

Ramps - Senior Center : Ramp , Handrail

Ramp to the Multipurpose Room Stage

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 82224

Ramps - Senior Center : Ramp , Handrail

Ramp to the Multipurpose Room Stage

Run 1 Right Handrail

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 33.75 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Code Reference ADA 405, 405.8, 505.4, CA 11B-405.8, 505.4

Record Number 82225

Senior Center

Ramps - Senior Center : Ramp , Handrail

Ramp to the Multipurpose Room Stage

Run 2

Finding

There is only one handrail provided.

On-Site Finding Missing Handrail

Recommendation

Provide compliant handrails on each side.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.2, CA 11B-405.8, 505.2

Record Number 82227

Ramps - Senior Center : Ramp , Ramp Run

Ramp to the Multipurpose Room Stage

Run 2

Finding

The width of the ramp is less than required.

On-Site Finding 45.00 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Code Reference ADA 405, 405.5, CA 11B-405.5

Record Number 82226

Senior Center

Ramps - Senior Center : Ramp , Handrail

Ramp to the Multipurpose Room Stage

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, 505.10.1

Record Number 82228

Doors - Exterior : Door , Hardware

Mens Restroom Next to Multipurpose Room

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 14.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 81796

Senior Center

Doors - Senior Center : Door

Multipurpose Room

Finding

The clear opening width of the door is less than required.

On-Site Finding 28.87 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Code Reference ADA 404, 404.2.3, CA 11B-404.2.3

Record Number 81751

Doors - Senior Center : Door , Hardware

Multipurpose Room

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 81752

Senior Center

Doors - Senior Center : Door , Clear Floor Space

West Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.80 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 81754

Doors - Senior Center : Door , Hardware

West Entrance

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 81753

Senior Center

Doors - Senior Center : Door , Hardware

**Multipurpose Room Exterior Entramce Next to Stage
Push Bar Only**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 81779

Doors - Senior Center : Door , Hardware

**Multipurpose Room Exterior Entramce Next to Stage
Push Bar Only**

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7, CA 11B-404.2.7

Record Number 81778

Senior Center

Doors - Senior Center : Door , Threshold

Multipurpose Room Exterior Entramce Next to Stage

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 81780

Doors - Senior Center : Door , Hardware

Womens Restroom Next to Multipurpose Rom

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 81781

Senior Center

Doors - Senior Center : Door

**Womens Restroom Next to Multipurpose Rom
Push / Pull**

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 81782

Doors - Senior Center : Door , Latch Side Clearance

111B Exterior Entrance

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 10.75 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 81799

Senior Center

Doors - Senior Center : Door , Latch Side Clearance

111B Exterior Entrance

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 21.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 81800

Doors - Senior Center : Door , Clear Floor Space

111B Exterior Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 7.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 81801

Senior Center

Doors - Senior Center : Door , Hardware

111B Exterior Entrance

Push Bar / D Handle

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 6.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 81797

Doors - Senior Center : Door , Threshold

111B Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 81798

Senior Center

Doors - Senior Center : Door

Administration & Conference Room Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Code Reference ADA 404, 404.2.10, CA 11B-404.2.10

Record Number 81802

Doors - Senior Center : Door , Latch Side Clearance

Reception

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 7.62 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Record Number 81852

Senior Center

Doors - Senior Center : Door , Clear Floor Space

**Multipurpose Room Exterior Entramce Next to 111A
Pull Side**

Finding

There is no level landing at this door.

On-Site Finding 4.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 81857

Doors - Senior Center : Door , Threshold

Multipurpose Room Exterior Entramce Next to 111A

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 81856

Senior Center

Doors - Senior Center : Door , Hardware

**Multipurpose Room Exterior Entramce Next to 111A
Push Bar Only**

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 13.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 81855

Doors - Senior Center : Door , Hardware

**Multipurpose Room Exterior Entramce Next to 111A
Push Bar Only**

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7, CA 11B-404.2.7

Record Number 81854

Senior Center

Doors - Senior Center : Door , Clear Floor Space

Computer Room Next to Conference Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 50.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 82198

Doors - Senior Center : Door , Latch Side Clearance

Computer Room Next to Conference Room

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 13.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 82197

Senior Center

Doors - Senior Center : Door , Hardware

**Computer Room Next to Conference Room
Lever**

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Record Number 82196

Doors - Senior Center : Door , Latch Side Clearance

**Kitchen
Push Side**

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 5.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Code Reference ADA 404, 404.2.4, 404.2.4.1, CA 11B-404.2.4.1

Record Number 82203

Senior Center

Doors - Senior Center : Door , Hardware

Kitchen

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 15.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 82200

Doors - Senior Center : Door , Hardware

Kitchen

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Record Number 82201

Senior Center

Doors - Senior Center : Door , Threshold

Kitchen

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 82202

Doors - Senior Center : Door , Clear Floor Space

Computer Room

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 21.37 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Shelves Obstructs Clear Floor Space Length.

Record Number 82205

Senior Center

Doors - Senior Center : Door , Latch Side Clearance

Computer Room

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 12.25 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 82204

Doors - Senior Center : Door , Clear Floor Space

Computer Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 43.25 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4

Notes : Furniture Obstructs Clear Floor Space Length & Latch Side Clearance.

Record Number 82206

Senior Center

Doors - Senior Center : Door , Hardware

Multipurpose Room Stage Sound Room

Single Knob

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7, CA 11B-404.2.7

Record Number 82207

Doors - Senior Center : Door , Latch Side Clearance

Kitchen Pamtry

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 14.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Desk Obstructs Latch Side Clearance.

Record Number 82215

Senior Center

Doors - Senior Center : Door , Clear Floor Space

Kitchen Exterior Entrance

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 39.75 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Cabinet Obstructs Clear Floor Space Length.

Record Number 82219

Doors - Senior Center : Door , Clear Floor Space

Kitchen Exterior Entrance

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 6.70 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Code Reference ADA 302, 305, 404, 404.2.4.4, CA 11B-404.2.4.4

Record Number 82220

Senior Center

Doors - Senior Center : Door , Hardware

Kitchen Exterior Entrance

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Code Reference ADA 309.4, 404.2.7

Record Number 82217

Doors - Senior Center : Door , Hardware

Kitchen Exterior Entrance

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Code Reference ADA 404.2.9, CA 11B-404.2.9

Record Number 82216

Senior Center

Doors - Senior Center : Door , Threshold

Kitchen Exterior Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Record Number 82218

Counters - Senior Center : Counter

Reception Counter

Finding

The counter is a protruding object.

On-Site Finding See Above

Recommendation

Adjust the counter so that it is no longer a protruding object.

Recommendation See Recommendation

Code Reference ADA 307.2, 902

Notes : Counter Protrudes 8" Into the Path of Travel.

Record Number 81773

Senior Center

Signage - Senior Center : Signage

111A, 111B

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 81750

Signage - Senior Center : Signage , Signage

Multipurpose Room

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 81766

Senior Center

Signage - Senior Center : Signage

Reception

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 81774

Signage - Senior Center : Signage

Multipurpose Exterior Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 81783

Senior Center

Signage - Senior Center : Signage , Signage

111B Exterior Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 81803

Signage - Senior Center : Signage , Signage

Main Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 81806

Senior Center

Signage - Senior Center : Signage

Administration & Conference Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 81821

Signage - Senior Center : Signage , Signage

West Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 81853

Senior Center

Signage - Senior Center : Signage

Kitchen

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 82187

Signage - Senior Center : Signage

Multipurpose Room Stage Sound Room

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 82195

Senior Center

Signage - Senior Center : Signage

Computer Room, Conference Room, Directors Office

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 82199

Signage - Senior Center : Signage

Kitchen Pamtry

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Code Reference ADA 216, 216.2, 703, CA 11B-216.2

Record Number 82208

Senior Center

Signage - Senior Center : Signage , Signage

Kitchen Exterior Entrance

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Code Reference ADA 216.2, 216.6 , CA 11B-216.2, 216.6

Record Number 82209

Restrooms - Senior Center : Restroom , Toilet Compartment

Mens Restroom Next to Multipurpose Room

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 41.00 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 81755

Senior Center

Restrooms - Senior Center : Restroom , Compartment Door

Mens Restroom Next to Multipurpose Room

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 81764

Restrooms - Senior Center : Restroom

Mens Restroom Next to Multipurpose Room

Finding

The inside handle is not located near the latch.

On-Site Finding None Found

Recommendation

Adjust the inside handle so that it is located near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 81765

Senior Center

Restrooms - Senior Center : Restroom , Compartment Door

Mens Restroom Next to Multipurpose Room

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Code Reference ADA 304.4, 603, 604.8, CA 11B-604.8.1

Record Number 81763

Restrooms - Senior Center : Restroom , Compartment Door

Mens Restroom Next to Multipurpose Room

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 81762

Senior Center

Restrooms - Senior Center : Restroom , Grab Bar

Mens Restroom Next to Multipurpose Room

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 81761

Restrooms - Senior Center : Restroom , Grab Bars

Mens Restroom Next to Multipurpose Room

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 23.50 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 81760

Senior Center

Restrooms - Senior Center : Restroom , Toilet

Mens Restroom Next to Multipurpose Room

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.

Recommendation See Recommendation

Code Reference ADA 603, 604.6, CA 11B-604.6

Record Number 81758

Restrooms - Senior Center : Restroom , Toilet

Mens Restroom Next to Multipurpose Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 41.50 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 81759

Senior Center

Restrooms - Senior Center : Restroom , Toilet

Mens Restroom Next to Multipurpose Room

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 19.00 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 81756

Restrooms - Senior Center : Restroom , Toilet Compartment

Womens Restroom Next to Multipurpose Room- Standard Compartment

Finding

The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.

On-Site Finding 42.00 inches

Recommendation

Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.2, 309, 606, CA 11B-603.5

Record Number 81767

Senior Center

Restrooms - Senior Center : Restroom , Compartment Door

Womens Restroom Next to Multipurpose Room- Standard Compartment

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 81771

Restrooms - Senior Center : Restroom , Compartment Door

Womens Restroom Next to Multipurpose Room- Standard Compartment

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 81770

Senior Center

Restrooms - Senior Center : Restroom , Grab Bar

Womens Restroom Next to Multipurpose Room- Standard Compartment

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Code Reference ADA 604.5.2, CA 11B-604.5.2

Record Number 81769

Restrooms - Senior Center : Restroom , Toilet Compartment

Womens Restroom Next to Multipurpose Room- Standard Compartment

Finding

The toilet paper dispenser is not mounted at the required height.

On-Site Finding 18.00 inches

Recommendation

Remount the toilet paper dispenser in the compartment to the required height.

Recommendation At least 19.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 81772

Senior Center

Restrooms - Senior Center : Restroom , Lavatory

**Mens Restroom Next to Multipurpose Room
Lavatory**

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 28.50 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 30.00 inches

Code Reference ADA 213, 305.3, 606, 606.2, CA 11B-305, 606.2

Record Number 81791

Restrooms - Senior Center : Restroom , Lavatory

**Mens Restroom Next to Multipurpose Room
Lavatory**

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 13.50 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on
center

Code Reference CA 11B-606.6

Record Number 81790

Senior Center

Restrooms - Senior Center : Restroom , Lavatory

**Mens Restroom Next to Multipurpose Room
Lavatory**

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 28.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Record Number 81789

Restrooms - Senior Center : Restroom , Lavatory

**Mens Restroom Next to Multipurpose Room
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Record Number 81792

Senior Center

Restrooms - Senior Center : Restroom , Wall Signage

Mens Restroom Next to Multipurpose Room

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Code Reference ADA 216, 216.8, 703, CA 11B-216.8

Record Number 81795

Restrooms - Senior Center : Restroom , Door Signage

Mens Restroom Next to Multipurpose Room

Male

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 65.50 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 81794

Senior Center

Restrooms - Senior Center : Restroom , Dispensers

Mens Restroom Next to Multipurpose Room

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 41.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 81788

Restrooms - Senior Center : Restroom , Grab Bars

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

There is no back grab bar at the toilet compartment.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Code Reference ADA 603, 604.5, 604.8.1.5, CA 11B-604.5, 604.8.1.5

Record Number 81808

Senior Center

Restrooms - Senior Center : Restroom , Toilet Compartment

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 37.00 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 60.00 inches

Code Reference ADA 213, 603, 604, 604.8.1.1, CA 11B-604.8.1.1

Record Number 81807

Restrooms - Senior Center : Restroom , Compartment Door

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Code Reference ADA 309.4, 404, 404.2.7, 604.8, CA 11B-404.2.7, 604.8.1.2

Record Number 81818

Senior Center

Restrooms - Senior Center : Restroom , Compartment Door

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Code Reference ADA 404, 604.8, 604.8.1.2, CA 11B-604.8.1.2

Record Number 81817

Restrooms - Senior Center : Restroom

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The inside handle is not located near the latch.

On-Site Finding None Found

Recommendation

Adjust the inside handle so that it is located near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 81819

Senior Center

Restrooms - Senior Center : Restroom , Compartment Door

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Code Reference ADA 213, 404, 604, 604.8, 604.8.1.2, CA 11B-404.2.7, 604.8.1.2

Record Number 81815

Restrooms - Senior Center : Restroom

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Code Reference ADA 604.8.1.2, CA 11B-604.8.1.2

Record Number 81816

Senior Center

Restrooms - Senior Center : Restroom , Grab Bars

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The distance between the wall and the gripping surface of the grab bar does not meet requirements.

On-Site Finding 15.00 inches

Recommendation

Remount the grab bar so the space between the wall and gripping surface meets requirements. Grab bars must be able to support a point load of at least 250 pounds and shall be less than the allowable shear stress of the grab bar material.

Recommendation 1.50 inches

Code Reference ADA 505, 604.9.3, 609.3, CA 11B-604.5, 609.3

Record Number 81814

Restrooms - Senior Center : Restroom , Grab Bars

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 23.75 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Code Reference CA 11B-604.5.1

Record Number 81813

Senior Center

Restrooms - Senior Center : Restroom , Toilet Compartment

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 3.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Code Reference ADA 603, 604.7, CA 11B-309.4, 604.7

Record Number 81820

Restrooms - Senior Center : Restroom , Toilet

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 15.75 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 17.00 - 18.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 81809

Senior Center

Restrooms - Senior Center : Restroom , Toilet

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 21.25 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Code Reference ADA 603, 604.2, CA 11B-604.2

Record Number 81811

Restrooms - Senior Center : Restroom , Toilet

Womens Restroom Next to Multipurpose Room - Alternate Compartment

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 28.87 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 48.00 inches

Code Reference ADA 603, CA 11B-604.8.1

Record Number 81812

Senior Center

Restrooms - Senior Center : Restroom

Womens Restroom Next to Multipurpose Room

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 56.75 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Code Reference ADA 304, 304.3, 304.3.1, 603, 603.2.1, CA 11B-304.3

Notes : Wakk Mounted Waste Receptacle Obstructs Turning Space Diameter.

Record Number 81858

Restrooms - Senior Center : Restroom , Lavatory

Womens Restroom Next to Multipurpose Room

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Pipes Not Completely Wrapped.

Record Number 81863

Senior Center

Restrooms - Senior Center : Restroom , Lavatory

**Womens Restroom Next to Multipurpose Room
Lavatory**

Finding

The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.

On-Site Finding 14.50 inches on center

Recommendation

Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.

Recommendation At least 18.00 inches on center

Code Reference CA 11B-606.6

Notes : Pipes Not Completely Wrapped.

Record Number 81862

Restrooms - Senior Center : Restroom , Lavatory

**Womens Restroom Next to Multipurpose Room
Lavatory**

Finding

The apron height under the lavatory is less than the required minimum height.

On-Site Finding 27.75 inches

Recommendation

Raise or replace the lavatory to provide the minimum required apron height.

Recommendation At least 29.00 inches

Code Reference ADA 213, 306.3, 606, CA 11B-306.3.3, 606.2

Notes : Pipes Not Completely Wrapped.

Record Number 81861

Senior Center

Restrooms - Senior Center : Restroom , Lavatory

**Womens Restroom Next to Multipurpose Room
Lavatory**

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Code Reference ADA 213, 606, 606.5, CA 11B-606.5

Notes : Pipes Not Completely Wrapped.

Record Number 81864

Restrooms - Senior Center : Restroom , Door Signage

**Womens Restroom Next to Multipurpose Room
Female**

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 66.00 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Code Reference CA 11B-703.7.2.6

Record Number 81865

Senior Center

Restrooms - Senior Center : Restroom , Dispensers

Womens Restroom Next to Multipurpose Room

Soap

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 40.50 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 308.1, 309, 606, CA 11B-603.5

Record Number 81859

Restrooms - Senior Center : Restroom , Dispensers

Womens Restroom Next to Multipurpose Room

Feminine Products

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Code Reference ADA 205, 309, 309.4, CA 11B-309.4, 603.5

Record Number 81860

Senior Center

Drinking Fountains - Senior Center : Drinking Fountain

Drinking Fountain Next to Restrooms

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Code Reference ADA 211.2, 305, 602, CA 11B-211.2, 602

Record Number 81775

Drinking Fountains - Senior Center : Drinking Fountain

Drinking Fountain Next to Restrooms

Finding

The distance from the front edge of the unit (including bumpers) to the spout location, is greater than the allowed maximum distance.

On-Site Finding 25.00 inches

Recommendation

Make sure that the distance from the front of the fountain to the flow of the water is not greater than the allowed maximum distance.

Recommendation Up to 5.00 inches

Code Reference ADA 211, 602, 602.5, CA 11B-602.5

Record Number 81776

Senior Center

Food Service - Senior Center : Food Service

Multipurpose Room

Finding

There is less than the required percentage of accessible tables/seating provided.

On-Site Finding 1.00 tables

Recommendation

Provide the minimum required percentage of the total seating capacity with accessible seating.

Recommendation At least 20.00 tables

Code Reference ADA 206, 226.1, 305, CA 11B-226.1

Record Number 82181

Food Service - Senior Center : Food Service , Tables and Seating

Multipurpose Room

Table

Finding

The knee space at the table is less than required.

On-Site Finding 22.50 inches

Recommendation

Modify or replace one or more of the tables in the food service area to meet the required minimum accessible seating.

Recommendation At least 27.00 inches

Code Reference ADA 226, 306, 306.3.1, 902, 902.2, CA 11B-306.3, 902.2

Record Number 81805

Senior Center

**Food Service - Senior Center : Food Service ,
Counter/Condiments/Tableware**

Multipurpose Room

Food Counter

Finding

The counter/tableware/condiment counter area is not at the required height.

On-Site Finding 34.25 inches

Recommendation

Provide a tableware/condiment counter at the required height.

Recommendation Up to 34.00 inches

Code Reference ADA 902, 904.5, CA 11B-904.4, 904.5

Record Number 82182

Break/Conference Room - Senior Center : Break Room , Sink

Multipurpose Room Meal Prep

Finding

There is not enough clear floor space at the sink.

On-Site Finding 20.00 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 48.00 inches

Code Reference ADA 205, 228, 308, 309

Record Number 82213

Senior Center

Break/Conference Room - Senior Center : Break Room

Multipurpose Room Meal Prep

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Code Reference ADA 305, 306, 606.2, CA 11B-305, 306, 606.2

Record Number 82212

Break/Conference Room - Senior Center : Break Room

Multipurpose Room Meal Prep

Finding

Sink controls needs foot control to operate.

On-Site Finding None Found

Recommendation

Provide compliant controls for the sink in the break/conference room.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309

Record Number 82210

Senior Center

Break/Conference Room - Senior Center : Break Room

Multipurpose Room Meal Prep

Finding

Sink counter height does not meet the standards.

On-Site Finding 34.37 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 82211

Break/Conference Room - Senior Center : Break Room

Multipurpose Room Meal Prep

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 62.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 308, 309, CA 11B-603.5

Record Number 82214

Senior Center

Sinks - Senior Center : Sink

Handwash Station in Kitchen

Finding

Sink controls are foot operated.

On-Site Finding None Found

Recommendation

Provide compliant controls for the sink.

Recommendation See Recommendation

Code Reference ADA 205, 228, 308, 309, 309.4

Record Number 82188

Sinks - Senior Center : Sink

Handwash Station in Kitchen

Finding

There is not enough toe clearance at the sink.

On-Site Finding 0.00 inches

Recommendation

Provide minimum required toe clearance.

Recommendation At least 9.00 inches

Code Reference ADA 205, 228, 308, 309

Record Number 82191

Senior Center

Sinks - Senior Center : Sink

Handwash Station in Kitchen

Finding

Sink knee clearance does not meet the standards.

On-Site Finding 24.50 inches

Recommendation

Provide compliant sink.

Recommendation At least 27.00 inches

Code Reference ADA 205, 228, 308, 309, 606, CA 11B-306.3, 606.2

Record Number 82190

Sinks - Senior Center : Sink

Handwash Station in Kitchen

Finding

Sink counter height is not compliant.

On-Site Finding 34.50 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Code Reference ADA 606.3, CA 11B-606.3

Record Number 82189

Senior Center

Sinks - Senior Center : Sink

Handwash Station in Kitchen

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 55.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Code Reference ADA 205, 308, 309, 606, CA 11B-603.5

Record Number 82192

Vacant Land

Accessibility Survey



Vacant Land

965 Weeks
East Palo Alto, CA 94303

Date of Inspection

11/6/2017

Prepared By

Disability Access Consultants

Vacant Land

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at Weeks Street

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Record Number 86434

Vacant Land

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Weeks Street
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86435

Vacant Lot - Corner of Bay Road & University Avenue

Accessibility Survey



Vacant Lot - Corner of Bay Road & University Avenue

Bay Road & University Avenue
East Palo Alto, CA 94303

Date of Inspection

11/6/2017

Prepared By

Disability Access Consultants

Vacant Lot - Corner of Bay Road & University Avenue

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at University Avenue

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is No Public Sidewalk.

Record Number 86440

Vacant Lot - Corner of Bay Road & University Avenue

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at University Avenue
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86441

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at Bay Road

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 86442

Vacant Lot - Corner of Bay Road & University Avenue

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Bay Road
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86443

Vacant Lot - Corner of Purdue Avenue & Fordham Street

Accessibility Survey



Vacant Lot - Corner of Purdue Avenue & Fordham Street

Purdue Avenue & Fordham Street
East Palo Alto, CA 94303

Date of Inspection

11/6/2017

Prepared By

Disability Access Consultants

Vacant Lot - Corner of Purdue Avenue & Fordham Street

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at Purdue Avenue

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 86436

Vacant Lot - Corner of Purdue Avenue & Fordham Street

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Purdue Avenue
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86437

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Path of Travel from the Public Right of Way at Fordham Street

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Code Reference ADA 206, 206.2, 402.1

Notes : There is a Public Sidewalk.

Record Number 86438

Vacant Lot - Corner of Purdue Avenue & Fordham Street

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

**Path of Travel from the Public Right of Way at Fordham Street
Exterior Walkway**

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Code Reference ADA 302, 303, 403.2, CA 11B-302.1, 403.2

Record Number 86439

Facilities Included in this Report

1790 Bay Road - 11/12/2017
Bell Street Park - 11/3/2017
City Hall - Offices - 10/11/2017
Community & Economic Development
Department - 10/13/2017
Cooley Landing Park & Educational Center
- 10/10/2017
Gloria Well - 11/12/2017
Jack Farrell Park - 10/3/2017
Joel Davis Park - 10/2/2017
Maintenance Yard - 10/10/2017
Martin Luther King Jr. Park - 10/3/2017
Newbridge Pocket Park - 11/3/2017
Pad "D" - 11/6/2017
Parole Reentry Nonprofit Office/Water
Building - 10/5/2017
Police Department-Office - 10/5/2017
Police Department-Office-3 Coaches -
10/4/2017
Pump Station - 11/12/2017
Rail Spur Trail - 11/9/2017
Senior Center - 10/30/2017
Vacant Land - 11/6/2017
Vacant Lot - Corner of Bay Road &

YMCA

University Avenue - 11/6/2017
Vacant Lot - Corner of Purdue Avenue &
Fordham Street - 11/6/2017
YMCA - 10/31/2017

Prepared By

Disability Access Consultants

Prepared Using

